


Fault Code: 135

Engine Oil Pressure Sensor Circuit

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 135 PID(P): P100 SPN: 100 FMI: 3 Lamp: Yellow SRT: 00-352	More than 4.88-VDC detected at the engine oil pressure sensor signal pin 24 of the engine harness.	No engine protection for oil pressure. Centinel™ system is disabled.

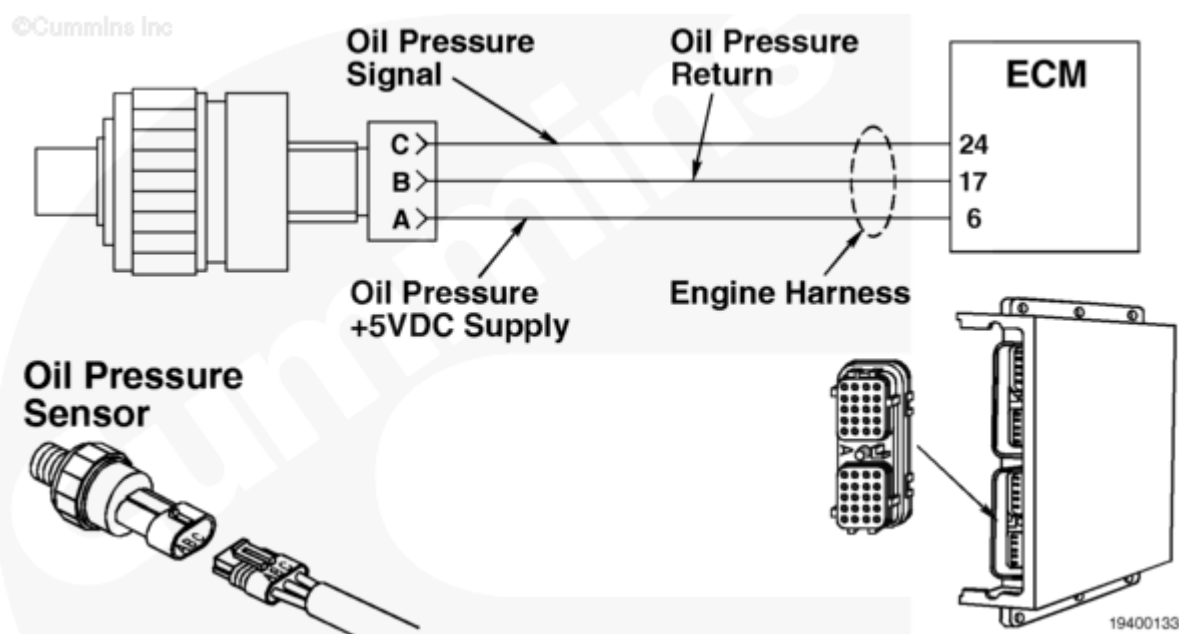

Engine Oil Pressure Sensor Circuit

Circuit Description

The engine oil pressure sensor monitors oil pressure and passes information to the ECM through pin 24 of the engine harness. The ECM monitors the voltage on pin 24 and expects to see the voltage vary between 0.5 and 4.5-VDC during normal engine operation. Voltage above 4.88-VDC on pin 24 will trip Fault Code 135 and can be caused by shorts in the supply, signal, or return wires, an open circuit in the return wire, or a failed sensor.

Component Location

The engine oil pressure sensor is located on the engine block to the upper left of the ECM.

Shoptalk

Possible causes of this fault code include:

- Malfunctioning or damaged engine oil pressure sensor
- Malfunctioning or damaged engine wiring harness

Refer to Troubleshooting Fault Code t05-135 (</qs3/pubsys2/xml/en/procedures/19/19-t05-135.html>)

Last Modified: 28-May-2026
