


Fault Code: 231

Coolant Pressure Sensor Circuit

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 231 PID(P): P109 SPN: 109 FMI: 3 Lamp: Yellow SRT: 00-387	More than 4.72-VDC detected at the coolant pressure sensor signal pin 16 of the engine harness.	No engine protection for coolant pressure.

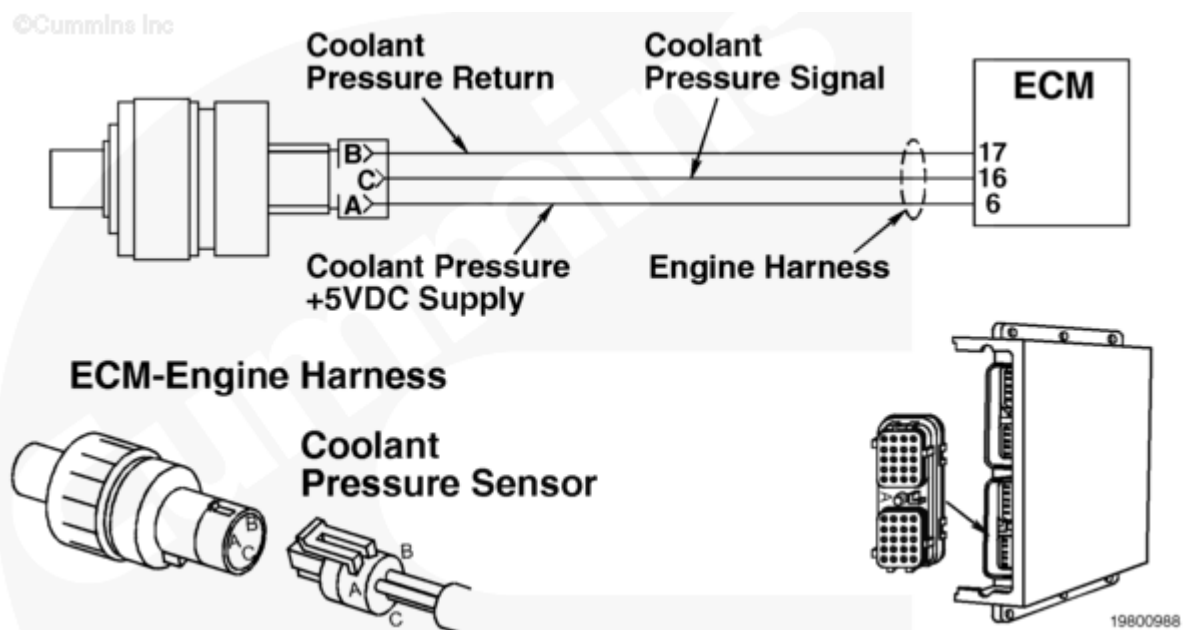

Coolant Pressure Sensor Circuit

Circuit Description

The coolant pressure sensor monitors coolant pressure and passes information to the ECM through pin 16 of the engine harness. The ECM monitors the voltage on pin 16 and expects to see the voltage vary between 0.5 and 4.5-VDC during normal operation. Voltage above 4.72-VDC on pin 16 will trip Fault Code 231 and can be caused by shorts in the supply, signal, or return wires, an open in the return wire, or a failed sensor.

Component Location

The coolant pressure sensor is located on the exhaust side of the engine, below the oil cooler.

Shoptalk

Possible causes of this fault code include:

- Malfunctioning or damaged coolant pressure sensor
- Malfunctioning or damaged engine wiring harness

Refer to Troubleshooting Fault Code t05-231 (</qs3/pubsys2/xml/en/procedures/19/19-t05-231.html>)

Last Modified: 28-May-2026
