


Fault Code: 234

Engine Overspeed

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 234 PID(P): P190 SPN: 190 FMI: 0 Lamp: Red SRT: 00-363	Engine speed signal on pin 27 and pin 28 and/or pin 37 and pin 38 of the engine harness indicates an engine speed greater than the safe operation rpm limit. The limit is 2450 rpm for the QSK19 and 2190 rpm for the QSK60.	Fuel shutoff valve de-energizes (valve closes). The valve reenergizes (fuel shutoff valve opens) when engine speed falls below its upper rpm threshold.

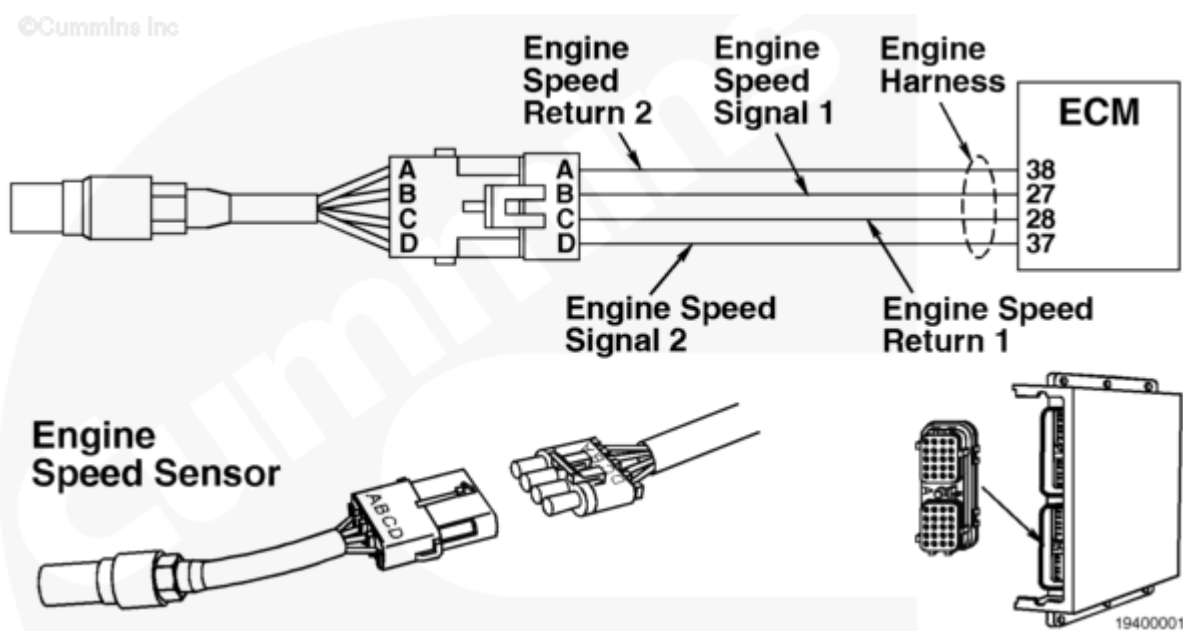

Engine Overspeed

Circuit Description

The engine position sensor monitors the engine position and the engine speed. It then passes this information to the ECM through the engine harness.

Component Location

The engine position sensor is located above the accessory drive.

Shoptalk

Inspect the intake manifold for sources of flammable vapors. Check the turbocharger seals to verify that there are no oil leaks.

- Inspect the engine position sensor for signs of damage or tampering.

Refer to Troubleshooting Fault Code t05-234 (</qs3/pubsys2/xml/en/procedures/19/19-t05-234.html>)

Last Modified: 01-Mar-2011
