

Fault Code: 294

OEM Temperature Sensor Circuit


 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 294 PID(P): P223 SPN: 1083 FMI: 4 Lamp: Yellow SRT:	VDC detected at the OEM temperature sensor signal pin 27 of the OEM interface harness indicates the sensor has failed low.	No engine protection for OEM temperature.

©Cummins Inc

OEM Interface
Connector

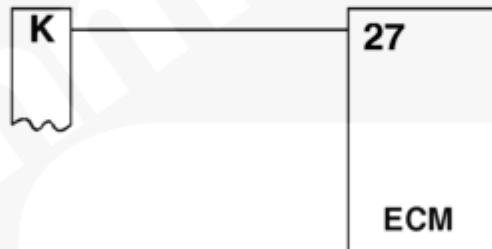

19400674

OEM Temperature Circuit

Circuit Description

The OEM sensor signal is used by the ECM to monitor the OEM temperature. The OEM temperature is used by the ECM for the engine protection system. A sensor that has failed low can be caused by shorts to ground on the supply and return wires, or an internally grounded (faulty) sensor.

Component Location

The location varies with the OEM. Refer to the OEM manual.

Shoptalk

The resistance of all temperature sensors varies with the temperature. Check the temperature thresholds using INSITE™ for QSK Series engines.

Refer to Troubleshooting Fault Code t05-294 (</qs3/pubsys2/xml/en/procedures/19/19-t05-294.html>)

Last Modified: 01-Mar-2011
