


Fault Code: 318

Fuel Pump Fueling Flow Mismatch


 Printable Version

Overview


Codes	Reason	Effect
Fault Code: 318 PID(P): S78 SPN: 931 FMI: 7 Lamp: Yellow SRT: 00-671	Fuel pump pressure and desired fuel pump pressure is not within the calibrated values.	No action is taken by the ECM.

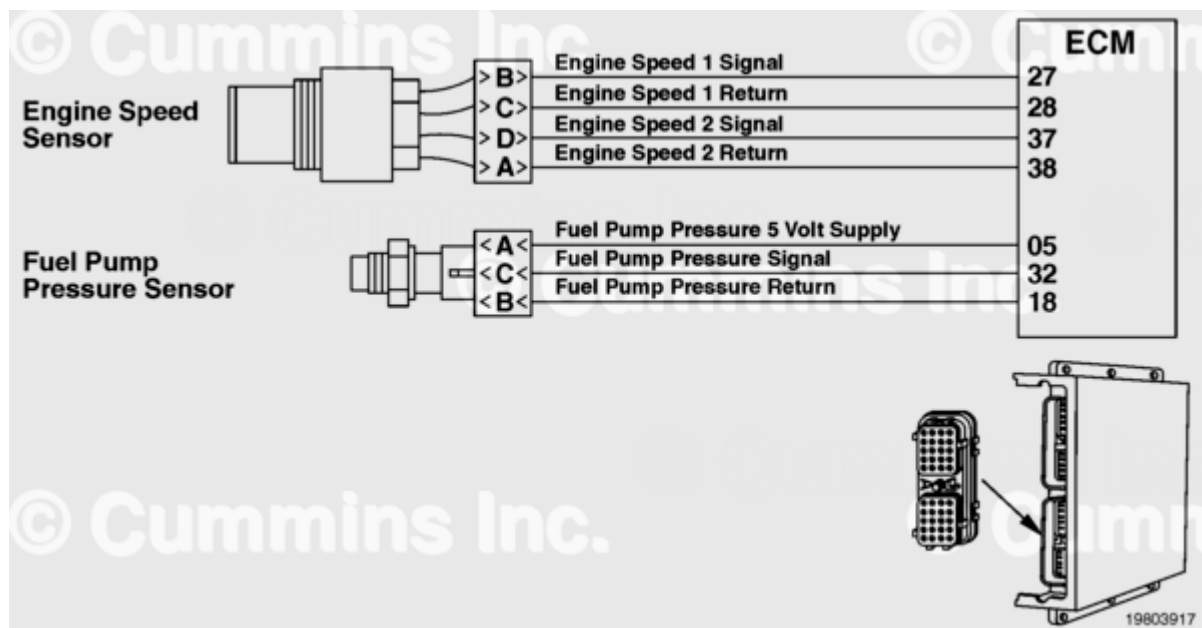


Fuel Flow Signal Circuit - QSK19 Industrial

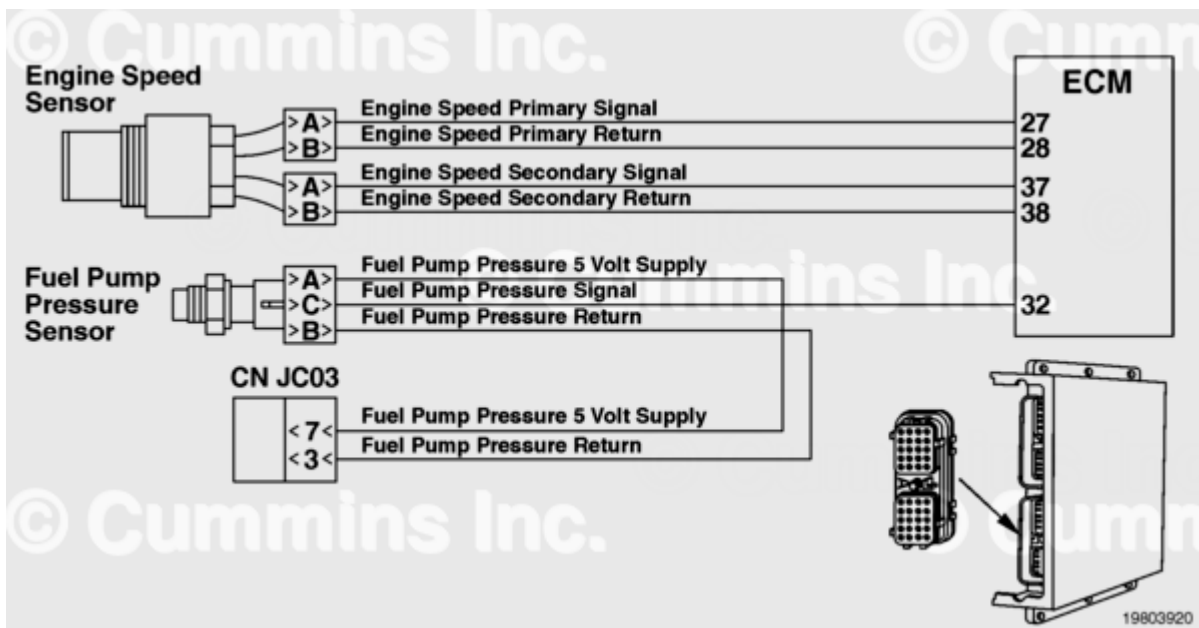


Fuel Flow Signal Circuit - QSK23 Industrial

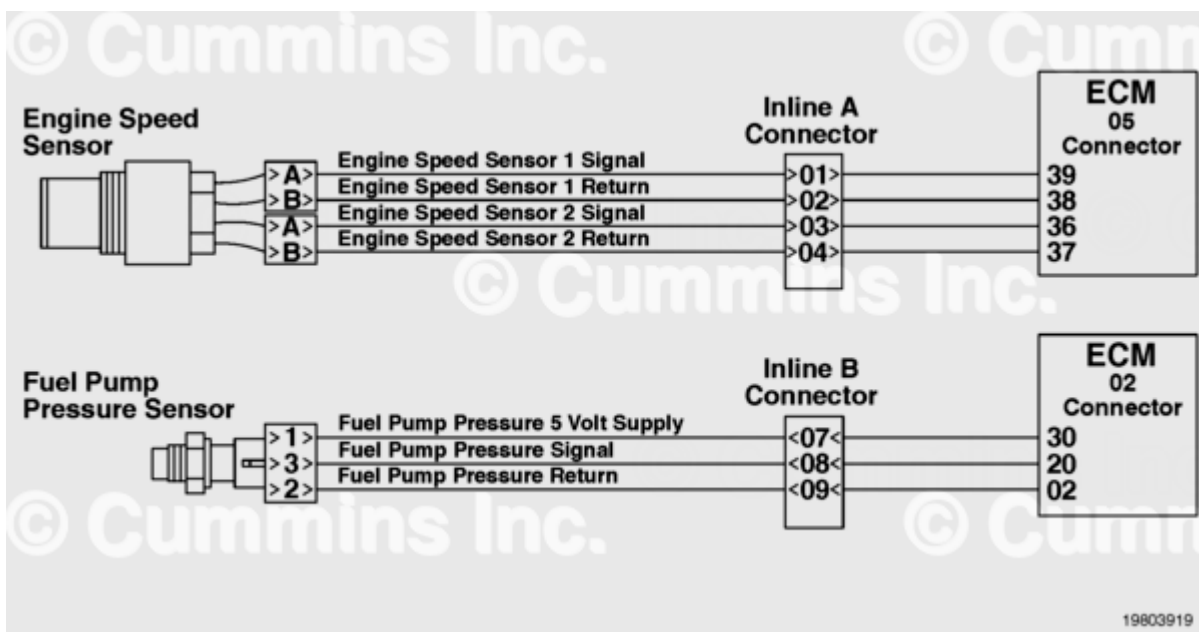


Fuel Flow Signal Circuit - QSK23 Generator Drive

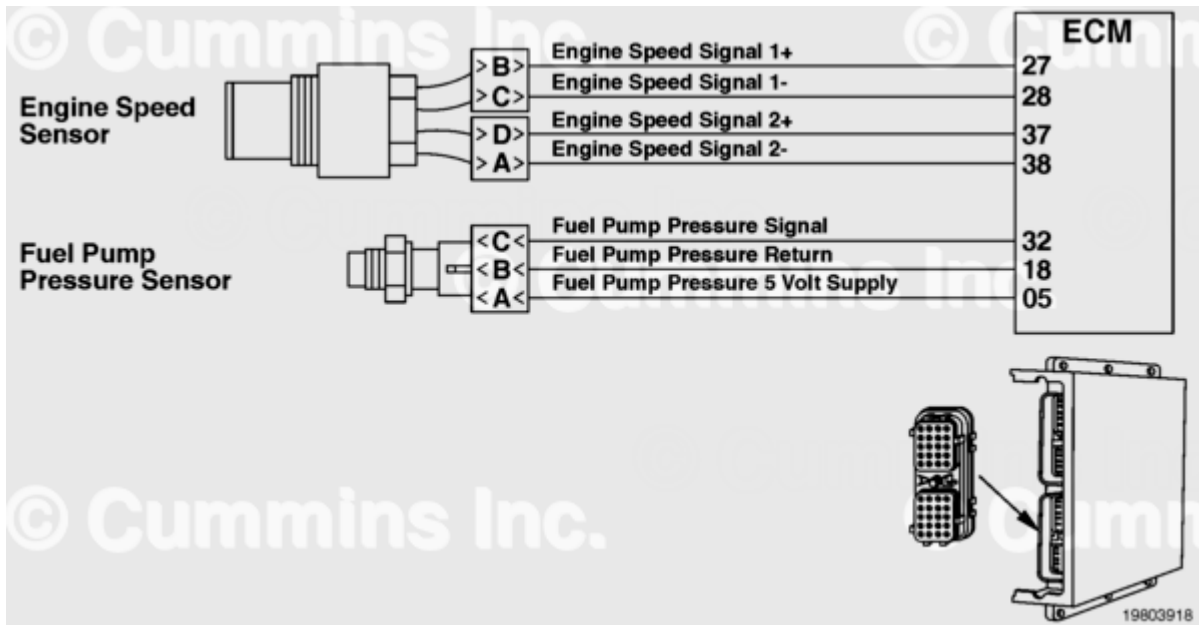

Fuel Flow Signal Circuit - QSK45 and QSK60

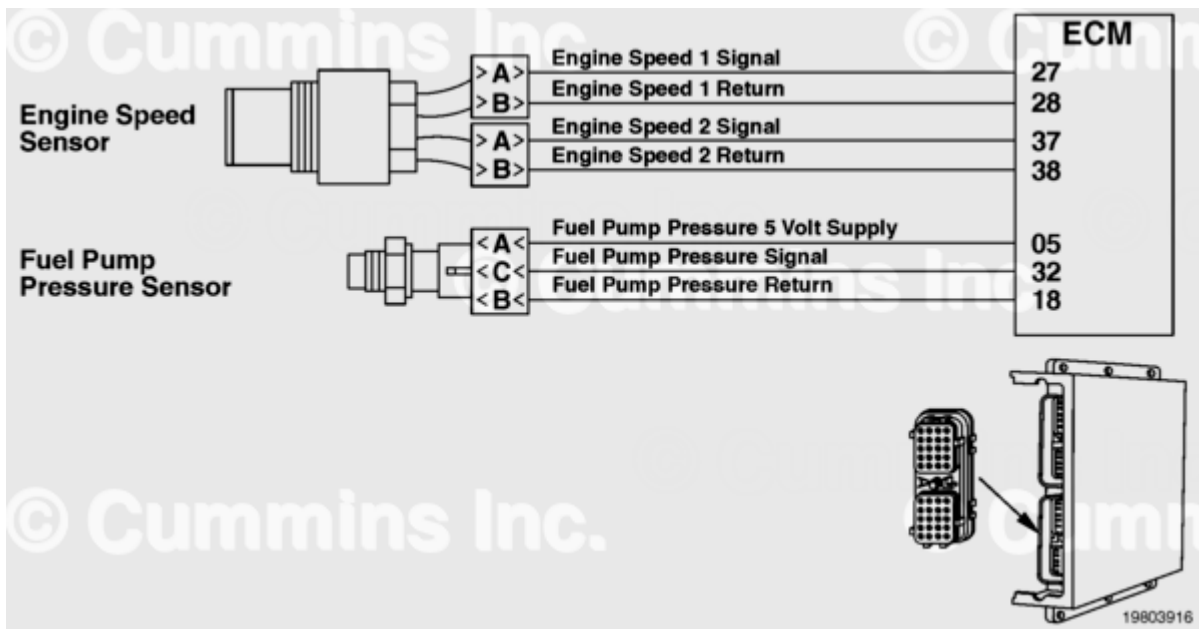

Fuel Flow Signal Circuit - QSK60

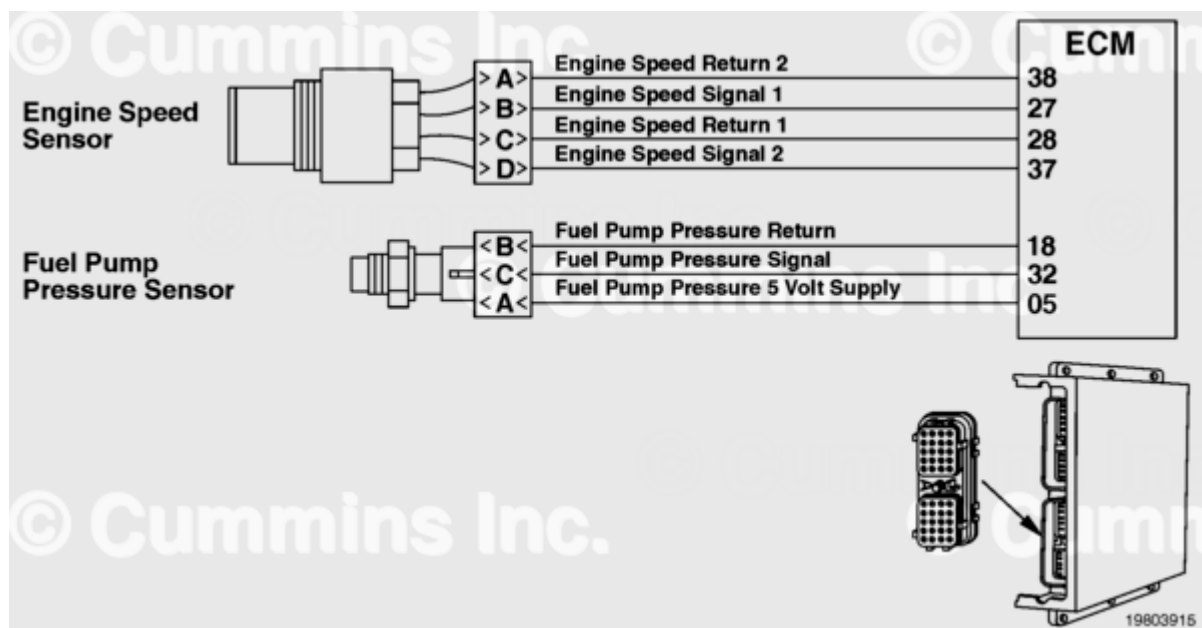

Fuel Flow Signal Circuit - QSK78

Circuit Description

The Engine Control Module (ECM) uses the fuel pump pressure signal and engine speed to estimate the actual fueling the engine is receiving, and then constantly compares this value to the desired fueling for the given speed and load.

Component Location

The fuel pump actuator is located on the fuel pump.

Conditions For Running The Diagnostics

This diagnostic runs continuously when the keyswitch is in the ON position or when the engine is running.

Conditions For Setting The Fault Codes

The Engine Control Module (ECM) detected a significant difference between actual and calculated fueling.

Action Taken When The Fault Code Is Active

- The ECM illuminates the amber CHECK ENGINE lamp immediately when the diagnostic runs and fails.

Conditions For Clearing The Fault Code

- To validate the repair, perform a key cycle, start the engine and let it idle for 1 minute.

- The fault code status displayed by the recommended Cummins® electronic service tool or equivalent will change to INACTIVE immediately after the diagnostic runs and passes.
- The ECM will turn off the amber CHECK ENGINE lamp immediately after the diagnostic runs and passes.
- It is necessary to use the "Reset All Faults" command in the recommended Cummins® electronic service tool or equivalent to clear this fault.

Shoptalk

This fault is a check on the ECM's control of the fuel pump actuator and subsequent fuel flow. If the desired fueling can **not** be met by commanding less current to the actuator, or if the desired fueling is being exceeded and can **not** be reduced by increasing the current to the actuator, then Fault Code 318 is logged.

Refer to Troubleshooting Fault Code t05-318 (</qs3/pubsys2/xml/en/procedures/19/19-t05-318.html>)

Last Modified: 04-May-2022
