


Fault Code: 753

Engine Speed Sensor Circuit

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 753 PID(P): S64 SPN: 723 FMI: 2 Lamp: Off SRT: 00-679	The engine speed signals detected on pins 27, 28, 37, and 38 of the ECM do not match.	No action by the ECM is taken.

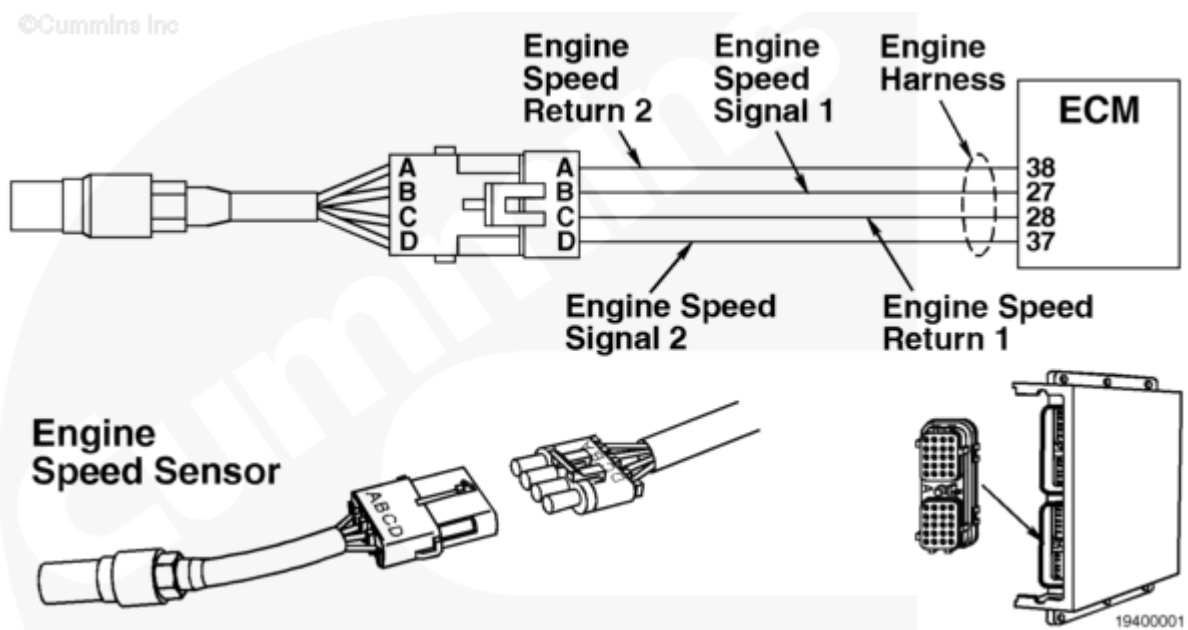

Engine Speed Sensor Circuit

Circuit Description

The engine speed sensor is a dual-coil circuit that provides the engine speed signal to the ECM through the engine harness.

Component Location

The engine speed sensor is located above the accessory drive.

Shoptalk

- If the problem occurs **only** at a certain engine temperature, be sure to check the engine speed sensor circuit while the engine is at that particular temperature.
- Measure camshaft end play to make sure that camshaft gear is **not** moving too far away from the end of the engine speed sensor.

Refer to Troubleshooting Fault Code t05-753 (</qs3/pubsys2/xml/en/procedures/19/19-t05-753.html>)

Last Modified: 18-Aug-2010
