


Fault Code: 156

Intake Manifold 2 Temperature Sensor Circuit - Voltage Above Normal or Shorted to High Source

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 156 PID(P): 105 SPN: 1131 FMI: 3 Lamp: Yellow SRT: 00-696	Intake Manifold 2 Temperature Sensor Circuit - Voltage Above Normal or Shorted to High Source. High voltage detected on SIGNAL pin 06 of the main harness A ECM connector.	Fault Code 158 is disabled.

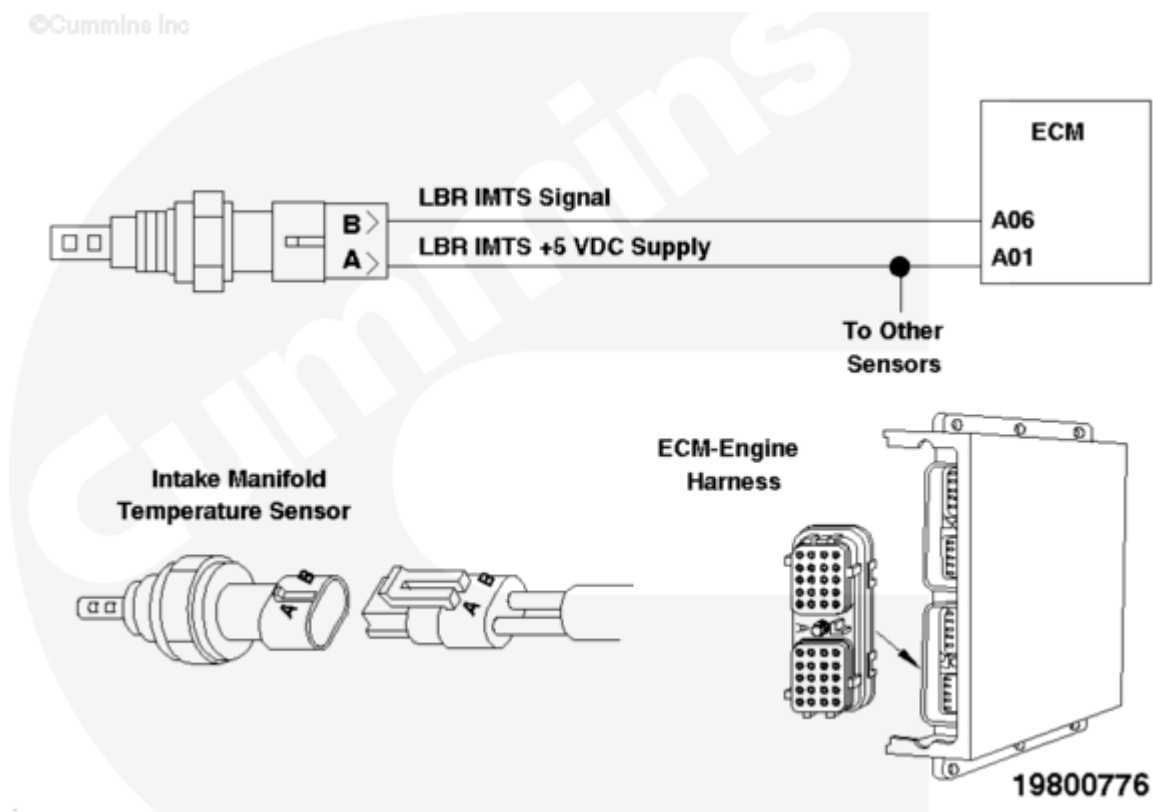

Left Bank Rear Intake Manifold Temperature Sensor Circuit

Circuit Description

The left bank rear intake manifold temperature sensor provides the left bank rear intake manifold air temperature signal to the CENSE™ ECM.

Component Location

The left bank rear intake manifold temperature sensor is located on the left bank rear intake manifold. The sensor is located downstream of the aftercooler.

Shoptalk

- The resistance of the sensor varies with temperature. The reading that you observe should compare to the following table if the sensor is functioning properly.

Temperature	Temperature	Resistance
(°C)	(°F)	(ohms)
0	32	30k to 36k
25	77	9k to 11k
50	122	3k to 4k
75	167	1350 to 1500
100	212	600 to 675

Refer to Troubleshooting Fault Code t05-156 (</qs3/pubsys2/xml/en/procedures/81/81-t05-156.html>)