



Technical Service Bulletin

Technical Service Bulletin: tsb100748

Released Date: 24-Sep-2008

Revised Lift/Priming Pump

Revised Lift/Priming Pump

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents


This Technical Service Bulletin introduces a revised Signature™, ISX, and QSX15 lift/priming pump and supersedes SPT 06T5-18.

The lift/priming pump used on all Signature™, ISX, and QSX15 engines has been updated. The gaskets, part numbers, and procedures no longer apply to ISX lift/priming pumps. Present production and service lift/priming pumps contain a number of revisions to improve quality and durability. The supply and discharge port locations have been changed. The gasket material has been updated to a more robust material and self-tapping capscrews are used to mount the pump to the support. These changes were made to reduce fuel leakage. In addition, a material change has been made to the insert that joins the impeller of the pump to the armature of the electric motor. This change was made to eliminate no start, low, and no lift/priming pump pressure conditions. Revised lift/priming pumps can be identified by the letter P at the end of the part number on the mounting support. See the illustration below. Present lift/priming pump part numbers and a cross reference can be found in SPT 08T5-13, ISX Transfer Pump Obsolete without Supersession.

The release date for the revised lift/priming pump for production is 17 January 2008.

The release date for the revised lift/priming pump for service is 17 January 2008.

The engine serial number (ESN) first is 79290014.

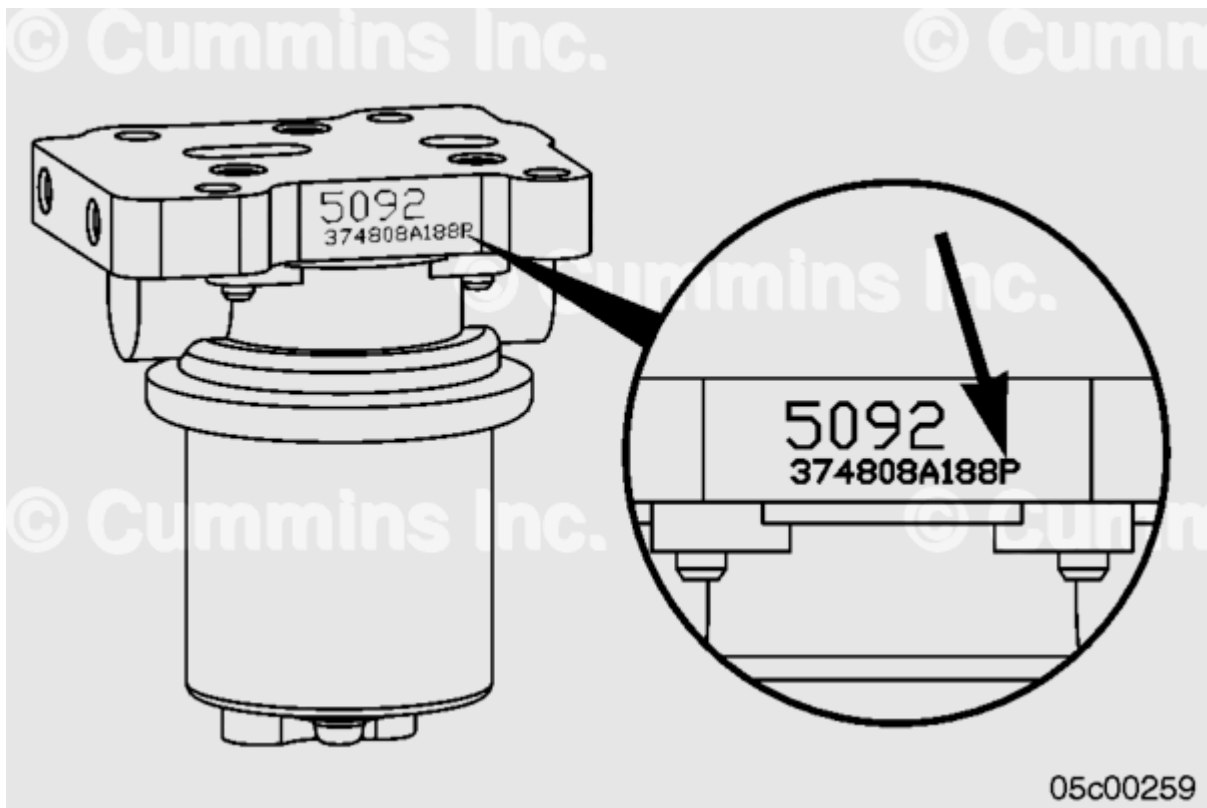

Lift/Priming Pump Part Number

Last Modified: 24-Sep-2008
