



Technical Service Bulletin

Technical Service Bulletin: tsb101752

Released Date: 05-Aug-2009

Revision to Procedure 020-012, Engine Brake Solenoid Valve

Revision to Procedure 020-012, Engine Brake Solenoid Valve

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This Service/Parts Topic introduces a change in the troubleshooting and repair Procedure 020-112, Engine Brake Solenoid Valve for the Signature, ISX, and QSX15 Engines Service Manual, Bulletin 3666239. The changes made are in the Inspect for Reuse section, to resistance check values for a 12-volt supply solenoid and to the measurement method.

Note : This is a product improvement and is not subject to campaign.

Resistance Values

The cold engine and hot engine resistance values should be between 5 and 20 ohms for solenoids that require a supply of 12 volts.


The table below indicates the old and new resistance check values for a 12-volt supply:

Engine State	Old Resistance Value	New Resistance Value
Cold	8 to 10 ohms	5 to 20 ohms
Hot	16 to 20 ohms	5 to 20 ohms

Measurement Method

In order to eliminate any measurement error, follow the steps below to check the resistance of the solenoid:

- Disconnect the wiring harness.
- Measure the resistance from the terminal to the body of the solenoid, as indicated in the illustration.

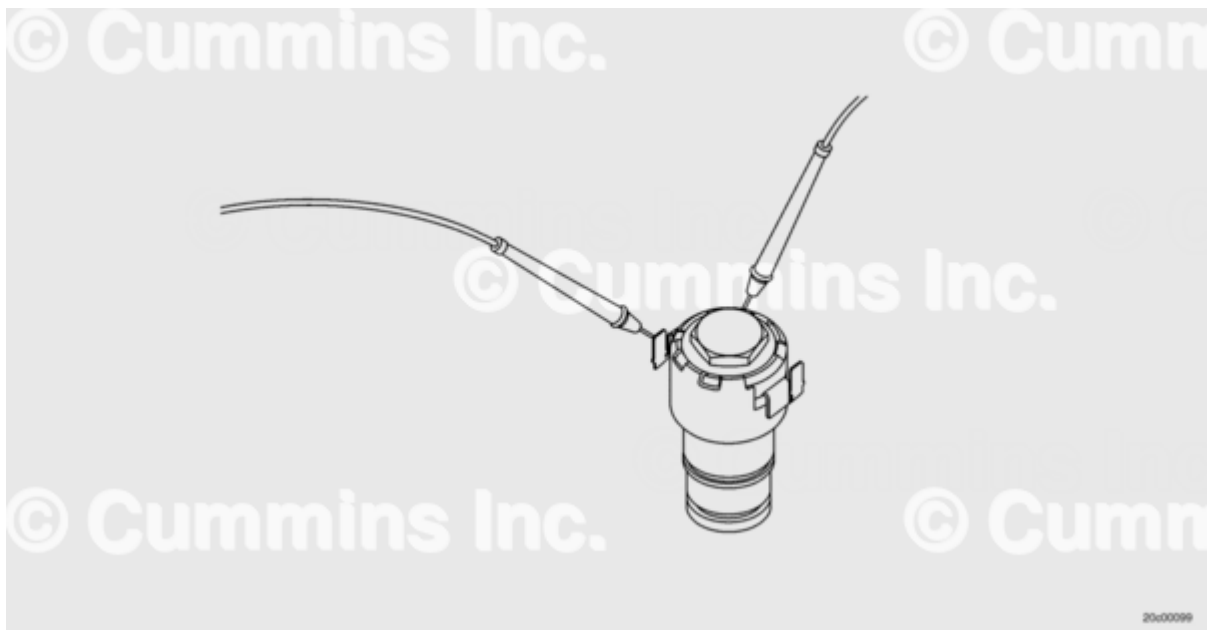

Related Procedures

10-020-012

(/qs3/pubsys2/xml/en/procedures/10/10-020-012.html)

Engine Brake Solenoid Valve

(/qs3/pubsys2/xml/en/procedures/10/10-020-012.html)

Last Modified: 05-Aug-2009