



Technical Service Bulletin

Technical Service Bulletin: TSB120004	Released Date: 18-Jan-2012
External Oil Leaks at Rocker Housing Gasket Reduced by Loctite™ 243 Applied to the Intake Port Capscrews	

External Oil Leaks at Rocker Housing Gasket Reduced by Loctite™ 243 Applied to the Intake Port Capscrews

Core Issue


External oil leaks at the ISM rocker housing gasket are partially caused by loss of capscrew load. Cyclic thermal expansion of the aluminum housing can cause the capscrews to rotate and eventually “ratchet” loose. The six short capscrews located at the intake ports are at risk for this issue.

Confirmation

External oil leakage from the rocker housing gasket, especially around the intake ports.

Resolution

If the rocker housing is removed during any repair, oil resistant medium strength thread locker, such as Loctite™ 243 or equivalent, should be used when assembling the six short capscrews located on both sides of the three intake ports. Reference the photograph below.

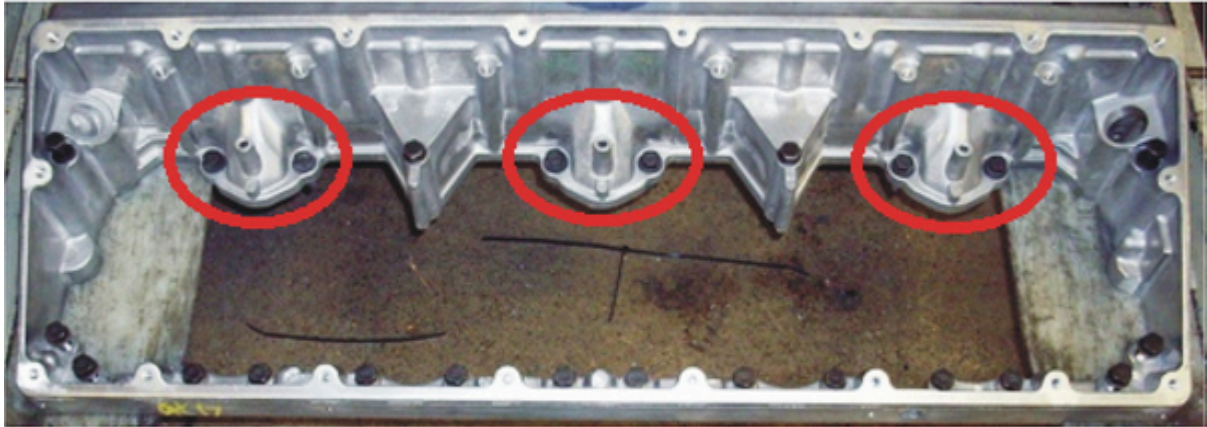

03z00005

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Document History

Date	Details
2012-1-2	Module Created

Last Modified: 18-Jan-2012
