



Technical Service Bulletin: TSB220262

Released Date: 04-Feb-2026

Debris Found in Fuel Filter Misdiagnosed as Fuel System Malfunction

## Debris Found in Fuel Filter Misdiagnosed as Fuel System Malfunction

### Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

### Contents

#### Product Affected

- B6.7 CM2350 B121B
- B6.7 CM2350 B135B
- B6.7 CM2350 B136C
- B6.7 CM2350 B141B
- B6.7 CM2350 B148B
- B6.7 CM2350 B157C
- B6.7 CM2350 B179B
- B6.7 CM2450 B155B
- B6.7 CM2670 B167B
- ISB6.7 CM2250
- ISB6.7 CM2350 B103
- ISL CM2150
- ISL8.9 CM2150 L110
- ISL9 CM2150 SN
- ISL9 CM2250
- ISL9 CM2350 L101
- ISL9 CM2350 L111
- L9 CM2350 L116B
- L9 CM2350 L119B
- L9 CM2350 L120C
- L9 CM2350 L123B
- L9 CM2350 L129C
- L9 CM2350 L133C
- L9 CM2450 L126B
- ISX12 CM2250
- ISX12 CM2350 X102

- X12 CM2350 X119B
- X12 CM2350 X144C
- X12 CM2450 X137B
- ISX15 CM2250
- ISX15 CM2250 SN
- ISX15 CM2350 X101
- X15 CM2350 X114B
- X15 CM2350 X116B
- X15 CM2450 X124B
- X15 CM2450 X134B
- X15 CM2450 X142B

### Issue Summary

#### Symptoms:

- Metal debris present in the dirty (inlet) side of any fuel filter.

#### Root Cause:

- This TSB should **only** be referenced when the fuel filter is being removed. Do **not** remove the fuel filter solely to inspect for debris.
- Metal identified in any fuel filter could be attributed to normal fuel system component wear. Debris can be ferrous or non-ferrous and is **not** considered a fuel system malfunction.
- Debris seen on the dirty (inlet) side of the fuel filter can be like what is shown in Figure 1.

### Verification

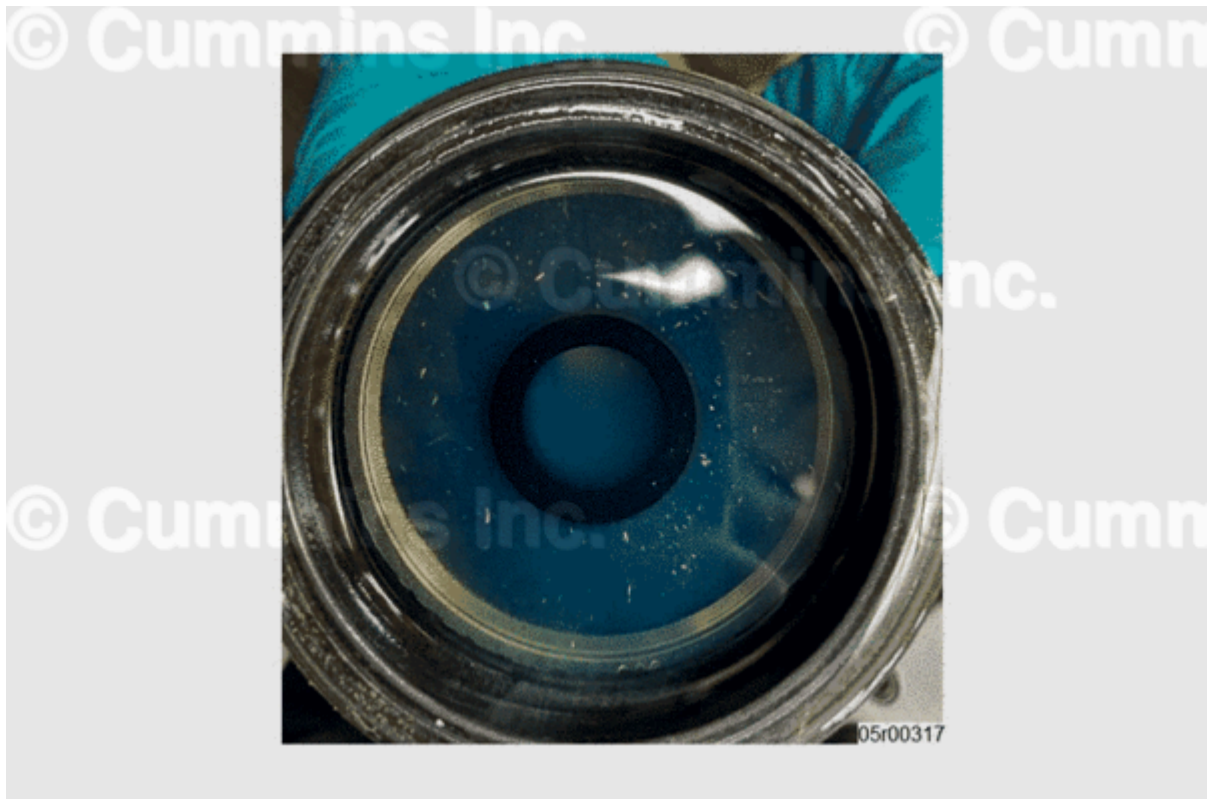


Figure 1, Example of Metallic Debris in the Dirty (Inlet) Side of the Pressure Side Fuel Filter.

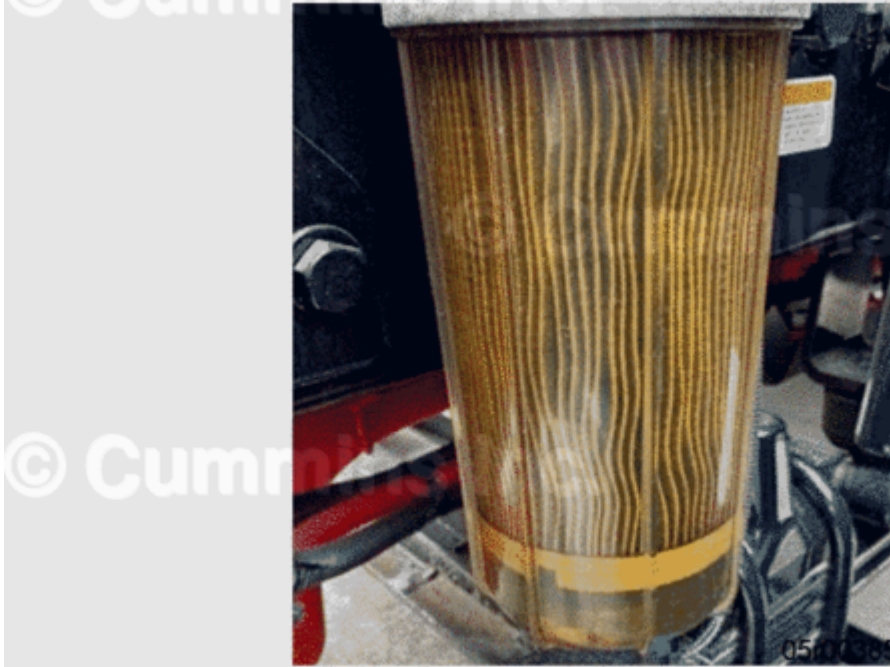


Figure 2, Example of Dirty Side of the Suction Side Fuel Filter.



Figure 3, Example of Normal Fuel Pump Gear Pump Tooth Wear.

Figure 3 is for reference **only**. **Never** disassemble the fuel pump gear pump.

### Resolution

- If engine does **not** have symptoms or fault codes, no further action is required. The presence of debris in the dirty (inlet) side of the Fuel Filter is **not** effective in identifying a fuel pump malfunction.
- If engine has symptoms or fault codes, reference published troubleshooting for the diagnosed malfunction.

### Document History

| Date       | Details                                       |
|------------|-----------------------------------------------|
| 2022-12-22 | Module Created                                |
| 2024-8-15  | Removed Stage 2 and updated Product Affected. |
| 2025-4-4   | Updated issue summary.                        |
| 2025-5-6   | Updated Symptoms and Root Cause sections.     |
| 2025-5-29  | Non-Product Problem Solving (PPS)             |
| 2026-2-2   | Added models to Product Affected              |

Last Modified: 04-Feb-2026