



Technical Service Bulletin

Technical Service Bulletin: TSB230178

Released Date: 20-Oct-2023

Improved Injector Bias Spring: Engine Runs Rough or Misfires

Improved Injector Bias Spring: Engine Runs Rough or Misfires

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- QSK23 CM500
- QSK23 CM2150
- QSK23 CM2250 K109
- QSK78 CM500
- QSK78 CM2250 K104

Issue Summary

Symptom:

- Engine runs rough or misfires.
- Increased exhaust gas temperatures: if using PrevenTech®, a warning will be issued by the PrevenTech® team to check the affected cylinder.

Root Cause:

- Injector bias springs have been manufactured with an inadequate shot peening process. This resulted in the potential for the injector bias spring to fracture during normal operation of the injector.

Verification

- Visually the injector appears undamaged, however internally the bias spring is fractured.
- Do **not** disassemble the injector.

Resolution

- Injectors with improved bias springs are now available.

Service Instructions

- All parts on hand **must** be examined and serial numbers on injectors checked to verify if they align to the clean date. See Part Identification section below.
- All suspect injectors **must** be quarantined and returned to Cummins Inc. Fuel Systems. See Part Inventory Action section below.

Part Identification

Table 1, Impacted Injector Part Numbers and Serial Number Ranges		
Injector Part Number	Suspect Injector Serial Number Range to be Quarantined	Figure Example
4326639	Serial number between 1T20000XXXX to 1T23037XXXX	1
4326640		
4902827		
4326639PX	Serial number between 010120XXX to 020723XXX	2
4326640PX		
4902827PX		

- Any injectors with a serial number between 1T20000XXXX to 1T23037XXXX **must** be quarantined.



Figure 1, New Injector Serial Number Labelling on Top Stop.

- Any injectors with a serial number between 010120XXX to 020723XXX **must** be quarantined.

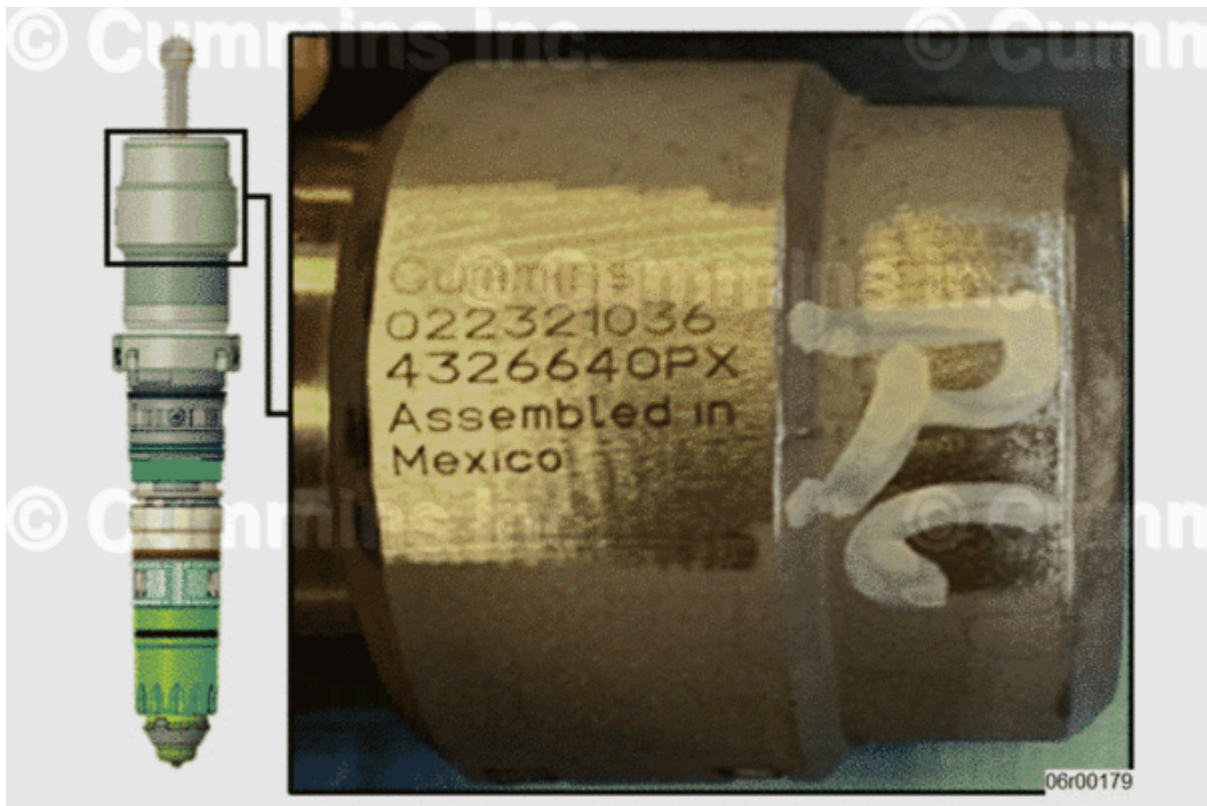


Figure 2, Recon® Injector Serial Number Labelling on Top Stop.

Part Inventory Action

In stock parts are affected. See Parts Alert 2023-128 and 2023-119 for details.

Document History

Date	Details
2023-9-13	Module Created
2023-10-18	Added 2023-119 to Part Inventory Action.

Last Modified: 20-Oct-2023
