



Technical Service Bulletin: TSB170079

Released Date: 30-Apr-2018

Incorrect Aftertreatment Part Number Etching

Incorrect Aftertreatment Part Number Etching

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

Engine:

- B6.7 CM2350 B121B
- L9 CM 2350 L116B
- X15 CM2350 X114B

Chassis Make:

- Freightliner®
- International®
- Kenworth®
- Peterbilt®

Issue

Incorrect part numbers etched on aftertreatment components.

Resolution

- Before ordering an aftertreatment diesel particulate filter (DPF), aftertreatment decomposition tube (DRT), aftertreatment diesel oxidation catalyst (DOC), or aftertreatment selective catalytic reduction (SCR) catalyst, verify aftertreatment component part numbers are correct for the specific aftertreatment system. Use Tables 1, 2, 3, and 4 below to verify part numbers.
- See Technical Service Bulletin, Adhesive Aftertreatment Main Body Gasket, TSB170070 for correct gasket part numbers.

Part Identification

- Figure 1 below displays location of entire assembly part number, which can guide in further identification of needed individual parts.
- Figure 2 below displays location of E PN and C PN on aftertreatment DOC.

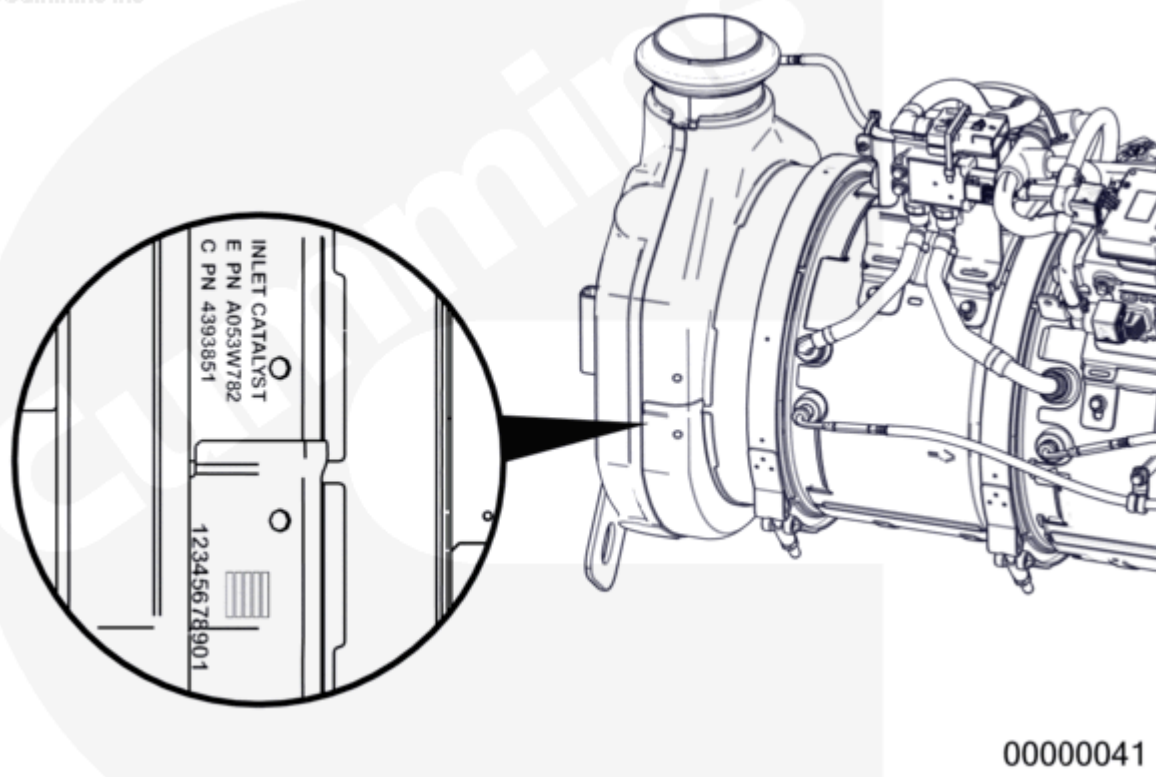


Figure 2, Aftertreatment DOC E PN and C PN Location.

Table 1, X15 CM2350 X114B: International®

Aftertreatment Assembly Part Numbers		Affected Module	Affected Aftertreatment Module Part Numbers				Clamp Part Number	Comments
E PN	C PN	Type	Incorrect EPN	Correct EPN	Incorrect CPN	Correct CPN		

Table 1, X15 CM2350 X114B: International®

A054U7 83	439439 3	DPF	A055B9 65	A055B9 53	439458 0	439457 7	530484 9	439458 0 is a DPF for a B6.7 engine; diamet er is 11.5 in. 439457 7 is a DPF for an X15 engine; diamet er is 14 in. 439457 7 must be ordered instead of 439458 0.
--------------	-------------	-----	--------------	--------------	-------------	-------------	-------------	--

Table 1, X15 CM2350 X114B: International®

A054U7 83	439439 3	DRT	A054Z3 88	A054Z3 89	439465 5	439465 4	530484 9	439465 5 is a DRT for a B6.7 engine; diamet er is 11.5 in. 439465 4 is a DRT for an X15 engine; diamet er is 14 in. 439465 4 must be ordered instead of 439465 5.
--------------	-------------	-----	--------------	--------------	-------------	-------------	-------------	--

Table 1, X15 CM2350 X114B: International®

A054U7 83	439439 3	SCR	A055V2 44	A055K0 50	439501 2	439473 7	530484 9	439501 2 is a SCR for a B6.7 engine; diamet er is 11.5 in. 439473 7 is a SCR for an X15 engine; diamet er is 14 in. 439473 7 must be ordered instead of 439501 2.
--------------	-------------	-----	--------------	--------------	-------------	-------------	-------------	--

Table 1, X15 CM2350 X114B: International®

A054U7 81	439471 7	DOC	A055J2 97	A055N 645	439475 6	439485 5	530484 9	439475 6 is a DOC for an X15 engine. 439485 5 is also a DOC for an X15 engine. Both the same diamet er and size. The only differ ence is that 439475 6 has extra OEM bracket s welded to end flange of DOC. DOC may or may not fit dependi ng on OEM truck configu ration.
--------------	-------------	-----	--------------	--------------	-------------	-------------	-------------	--

Table 1, X15 CM2350 X114B: International®

A054U781	4394717	SCR	A055V244	A058P548	4395012	5418110	5304849	4395012 is a SCR for a B6.7 engine; diameter is 11.5 in. 5418110 is an SCR for an X15 engine; diameter is 14 in. 5418110 must be ordered in place of 4395012
----------	---------	-----	----------	----------	---------	---------	---------	--

Table 2, B6.7 CM2350 B121B and L9 CM2350 L116B: Kenworth™ and Peterbilt™

Aftertreatment Assembly Part Numbers		Affected Module	Affected Aftertreatment Module Part Numbers				Clamp Part Number	Comments
E PN	C PN	Type	Incorrect EPN	Correct EPN	Incorrect CPN	Correct CPN		

Table 2, B6.7 CM2350 B121B and L9 CM2350 L116B: Kenworth™ and Peterbilt™

A052V104	4394889	DOC	A055B958	A055B956	-	4394578	5272750	4394578 was etched on DOC correctly. EPN was etched incorrectly. Low risk because part ordering is done using CPN and not EPN.
A052V104	4394889	DOC	A055H761	A055M761	-	4394840	5272750	4394840 was etched on DOC correctly. EPN was etched incorrectly. Low risk because part ordering is done using CPN and not EPN.

Table 3, B6.7 CM2350 B121B and L9 CM2350 L116B: Freightliner®[illegible]

Sl. No.	Name of the Candidate	Roll No.	Grade	Subject	Score	Remarks
1						
2						
3						
4						
5						
6						
7						
8						
9						
10						
11						
12						
13						
14						
15						
16						
17						
18						
19						
20						
21						
22						
23						
24						
25						
26						
27						
28						
29						
30						
31						
32						
33						
34						
35						
36						
37						
38						
39						
40						
41						
42						
43						
44						
45						
46						
47						
48						
49						
50						
51						
52						
53						
54						
55						
56						
57						
58						
59						
60						
61						
62						
63						
64						
65						
66						
67						
68						
69						
70						
71						
72						
73						
74						
75						
76						
77						
78						
79						
80						
81						
82						
83						
84						
85						
86						
87						
88						
89						
90						
91						
92						
93						
94						
95						
96						
97						
98						
99						
100						

Table 3, B6.7 CM2350 B121B and L9 CM2350 L116B: Freightliner®

A054M 325	439492 3	DPF	A055B9 65	A055B9 56	439458 0	439457 8	527275 0	439458 0 is a DPF for a B6.7 engine. 439457 8 is a DPF for an L9 engine. Both part number s have same diamet er but differen t lengths. 439458 0 will physica lly fit but when aftertre atment system is installe d onto vehicle total length will be too short by 5.5 in.
--------------	-------------	-----	--------------	--------------	-------------	-------------	-------------	---

Table 4, B6.7 CM2350 B121B and L9 CM2350 L116B: International®

Aftertreatment Assembly Part Numbers		Affecte d Module	Affected Aftertreatment Module Part Numbers				Clamp Part Numbe r	Comme nts
E PN	C PN	Type	Incorre ct EPN	Correct EPN	Incorre ct CPN	Correct CPN		
A054U2 13	439436 6	SCR	A055H 540	A055H 450	-	439469 7	527275 0	439469 7 was etched on SCR correctl y. EPN was etched incorre ctly. Low risk becaus e part orderin g is done using CPN and not EPN.

Table 4, B6.7 CM2350 B121B and L9 CM2350 L116B: International®

A054U2 06	439436 0	DOC	A053F2 40	A055F2 40	-	439467 6	527275 0	439467 6 was etched on DOC correctl y. EPN was etched incorre ctly. Low risk becaus e part orderin g is done using CPN and not EPN.
A054U2 07	439436 1	DOC	A053F2 40	A055F2 40	-	439467 6	527275 0	439467 6 was etched on DOC correctl y. EPN was etched incorre ctly. Low risk becaus e part orderin g is done using CPN and not EPN.

Table 4, B6.7 CM2350 B121B and L9 CM2350 L116B: International®								
A054U2 12	439436 5	SCR	A055H 247	A055H 427	-	439469 6	527275 0	439469 6 was etched on SCR correctl y. EPN was etched incorre ctly. Low risk becaus e part orderin g is done using CPN and not EPN.

Document History

Date	Details
2017-6-19	Module Created
2017-8-28	Added Part Identification section. Updated Tables 1, 2, 3, and 4 with clamp part number. Added Figure 1 and Figure 2.
2018-3-29	Added SCR rows to A054U783 and A054U781
2018-4-25	Added additional Aftertreatment Assembly Part Numbers

Last Modified: 30-Apr-2018
