



Technical Service Bulletin: TSB170102

Released Date: 26-Sep-2017

Belt Shredding: Charging System Alternator Out of Alignment

Belt Shredding: Charging System Alternator Out of Alignment

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Information Only - OEM Related Matter Not Covered By Cummins® - Contact Appropriate OEM Dealer or OEM Representative For Additional Information

Contents

Product Affected

- X15 CM2350 X114B
- X15 CM2350 X116B

Issue

Symptom:

- Belt shredding beginning on inside rib (closest to cab of truck)

Root Cause:

- Charging system alternator is **not** properly aligned

Verification

- Use a laser alignment tool to confirm charging system alternator is **not** properly aligned.

Resolution

- If charging system alternator is **not** properly aligned, four charging system alternator mounting capscrews **must** be loosened and torqued starting with bottom right capscrew and continuing **counterclockwise**.
 - See Figure 1 below for charging system alternator capscrew torquing sequence.
 - For charging system alternator capscrew torque specifications, see corresponding Service Manual. Reference Procedure 013-001 in Section 13.
- After following charging system alternator capscrew tightening sequence outline above, use laser alignment tool to confirm charging system alternator is properly aligned.

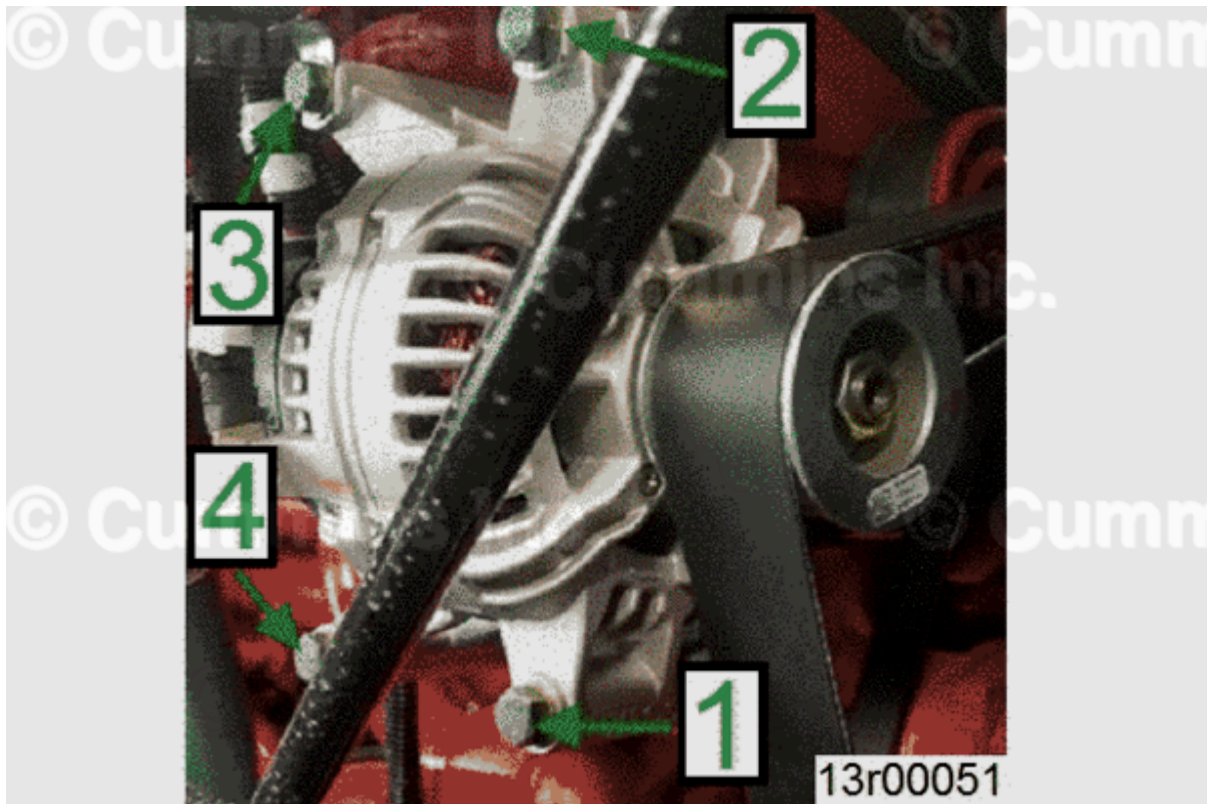


Figure 1, Charging System Alternator Mounting Torque Sequence.

Document History

Date	Details
2017-9-21	Module Created

Last Modified: 26-Sep-2017
