



Technical Service Bulletin

Technical Service Bulletin: TSB200008

Released Date: 26-Jul-2020

Introduction of Turbocharger Actuator Boot Cover Service Kit

Introduction of Turbocharger Actuator Boot Cover Service Kit

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- X15 CM2350 X114B
- X15 CM2350 X116B

Description of Change

This document announces a new turbocharger actuator boot cover service kit, Part Number 5579449.

Reason for Change

Turbocharger actuator corrosion found due to water intrusion through actuator connector.

Service Instructions

Turbocharger actuators without a boot cover and with Fault Code 1894 active, **must** have a boot cover installed.

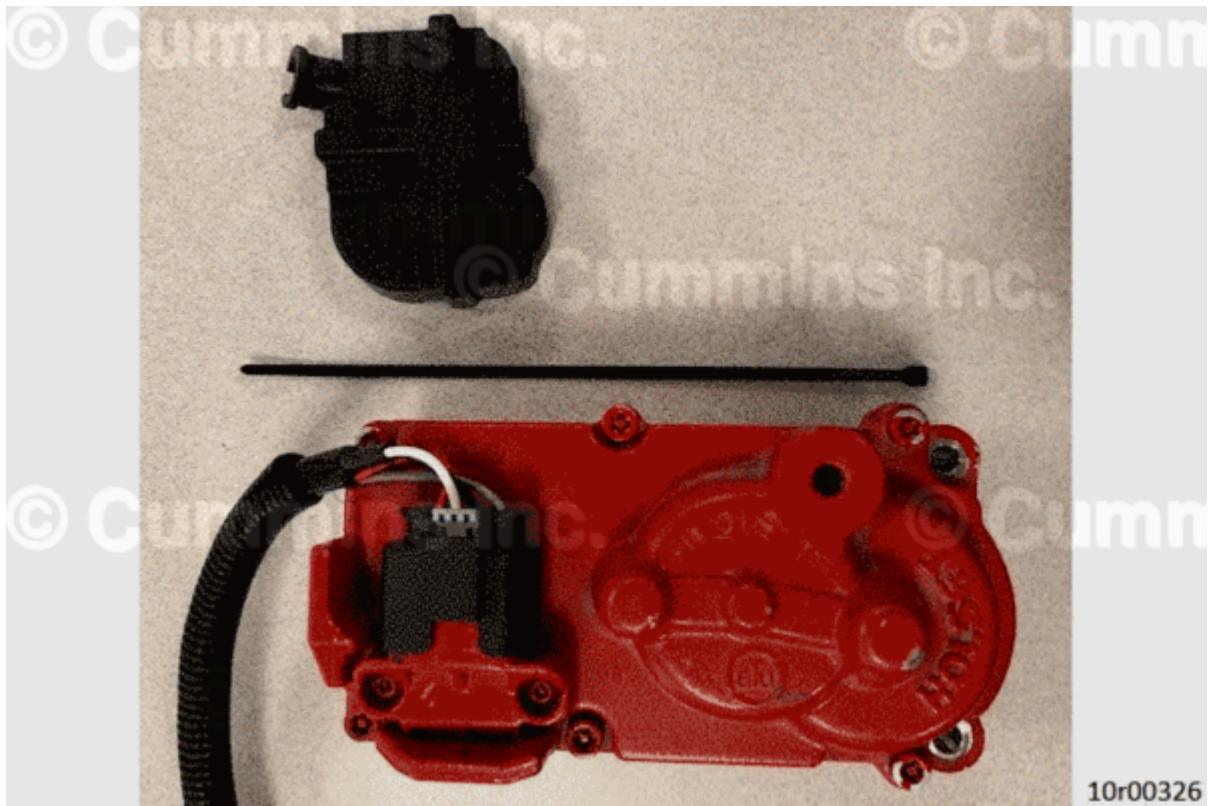


Figure 1, Boot Cover and Zip Tie

Prior to installing boot cover, make sure grey tab is fully inserted (clip locked) into the black connector.

1. Incorrect: grey tab **not** fully inserted.
2. Correct: grey tab fully inserted.

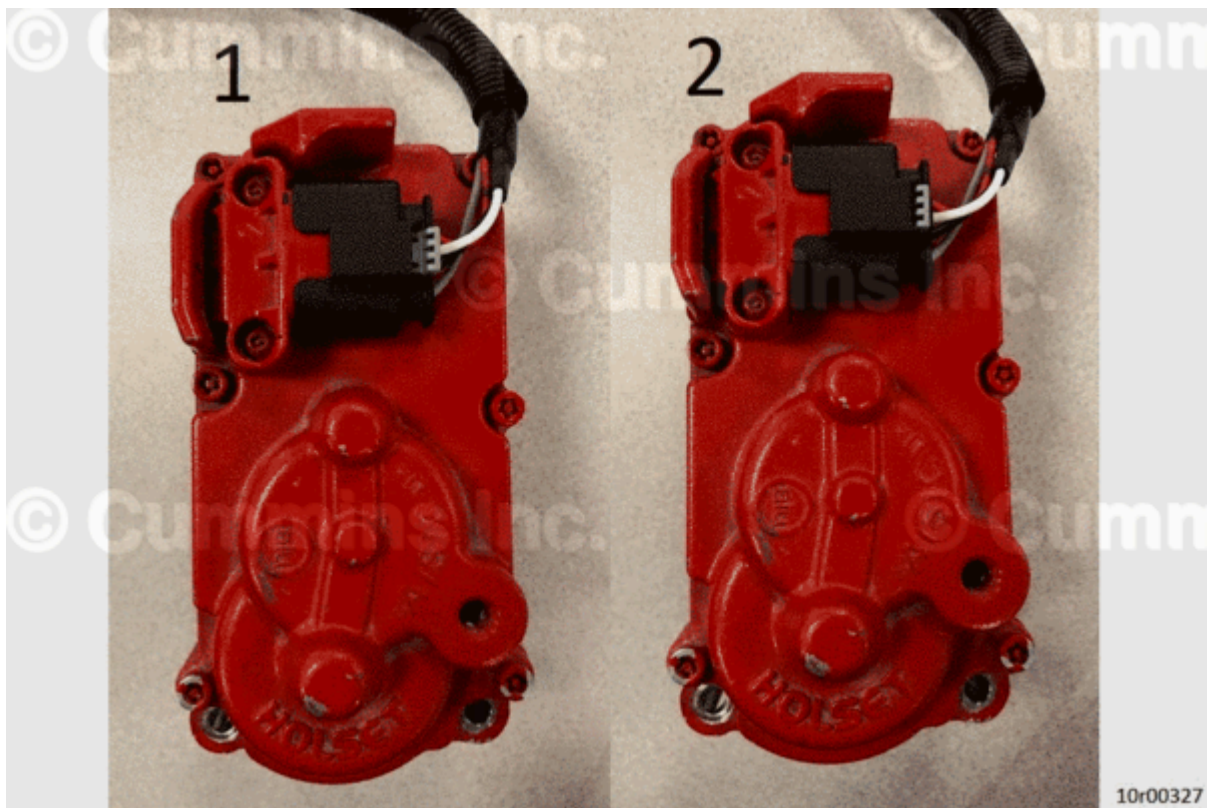


Figure 2, Location of Grey Tab

Place boot cover, Part Number 5566729, on top of turbocharger actuator connector, as shown below, and make sure boot cover is fully seated.

Secure zip tie, Part Number 3691058, around boot cover and corrugated harness sleeve. Pull snug and cut end of zip tie.



Figure 3, Boot Cover Correctly Installed

Service Parts Availability

Service parts are available. See Table 1 for part numbers.

Table 1, Service Parts

Part Description	Existing Part Number	Obsolete	Superseded	New Part Number
KIT,UPFIT	Not Applicable	No	No	5579449

Production Status

Implemented for production. See Table 2.

Table 2, Production Information

ESN First	Build Date ¹	Plant
80231278	3 December 2019	Jamestown Engine Plant

¹Engine build date can be found on the engine dataplate.

Associated Publications

Table 3, Publications Affected					
Manual Type	Engine	Bulletin Number	Procedure Title	Procedure	Section
Service Manual	X15 CM2350 X114B	5411181	Variable Geometry Turbocharger Actuator, Electric	Refer to Procedure 010-134 (/qs3/pubsys2/xml/en/procedures/377/377-010-134.html)	10
Service Manual	X15 CM2350 X116B	5411186	Variable Geometry Turbocharger Actuator, Electric	Refer to Procedure 010-134 (/qs3/pubsys2/xml/en/procedures/453/453-010-134.html)	10

Document History

Date	Details
2020-1-13	Module Created
2020-7-14	Changed from Group 11 to Group 10.

Last Modified: 26-Jul-2020
