



Technical Service Bulletin: TSB240227

Released Date: 18-Nov-2024

Aftertreatment Diesel Exhaust Fluid (DEF) Dosing Valve Inlet Filter with Fault Code(s) 1682 and 7325

Aftertreatment Diesel Exhaust Fluid (DEF) Dosing Valve Inlet Filter with Fault Code(s) 1682 and 7325

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- B6.7 CM2350 B121B
- B6.7 CM2450 B155B
- L9 CM2350 L116B
- L9 CM2450 L126B
- X12 CM2350 X119B
- X12 CM2450 X137B
- X15 CM2350 X114B
- X15 CM2350 X116B
- X15 CM2450 X124B
- X15 CM2450 X134B
- X15 CM2450 X142B

Issue Summary

Symptom:

- Fault Code 1682
- Fault Code 7325

Root Cause:

- Aftertreatment diesel exhaust fluid (DEF) dosing valve inlet filter blocked or restricted leading to improper DEF dosing unit replacement.

Verification

- There is an inlet filter in both the aftertreatment DEF dosing unit, Figure 3 and 4, and aftertreatment DEF dosing valve, Figure 1 and 2.

- Replace the aftertreatment DEF dosing valve inlet filter. Refer to Procedure 011-059 in Section 11 of the corresponding service manual.

Part Identification



Figure 1, UL2.0 DEF Dosing Valve Inlet Filter Location



Figure 2, UL2.2 DEF Dosing Valve Inlet Filter Location

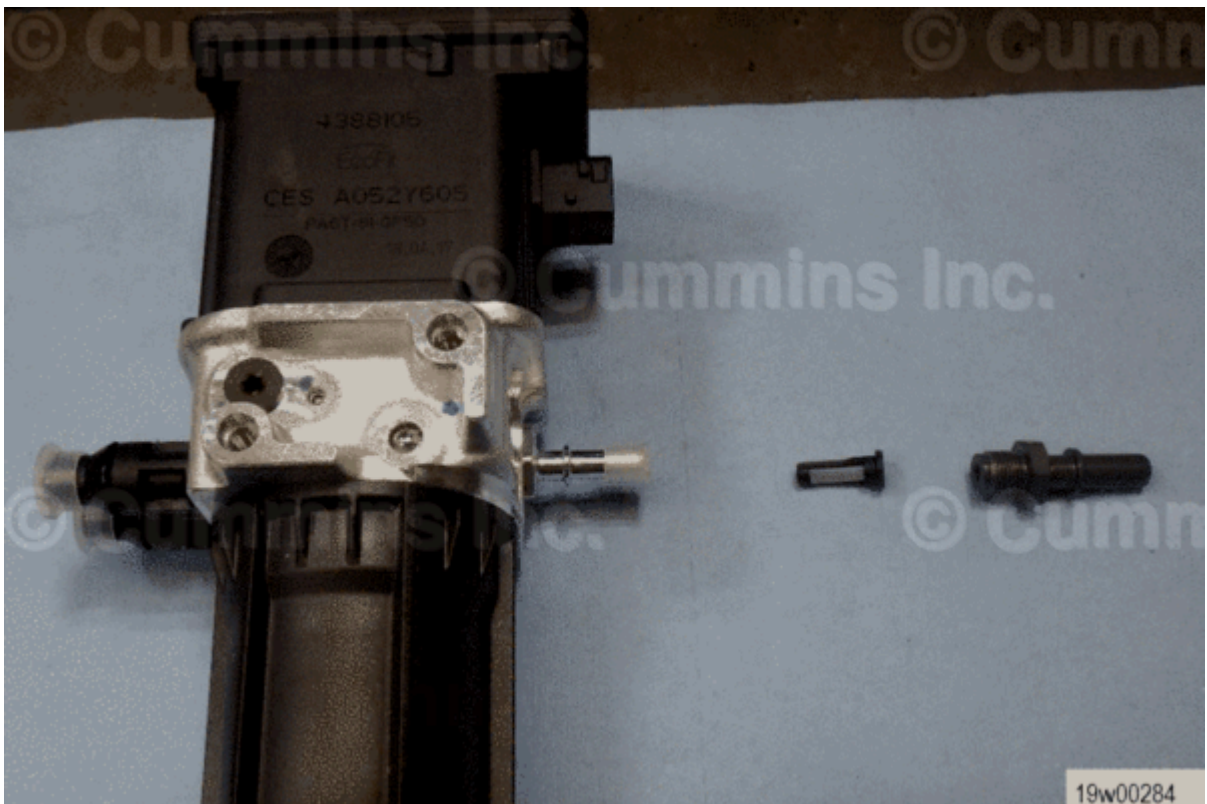


Figure 3, UL2.0 DEF Dosing Unit Inlet Filter Location

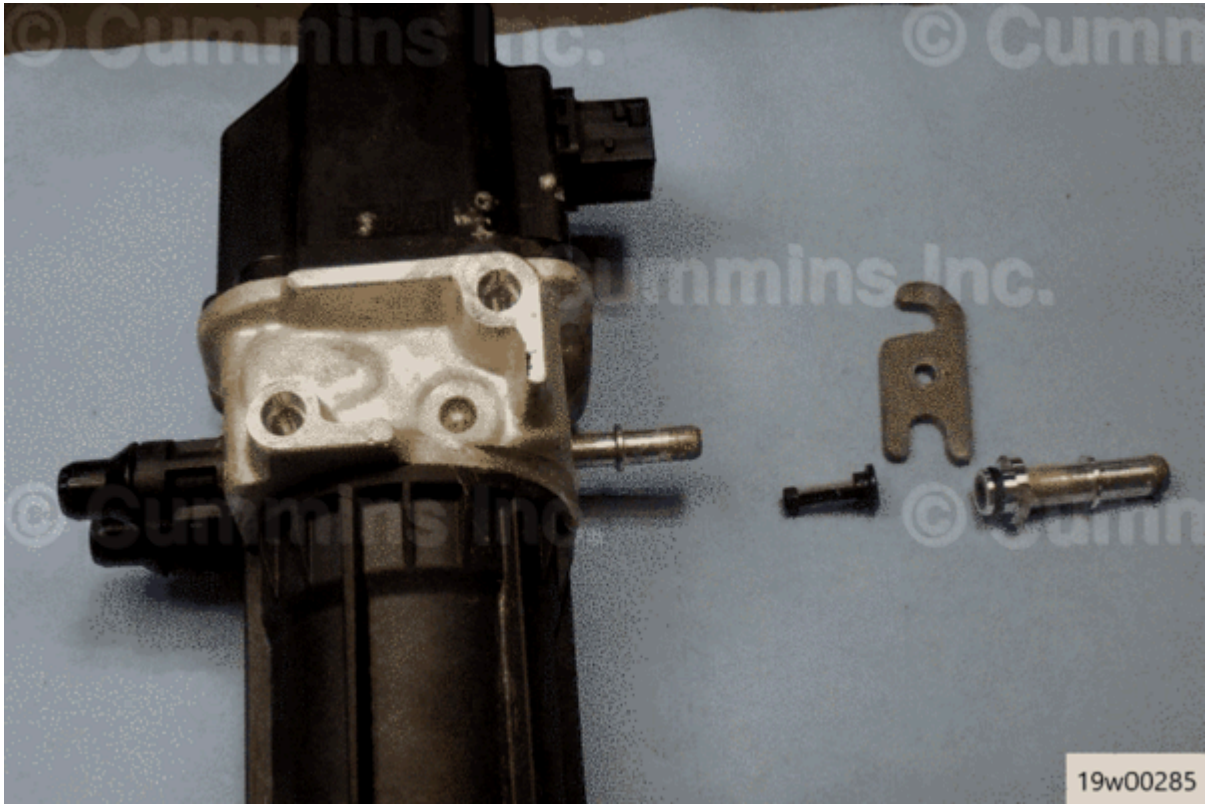


Figure 4, UL2.2 DEF Dosing Unit Inlet Filter Location

Document History

Date	Details
2024-11-15	Module Created

Last Modified: 18-Nov-2024
