


Trainings ▾


Initial Check

Connect an electronic service tool to the vehicle datalink.

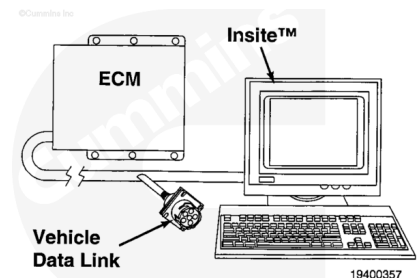


Install a 0-2030 mm-Hg [0-80 in-Hg] manometer (or gauge) in the [3/8-inch] pipe plug hole in the aftercooler housing.

Do **not** drill and tap a hole in the aftercooler cover. A faulty reading can result if the aftercooler core is leaking.

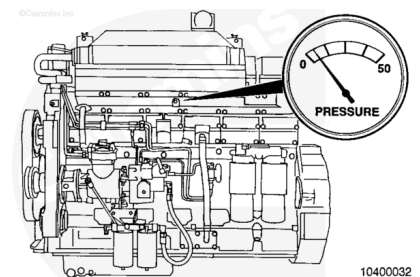


Operate the engine at rated rpm and full load. Compare the reading from the electronic service tool to the gauge reading. If the electronic service tool reading differs by more than 2 in Hg from the gauge reading, then replace the intake manifold pressure sensor.

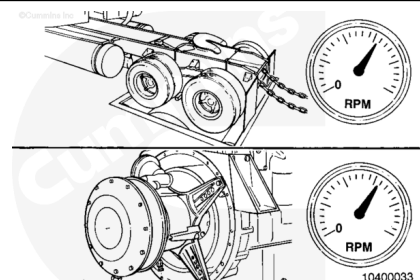

Remove

Lift up on the tab and disconnect the connector from the sensor.

Remove the sensor from the air intake manifold with deep flank drive socket, Part Number 3823843.

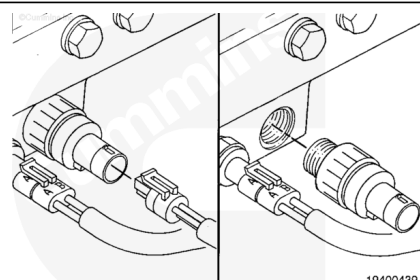


Install

Make sure the new sensor has an o-ring around the surface where it seals against the air intake manifold.

Install the sensor into the air intake manifold by turning it **clockwise**.

Torque Value: 14 n•m [124 in-lb]

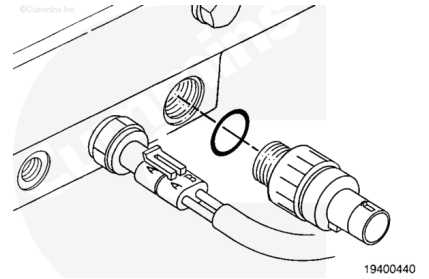

Push the harness connector into the sensor until it locks.

