


Fault Code: 133

Remote Accelerator Position Sensor: CELECT™-Type Accelerator Pedal or Lever

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 133 PID(P): P29 SPN: 029 FMI: 3 Lamp: Red SRT: 00-385	More than 4.82 VDC detected at the remote throttle position signal pin 30 of the OEM interface harness.	Calibration-dependent power and speed derate.

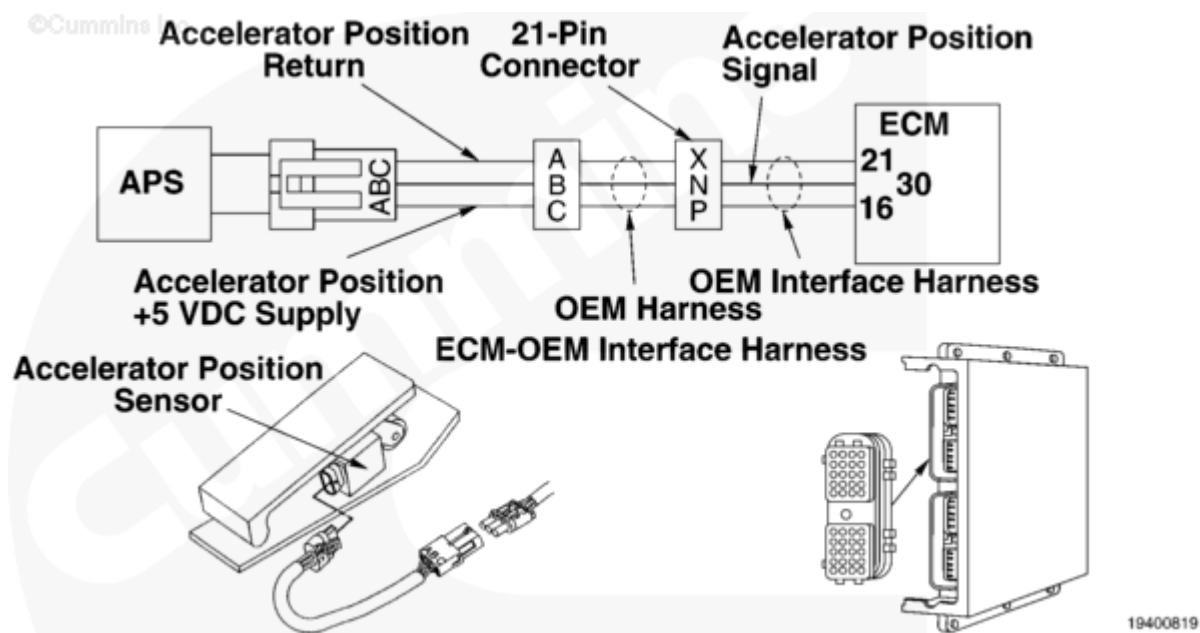

Remote Accelerator Position Sensor: CELECT™-Type Accelerator Pedal or Lever

Circuit Description

The remote accelerator pedal or lever provides the operator's accelerator pedal or lever command to the ECM through the OEM harness and the OEM interface harness. The ECM uses this signal to determine the fueling command for the fuel rail actuator valve.

Component Location

The accelerator pedal or lever location varies with each OEM. Refer to the OEM manual.

Shoptalk

The accelerator pedal or lever position sensor is a potentiometer. The resistance specifications of the accelerator pedal or lever position sensor are the following:

- Between supply and return = 2000 to 3000 ohms.
- Between supply and signal: Released = 1500 to 3000 ohms; Depressed = 200 to 1500 ohms.

Note: If the accelerator pedal or lever or accelerator pedal or lever position sensor is changed, or after a calibration download, cycle the accelerator pedal or lever (turn keyswitch ON) through its complete travel three times. This procedure calibrates the new accelerator pedal or lever with the ECM.

Refer to Troubleshooting Fault Code t05-133 (</qs3/pubsys2/xml/en/procedures/19/19-t05-133.html>)