


Fault Code: 237

Multiple-Unit Synchronization

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 237 PID(P): S30 SPN: 644 FMI: 2 Lamp: Yellow SRT: 00-395	Duty cycle of input throttle signal pin 17 of the OEM interface harness is less than 3 percent or more than 97 percent.	The primary engine and secondary engines are shut down with increasing time after alert if hard-coupled. Only the secondary engines are shut down with increasing time after alert if soft-coupled.

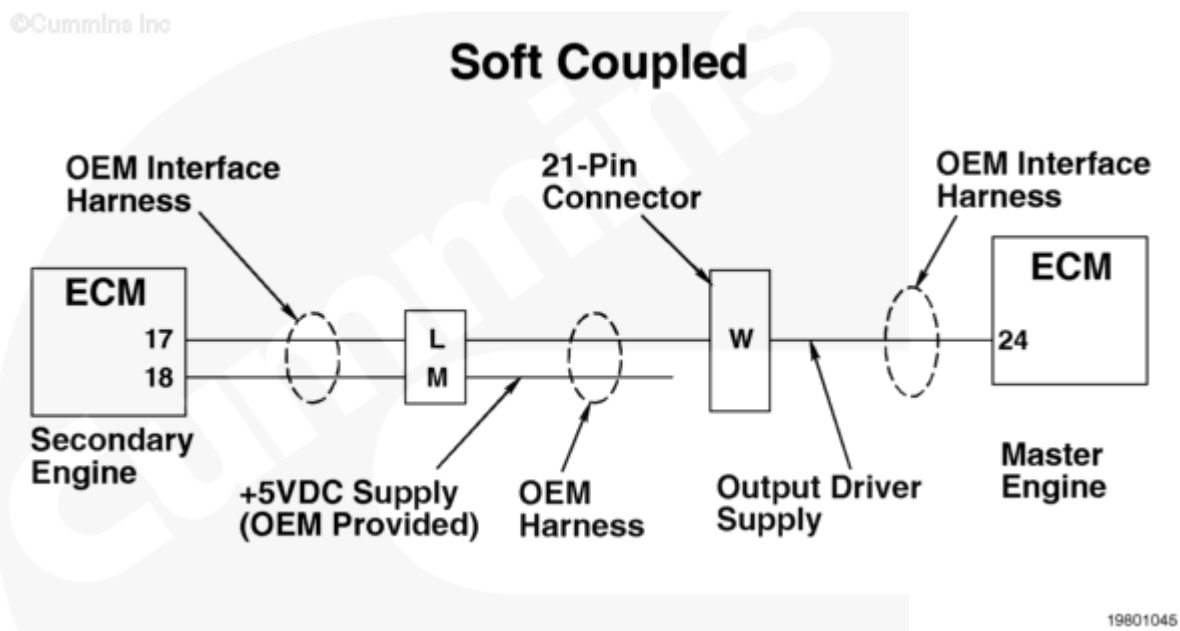

Multiple-Unit Synchronization Circuits: Soft-Coupled, Hard-Coupled, and Soft-Coupled Marine

Circuit Description

The primary engine outputs a throttle duty cycle signal on pin 24. This signal is received by the secondary engine(s) and is used as the throttle input. To complete this circuit, a +5-VDC supply is provided by the OEM and connected to pin 18 of the secondary engine.

Component Location

The PWM output supply is located in the OEM interface harness.

Shoptalk

The secondary engine expects to see a duty cycle signal that varies between 3 and 97 percent. A signal less than 3 percent or greater than 97 percent will generate Fault Code 237 in the secondary engine.

Refer to Troubleshooting Fault Code t05-237 (</qs3/pubsys2/xml/en/procedures/19/19-t05-237.html>)

Last Modified: 01-Mar-2011
