


Fault Code: 442

Unswitched Battery Supply Circuit

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 442 PID(P): P168 SPN: 168 FMI: 0 Lamp: Yellow SRT: 00-373	More than 38.0-VDC battery voltage detected at the ECM.	ECM damage will occur.

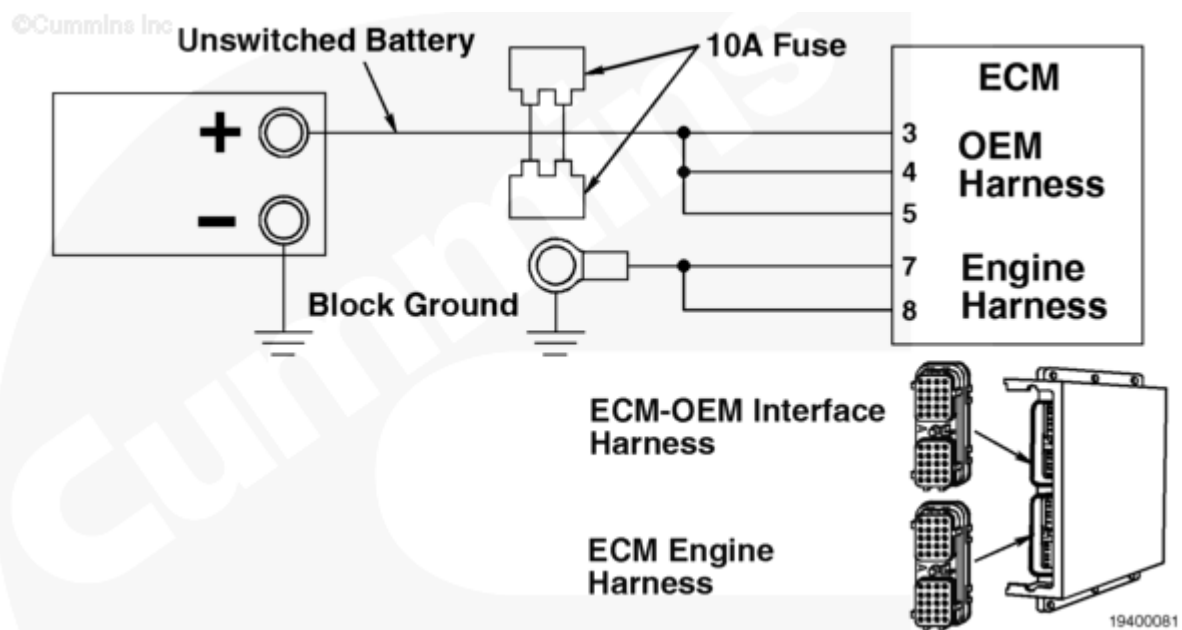

Unswitched Battery Supply Circuit

Circuit Description

The ECM receives unswitched battery voltage through the OEM harness and engine harness. There are two in-line 10-amp fuses in the unswitched battery wire of the OEM interface harness to protect the ECM. The battery return wires in the engine harness are connected to the engine block ground.

Component Location

The location of the battery will vary with the OEM. Refer to the OEM manual for the battery location.

Shoptalk

Improper wiring of the battery circuit is the most likely cause of this fault.

Refer to Troubleshooting Fault Code t05-442 (</qs3/pubsys2/xml/en/procedures/19/19-t05-442.html>)

Last Modified: 01-Mar-2011
