


Fault Code: 452

Rail Pressure Sensor Circuit

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 452 PID(P): 157 SPN: 157 FMI: 4 Lamp: Red SRT: 00-375	Less than 0.15-VDC detected at the rail pressure sensor signal pin 31 of the engine harness.	Depending on the calibration, the engine will shut down or power-derate, or no action is taken by the ECM.

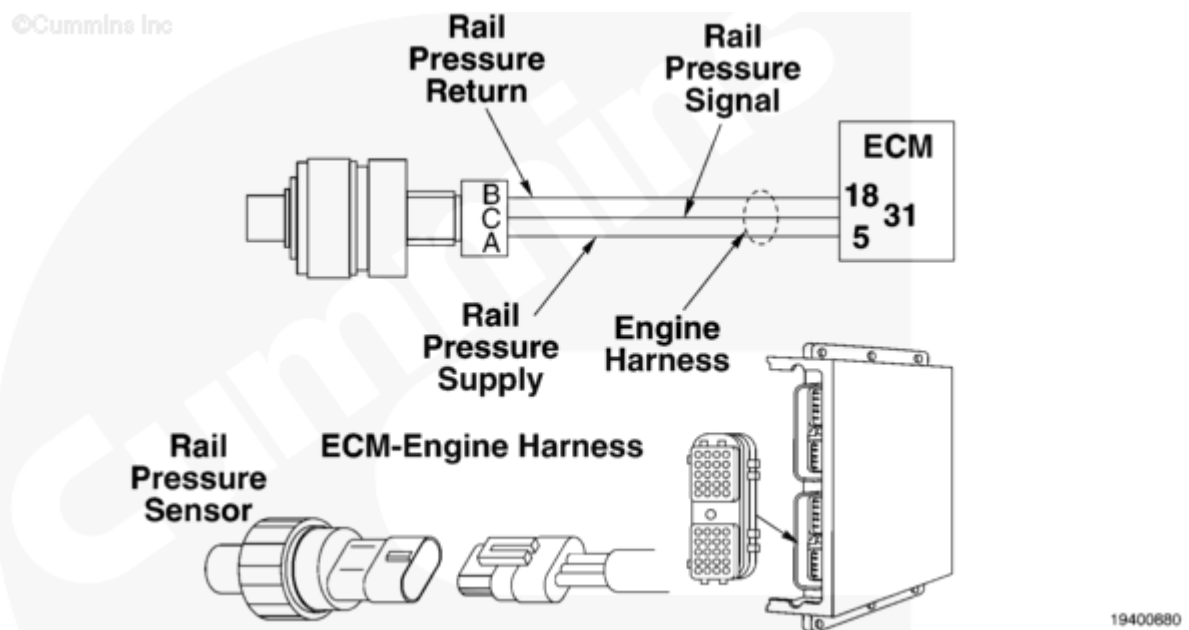

Rail Pressure Sensor Circuit

Circuit Description

The rail pressure sensor provides a signal to the ECM through the engine harness. The ECM uses the rail pressure sensor signal to monitor the amount of fuel going to the injector's metering chamber from the control valve body.

Component Location

The rail pressure sensor is located on the lower right side of the control valve body.

Shoptalk

Possible causes of this fault code include:

- Malfunctioning or damaged rail pressure sensor
- Malfunctioning or damaged engine wiring harness

Refer to Troubleshooting Fault Code t05-452 (</qs3/pubsys2/xml/en/procedures/19/19-t05-452.html>)

Last Modified: 28-May-2026
