

Fault Code: 553


Rail Pressure Over Limits

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 553 PID(P): P157 SPN: 157 FMI: 0 Lamp: Red SRT: 00-382	Rail pressure exceeds a normal limit.	Fuel shutoff valve de-energized (valve closes). The valve reenergizes (valve opens) when rail pressure falls below acceptable limit for present engine speed.

©Cummins Inc

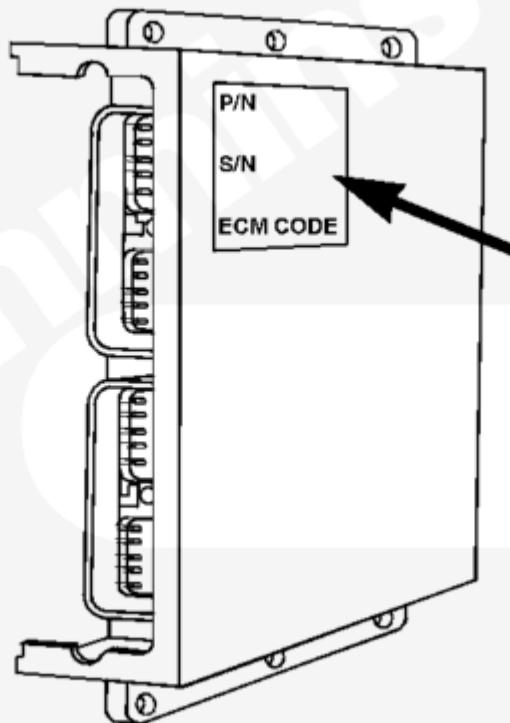

19400316

ECM

Circuit Description

The ECM secondary processor monitors the rail pressure. When it senses a pressure above the torque curve, with the accelerator off-idle, or a pressure above 103 kPa [15 psi], with the accelerator on-idle, and engine speed is above idle, it will shut the engine down. A problem in the ECM is the most likely cause of this situation.

Component Location

The ECM is mounted on the control valve body.

Shoptalk

If Fault Code 514 is logged but the engine is **not** shut down, an overpressure situation will develop, causing Fault Code 553 to be logged. If this is the case, the actuator has failed to open; investigate Fault Code 514 first.

Refer to Troubleshooting Fault Code t05-553 (</qs3/pubsys2/xml/en/procedures/19/19-t05-553.html>)

Last Modified: 01-Mar-2011
