


Fault Code: 729

Blowby Pressure Sensor Circuit

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 729 PID(P): P22 SPN: 1264 FMI: 4 Lamp: Yellow SRT: 00-678	Less than 0.29-VDC detected at the blowby pressure sensor SIGNAL pin 25 of the engine harness.	No engine protection for blowby pressure.

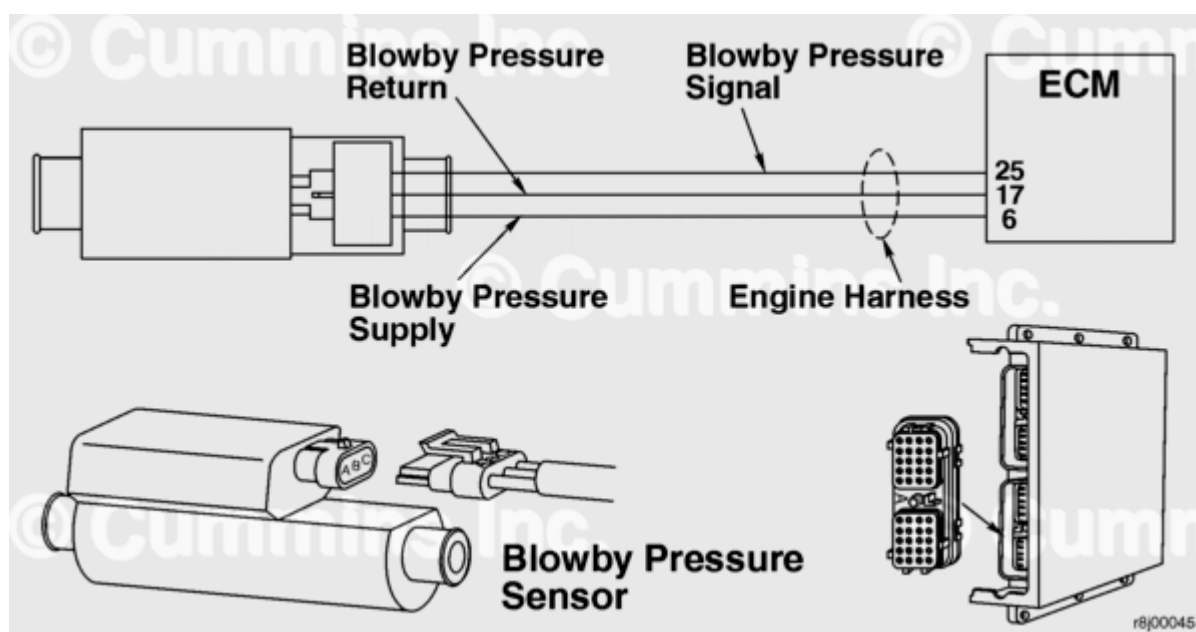

Blowby Pressure Sensor Circuit

Circuit Description

The blowby pressure sensor monitors blowby pressure and passes this information to the engine control module (ECM) through pin 25 of the engine harness. The ECM monitors the voltage on pin 25 and expects to see the voltage vary between 0.5 and 4.5-VDC during normal engine operation. Voltage below 0.29-VDC on pin 25 will trip Fault Code 729 and can be caused by shorts in the SUPPLY, SIGNAL, or RETURN wires, an open in the RETURN wire, or a malfunctioning sensor.

Component Location

The blowby pressure sensor is located on the exhaust side of the engine, below the water pump on the QSK19 fuel systems. Refer to Procedure 100-002 (Engine Diagrams) in Section E for component location for QSK23, QSK45, QSK60, and QSK78 Series engines.
(/qs3/pubsys2/xml/en/procedures/19/19-100-002-tr.html)

Shoptalk

Confirm that the crankcase breathers, breather tubes, and blowby sensor are **not** obstructed.

Refer to Troubleshooting Fault Code t05-729 (/qs3/pubsys2/xml/en/procedures/19/19-t05-729.html)

Last Modified: 15-Apr-2013
