


Trainings ▾


Initial Check

Check the tensioner arm, pulley, and stops for cracks. If any cracks are noticed, the tensioner **must** be replaced.

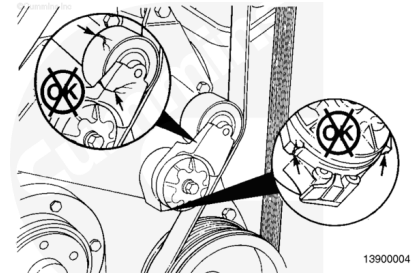


With the belt on, verify that neither tensioner arm stops are in contact with the spring casing stop. If either stop is touching, the drive belt **must** be replaced.


After replacing the belt, if the tensioner arm stops are still in contact with the spring case stop, replace the tensioner.

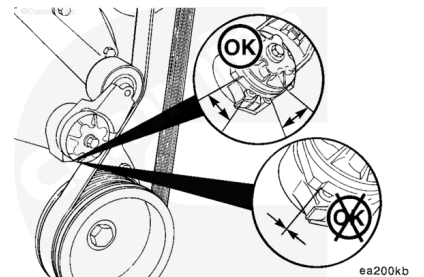

Check the location of the drive belt on the belt tensioner pulley. The belt should be centered on, or close to the middle of, the pulley. Unaligned belts, either too far forward or backward, can cause belt wear, belt roll-off failures, or increase uneven tensioner bushing wear.

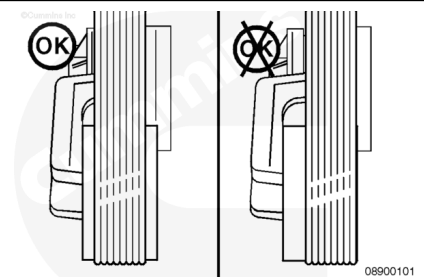

With the belt removed, verify that the tensioner arm stop is in contact with the spring case stop. If these two are **not** touching, the tensioner **must** be replaced.

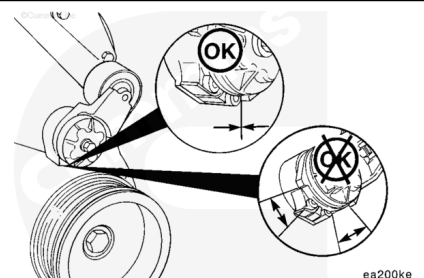


Preparatory Steps

⚠ WARNING ⚠


Batteries can emit explosive gases. To reduce the possibility of personal injury, always ventilate the compartment before servicing the batteries. To reduce the possibility of arcing, remove the negative (-) battery cable first and attach the negative (-) battery cable last.

- Disconnect the batteries.

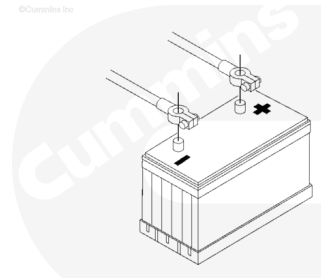

13900060

- Remove the drive belt. Refer to Procedure 008-002 (</qs3/pubsys2/xml/en/procedures/40/40-008-002-tr.html>).

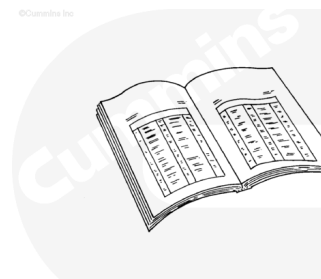


ck800wa

Remove

Remove the capscrew and belt tensioner from the bracket.

Note : Some belt tensioners are mounted to the water inlet connection.

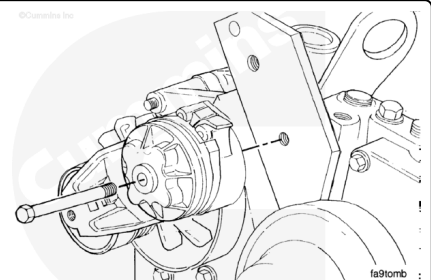

fa9tomb


Clean and Inspect for Reuse

Check the belt for damage.


Transverse (across the belt width) cracks are acceptable.

Longitudinal (direction of the belt length) cracks that intersect with transverse cracks are **not** acceptable.

If the belt is frayed or has any piece of material missing, the belt is unacceptable and needs to be replaced.

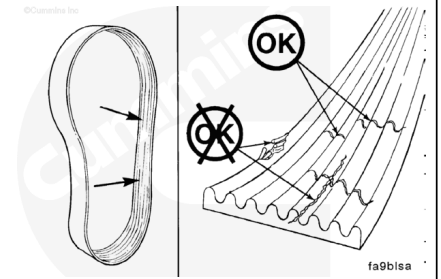


Measure the clearance between the tensioner spring case and the tensioner arm to verify tensioner wear-out and uneven bearing wear. If the clearance exceeds 3 mm [0.12 in] at any point, the tensioner failed and **must** be replaced as a complete assembly.

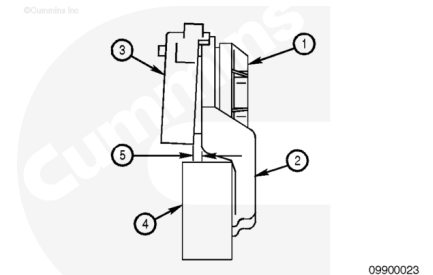

Experience has revealed that tensioners generally will show a larger clearance gap near the lower portion of the spring case, resulting in the upper portion rubbing against the tensioner arm. **Always** replace the belt when a tensioner is replaced.

1. Tensioner cap
2. Tensioner arm
3. Spring case
4. Tensioner pulley
5. Clearance gap.


Inspect the tensioner for evidence of the tensioner arm contacting the tensioner cap. If there is evidence of the two areas making contact, the pivot tube bushing has failed and the tensioner **must** be replaced.

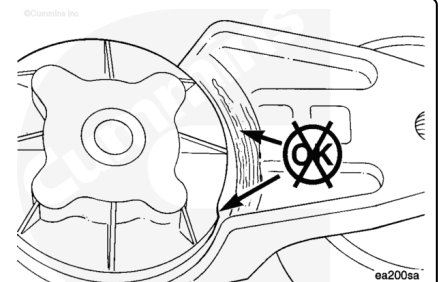

Install

Install the tensioner and capscrew.

Torque Value: 43 n•m [32 ft-lb]

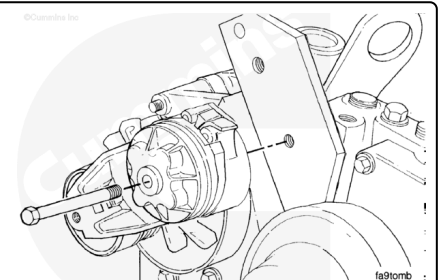

Finishing Steps

- Install the drive belt. Refer to Procedure 008-082 (</qs3/pubsys2/xml/en/procedures/40/40-008-082-tr.html>).

©Cummins Inc.




ck600wa

⚠ WARNING ⚠

Batteries can emit explosive gases. To reduce the possibility of personal injury, always ventilate the compartment before servicing the batteries. To reduce the possibility of arcing, remove the negative (-) battery cable first and attach the negative (-) battery cable last.

©Cummins Inc.

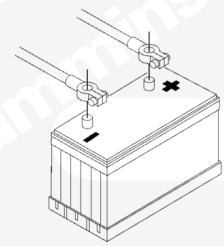

13900060

- Connect the batteries.