

Fault Code: 157


Intake Manifold 2 Temperature Sensor Circuit - Voltage Below Normal or Shorted to Low Source

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 157 PID(P): 105 SPN: 1131 FMI: 4 Lamp: Yellow SRT: 00-697	Intake Manifold 2 Temperature Sensor Circuit - Voltage Below Normal or Shorted to Low Source. Low voltage detected on SIGNAL pin-06 of the main harness A engine control module (ECM) connector.	Fault Code 158 is disabled.

©Cummins Inc

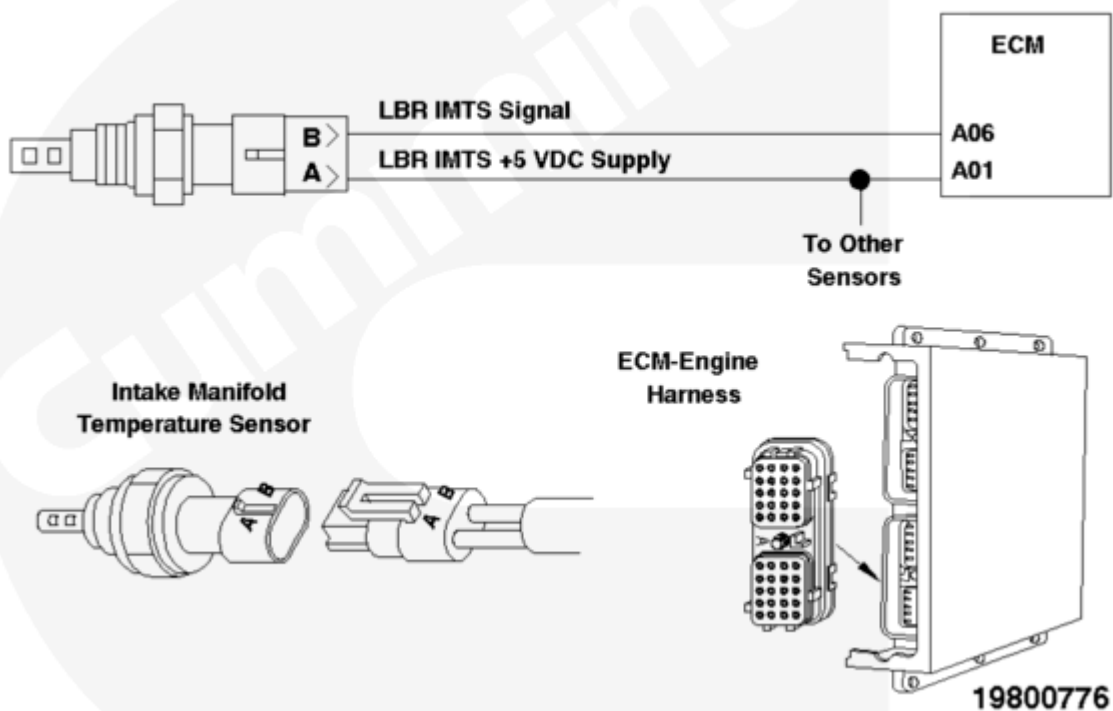

Intake Manifold 2 Temperature Sensor Circuit

Circuit Description

The intake manifold 2 temperature sensor provides the left bank rear intake manifold air temperature signal to the CENSE™ ECM.

Component Location

The intake manifold 2 temperature sensor is located on the left bank rear intake manifold. The sensor is located downstream of the aftercooler.

Shoptalk

The resistance of the sensor varies with temperature. The reading that you observe should compare to the following table if the sensor is functioning properly.

Temperature	Temperature	Resistance
(°C)	(°F)	(ohms)
0	32	30k to 36k
25	77	9k to 11k
50	122	3k to 4k
75	167	1350 to 1500
100	212	600 to 675

Refer to Troubleshooting Fault Code t05-157. (</qs3/pubsys2/xml/en/procedures/81/81-t05-157.html>)