


Fault Code: 695

Turbocharger 2 Compressor Intake Temperature Circuit - Voltage Below Normal or Shorted to Low Source

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 695 PID(P): SPN: 1173 FMI: 4 Lamp: None SRT: 00-514	Turbocharger 2 Compressor Intake Temperature Circuit - Voltage Below Normal or Shorted to Low Source. Low voltage detected on SIGNAL pin 15 of the main harness A ECM connector.	Fault Code 616 is disabled.

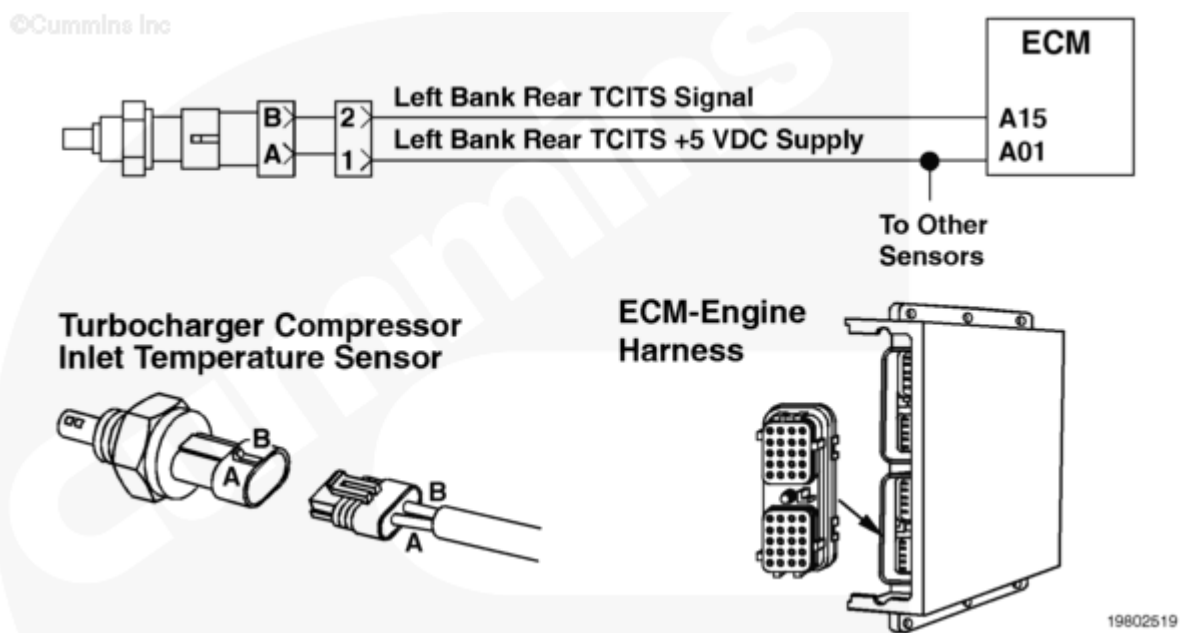

Left Bank Rear Turbocharger Compressor Inlet Temperature Sensor Circuit

Circuit Description

The left bank rear turbocharger compressor temperature sensor provides the left bank rear turbocharger compressor inlet temperature to the ECM. The resistance of the sensor varies with temperature. The ECM detects the change in resistance of the sensor by monitoring the voltage across an internal resistor that is in series with the sensor. The change in voltage across the internal resistor is translated into a temperature change.

Component Location

The left bank rear turbocharger compressor inlet temperature sensor is located on the left bank rear turbocharger inlet.

Shoptalk

- The resistance of the sensor varies with the temperature. The reading that you observe should compare to the following table if the sensor is functioning properly.

Temperature	Temperature	Resistance
(°C)	(°F)	(ohms)
0	32	30k to 36k
25	77	9k to 11k
50	122	3k to 4k
75	167	1350 to 1500
100	212	600 to 675

Refer to Troubleshooting Fault Code t05-695 (</qs3/pubsys2/xml/en/procedures/81/81-t05-695.html>)