


Fault Code: 132-nctap

Accelerator Pedal or Lever Position Sensor 1 Circuit - Voltage Below Normal or Shorted to Low Source

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 132-nctap PID(P): P91 SPN: FMI: 7 Lamp: Flashing SRT: 00-622	Low voltage detected at throttle position signal circuit.	Possible reduced engine performance.

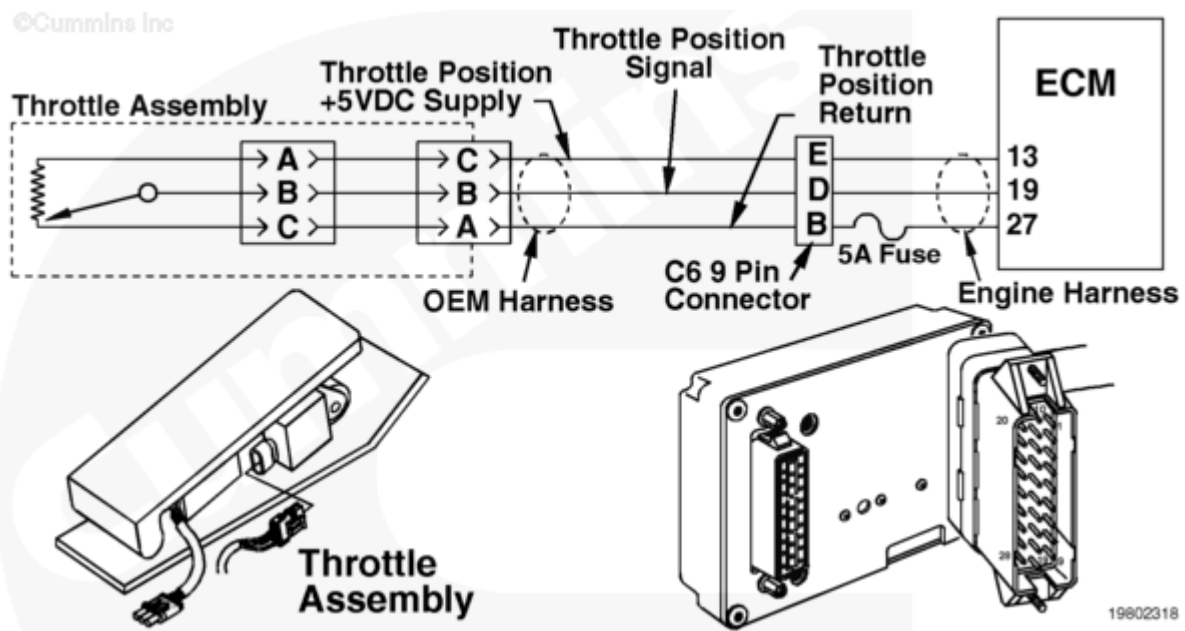

Throttle Position Sensor Circuit - (Non-CELECT™ Type Accelerator Pedal)

Circuit Description

The throttle position sensor is a variable resistance sensor used by the ECM to monitor the throttle command. This sensor has three circuits: 5 volt supply, return and signal circuits. The signal circuit voltage indicates the position of the throttle position sensor.

Component Location

Throttle position sensor location may vary and is OEM dependent.

Conditions For Running The Diagnostics

This diagnostic runs continuously when the keyswitch is in the ON position.

Conditions For Setting The Fault Codes

The Engine Control Module (ECM) detected the signal voltage on the throttle position sensor circuit is out of range low.

Action Taken When The Fault Code Is Active

- The ECM illuminates the red STOP ENGINE lamp immediately when the diagnostic runs and fails.

For Power Generation Applications:

- The generator set controller displays the fault immediately when the diagnostics runs and fails.

Conditions For Clearing The Fault Code

- Turn the keyswitch OFF. Allow the ECM to completely power down and turn the keyswitch ON.
- The fault code status displayed by the recommended Cummins® electronic service tool or equivalent will change to INACTIVE immediately after the diagnostic runs and passes.
- The ECM will turn off the red STOP ENGINE lamp immediately after the diagnostic runs and passes.
- The "Reset All Faults" command in the recommended Cummins® electronic service tool or equivalent can be used to clear active and inactive faults.

For Power Generation Applications:

- To validate the repair, start the engine and let it run for 1 minute at no load.
- The generator set controller will turn off the indicator immediately after the user presses reset.
- The "Reset All Faults" command in the recommended Cummins® electronic service tool or equivalent can be used to clear active faults.

Shoptalk

Possible causes of this fault code include:

- Malfunctioning or damaged engine wiring harness.
- Malfunctioning or damaged OEM wiring harness.
- Malfunctioning or damaged throttle position sensor.
- Damaged or loose connectors.

Refer to Troubleshooting Fault Code t05-132 (</qs3/pubsys2/xml/en/procedures/98/98-t05-132nctap.html>)

Last Modified: 15-Sep-2021
