

Fault Code: 525


Engine Control Module Not Calibrated - Voltage Above Normal or Shorted to High Source

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 525 PID(P): S254 SPN: FMI: 3 Lamp: On SRT: 00-649	Incorrect ECM calibration, or ECM failure.	Engine may run rough, may stop running, may not start, or may be difficult to start.

©Cummins Inc

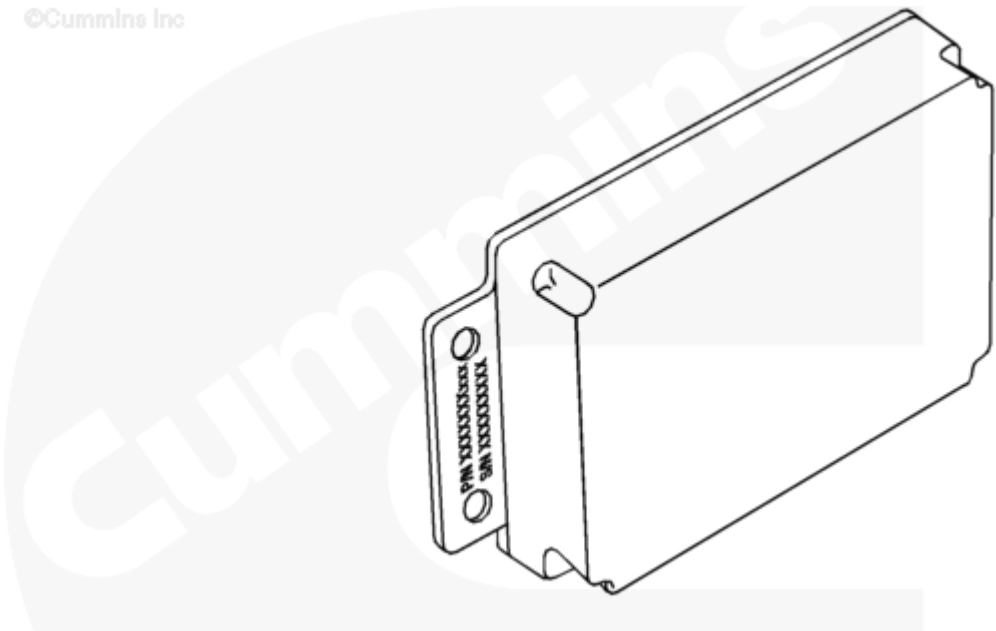

19802469

Engine Control Module (ECM)

Circuit Description

The ECM has internal diagnostics that continuously run and check the internal memory.

Component Location

The ECM is bolted to the fuel pump on the left side of the engine.

Conditions For Running The Diagnostics

This diagnostic runs continuously when the keyswitch is in the ON position.

Conditions For Setting The Fault Codes

The Engine Control Module (ECM) has detected a memory error in the ECM.

Action Taken When The Fault Code Is Active

- The ECM illuminates the red STOP ENGINE lamp immediately after the diagnostic runs and fails.
- The engine may **not** start.

For Power Generation Applications:

- The generator set controller displays the fault immediately when the diagnostics runs and fails.

Conditions For Clearing The Fault Code

- Turn the keyswitch OFF. Allow the ECM to completely power down and turn the keyswitch ON.
- The fault code status displayed by the recommended Cummins® electronic service tool or equivalent will change to INACTIVE immediately after the diagnostic runs and passes.
- The ECM will turn off the red STOP ENGINE lamp immediately after the diagnostic runs and passes.
- The “Reset All Faults” command in the recommended Cummins® electronic service tool or equivalent can be used to clear active and inactive faults.

For Power Generation Applications:

- To validate the repair, start the engine and let it run for 1 minute at no load.
- The generator set controller will turn off the indicator immediately after the user presses reset.
- The “Reset All Faults” command in the recommended Cummins® electronic service tool or equivalent can be used to clear active faults.

Shoptalk

Possible causes of this fault code include:

- A malfunction of the ECM software or calibration error.
- Internal ECM failure.

Refer to Troubleshooting Fault Code t05-525 (/qs3/pubsys2/xml/en/procedures/98/98-t05-525.html)

Last Modified: 15-Sep-2021
