



# Technical Service Bulletin

Technical Service Bulletin: tsb100426

Released Date: 06-Jan-2006

Intercooler Core Improvements

## Intercooler Core Improvements

### Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

### Contents

This Technical Service Bulletin informs the field of QSK60 and QSK78 intercooler core improvements. These improvements were implemented into production from the 27<sup>th</sup> of September 2005 for the QSK60 (Engine Serial Number 33161599), and from the 12<sup>th</sup> of September 2005 for the QSK78 (Engine Serial Number 66300659).


Improvements to the QSK60 and QSK78 intercooler core include improved flange thickness and extra welding, which have been added to improve the intercooler wall strength.

This has been achieved by adding stitch welds in the corners to secure the inner tank wall to the outer side plates, and thus creating better structural strength.


These modifications fix problems such as coolant leaks due to water pressure pulses opening the weld joint and flange cracks due to poor flange flatness.

#### Intercooler Part Number Change

| Old Part Number | New Part Number |
|-----------------|-----------------|
| 3171310         | 3637966         |

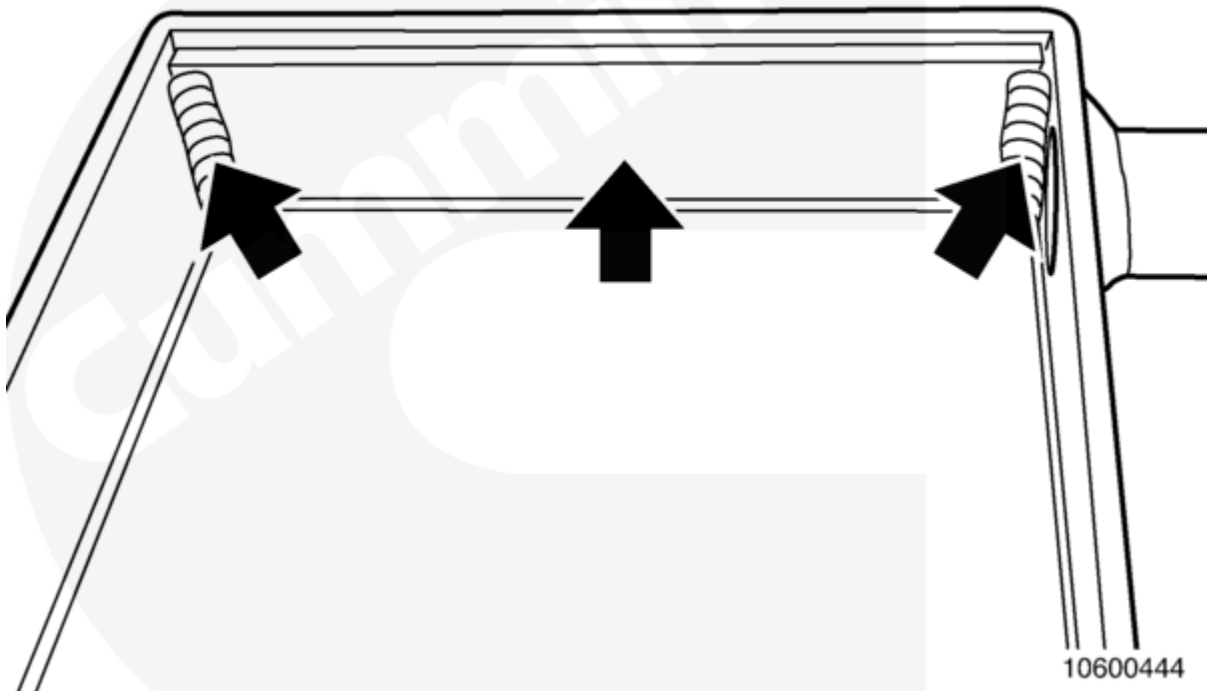


Stitch Welds

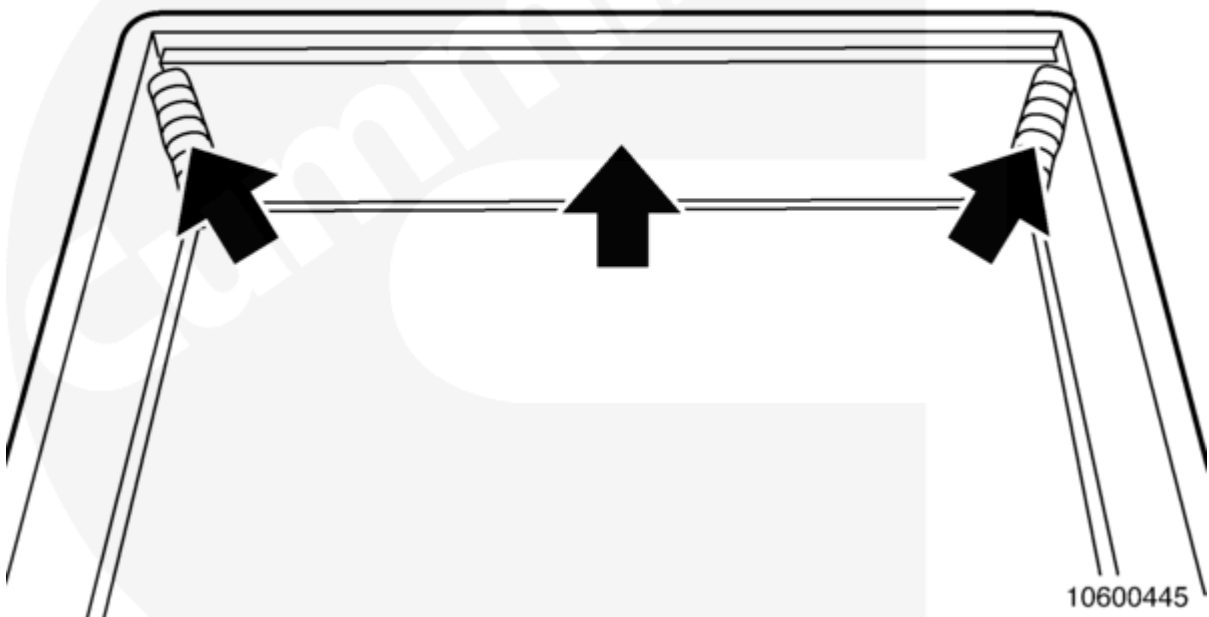

Stitch Welds

Section Through End of New Intercooler Core, Part Number 3637966

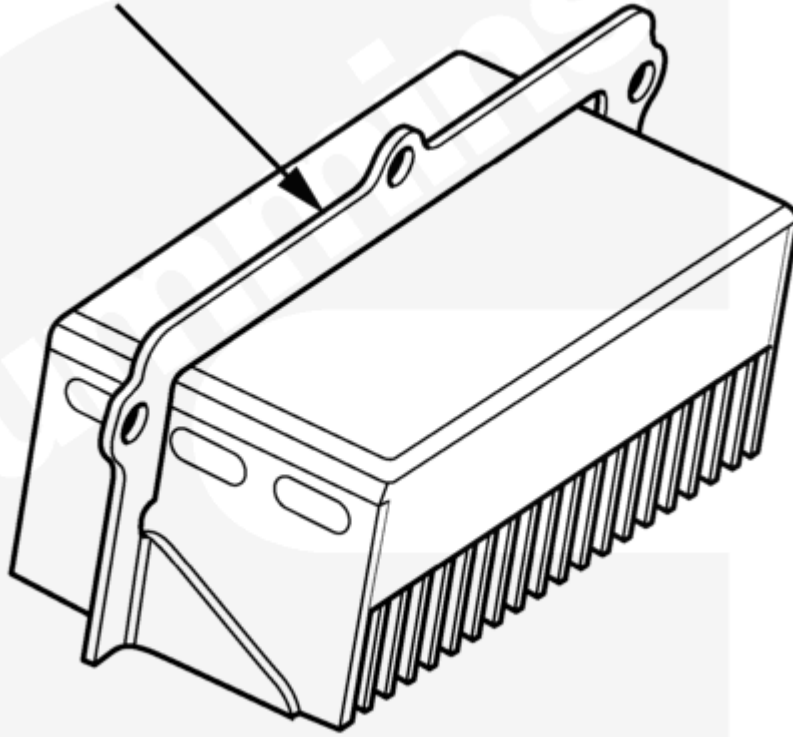

10600446

Improved Flange Flatness

**Note :** This is a product improvement and not subject to campaign or TRP.