



Technical Service Bulletin

Technical Service Bulletin: tsb100727

Released Date: 12-Aug-2008

New Cam Cover Seals

New Cam Cover Seals

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This Technical Service Bulletin introduces new injector and valve cam cover seals for Signature™, ISX, and QSX15 series engines. Each new seal will obsolete and supersede the earlier version.

The new seals have been designed to make the assembly process easier and prevent leaks caused by mis-assembly. They are a press-in-place design, which are meant to be pressed into the seal retaining groove cut into the cam cover and stay in place without the need of an adhesive.

The new seals have retaining nubs (1), around both the inside and outside circumferences, that are designed to hold them in place. Because of this feature, they have a different appearance than the previous seals. The new seal is shown in Figure 1.

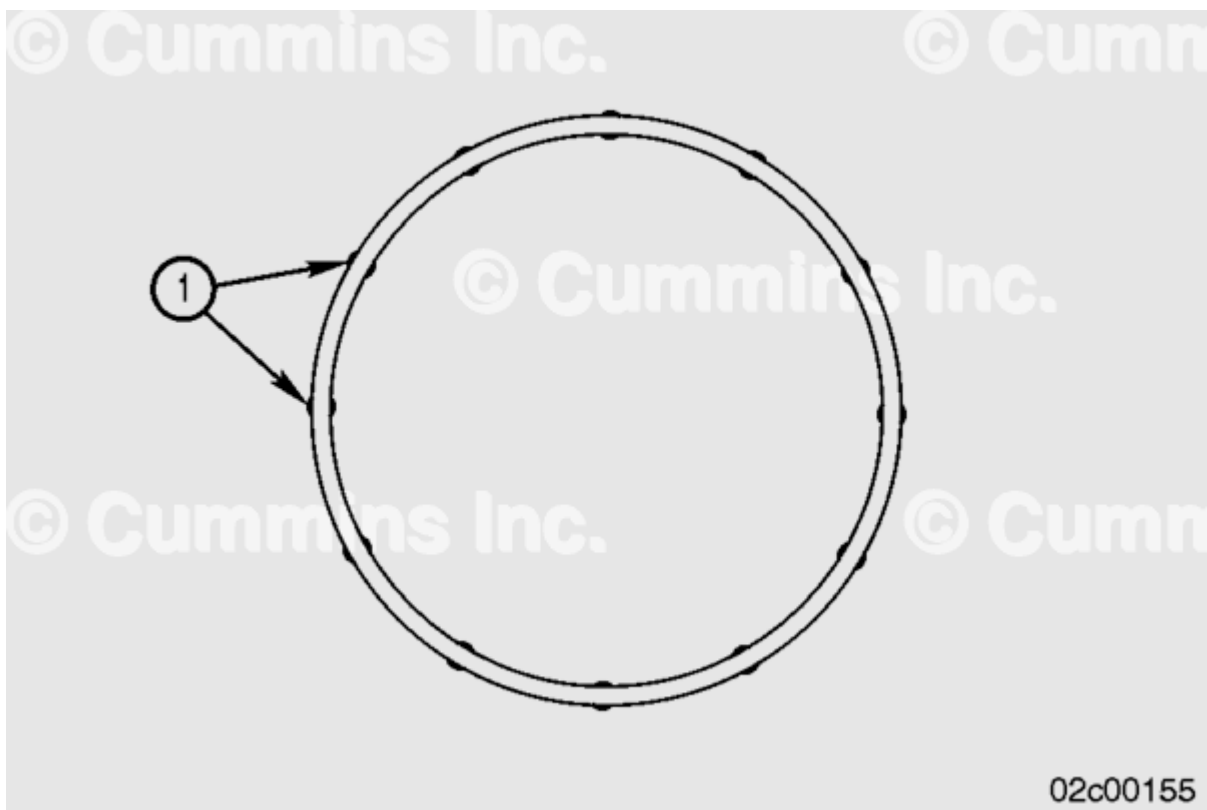


Figure 1, New Cam Cover Seal

Both new seals are presently being used in production. The engine serial number (ESN) first is 79321243 in production on June 26, 2008.

Table 1: Cam Cover Seal Part Numbers

New Part Number	Quantity	Description	Old Part Number	Quantity
4985660	1	Seal, cam cover, valve	4101881	1
4985661	1	Seal, cam cover, injector	4101882	1