



Technical Service Bulletin

Technical Service Bulletin: TSB110002

Released Date: 21-Feb-2011

Possible Water Pump/Cylinder Block Interference on ISM and QSM11 Engine Applications

Possible Water Pump/Cylinder Block Interference on ISM and QSM11 Engine Applications

Core Issue


This document describes a condition in which there may be interference between the water pump housing and the cylinder block on some ISM and QSM11 engines. Due to the manufacturing and process variation between components, it is possible for the water pump housing to contact the cylinder block casting, behind the cylinder block to gear housing interface. This issue may result in an external coolant leak from the water pump housing or an issue with the water pump bearing. If the engine is experiencing an external coolant leak from the water pump housing or an issue with the water pump bearing, the engine **must** be inspected for this possible interference condition before the water pump is removed for repair.

Confirmation

The condition can affect ISM and QSM11 engines manufactured at the Jamestown Engine Plant. Reference the table below for engine serial number and date ranges.

	Beginning	End
Engine Build Date	12/01/2010	12/06/2010
Engine Serial Number	35278340	35278970

Inspect for interference between the water pump housing and the cylinder block casting by sliding thin cardboard or cardstock between the components. See illustration below.

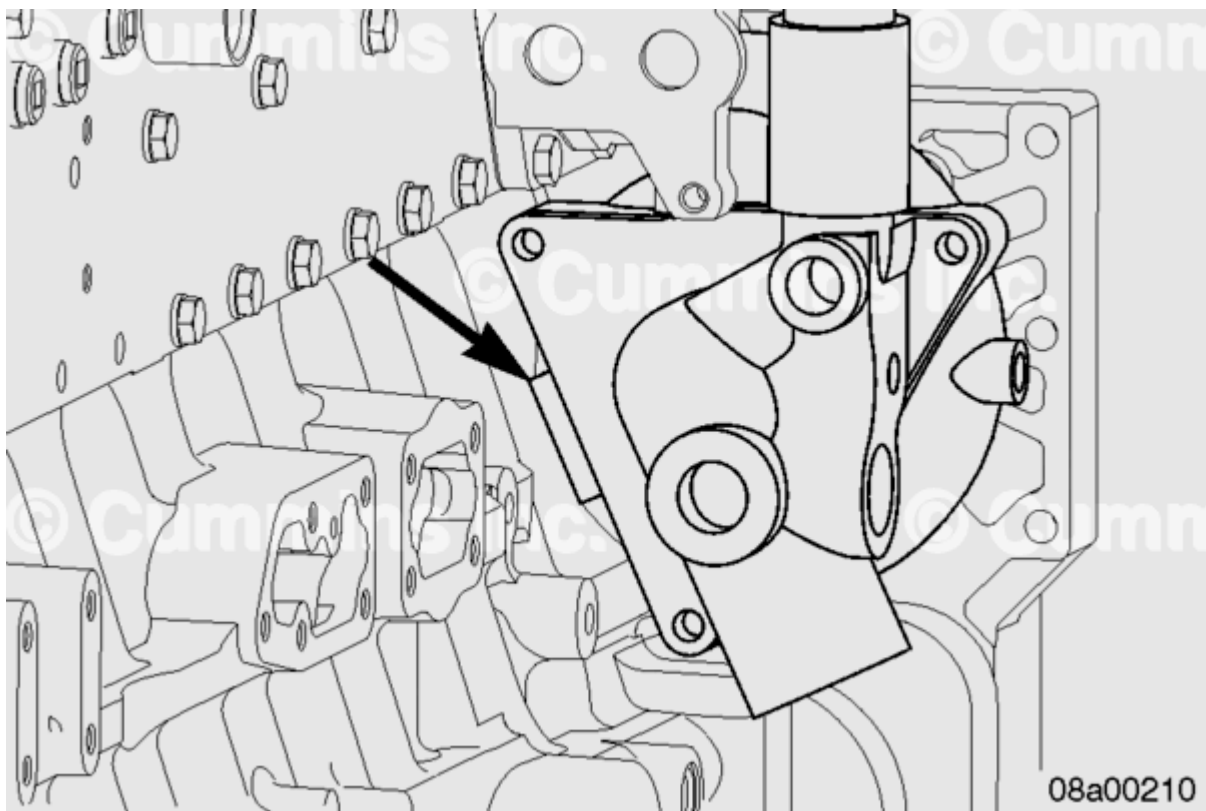

Water Pump Housing and Cylinder Block Casting

Resolution

⚠ WARNING ⚠

Wear appropriate eye and face protection when using a grinder and/or compressed air. Flying debris and dirt can cause bodily injury.

If interference is found, it may be necessary to remove the water pump from the engine to correct the interference by grinding a small amount of material from the affected area of the cylinder block casting or water pump housing. Use the following procedure in the ISM, ISMe, and QSM11 Service Manual, Bulletin 3666322. Refer to Procedure 008-062 in Section 8.

(/qs3/pubsys2/xml/en/procedures/35/35-008-062-tr.html)

Note : Care must be taken to properly cover any exposed engine components during the grinding process and to seal or paint the area exposed by grinding.

If interference is **not** found, no further action is necessary.

Note : The inspection (0.1 hours) and grinding process (0.3 hours) can be applied using 99-999 Standard Repair Time (SRT) when necessary.

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Document History

Date	Details
2011-1-5	Module Created
2011-2-15	QSOL Quick Fix Reason: Spelling Error Notes: none
2011-2-21	QSOL Quick Fix Reason: Spelling Error Notes: none

Last Modified: 21-Feb-2011
