



Technical Service Bulletin

Technical Service Bulletin: TSB190035

Released Date: 05-Mar-2019

Cylinder Liner Installer Kit 3164606 Update

Cylinder Liner Installer Kit 3164606 Update

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- ISX CM570
- ISX CM870
- ISX CM871
- ISX CM871 E
- ISX15 CM2250
- ISX15 CM2250 SN
- ISX15 CM2350 X101
- QSX15 CM2250
- QSX15 CM2250 ECF
- QSX15 CM2250 X115
- QSX15 CM2350 X105
- QSX15 CM2350 X106
- QSX15 CM2350 X118
- QSX15 CM570
- X15 CM2350 X114B
- X15 CM2350 X116B

Issue

Symptom:

Lack of adequate thread engagement when using liner installation kit, Part Number 3164606. Short head bolts can lead to stripped head bolt threads or damaged cylinder block threads.

Root Cause:

Cylinder blocks are now machined with a deeper cylinder head bolt counterbore that prevents adequate thread engagement when using the short head bolts. The long head bolts are too long to use without spacers.

Resolution

Existing Kit, Part Number 3164606, has been updated to include spacers, Part Number 5395470, that allow the longer cylinder head bolts to be used with the kit to achieve adequate thread engagement.

Spacers are individually saleable for upfit of existing kits.



Figure 1, Top: Long Cylinder Head Bolt to be Used With Spacers. Bottom: Short Cylinder Head Bolt.

Service Instructions

Cummins Inc. recommends that all repair network kits have one of the following actions performed:

- Order quantity 2 of spacer, Part Number 5395470.
- Replace existing kit.
- Individual owners are fully responsible for any cost associated with upfit or replacement.



Figure 2, Left: Incorrect Spacer Arrangement. Right: Correct Spacer Arrangement.

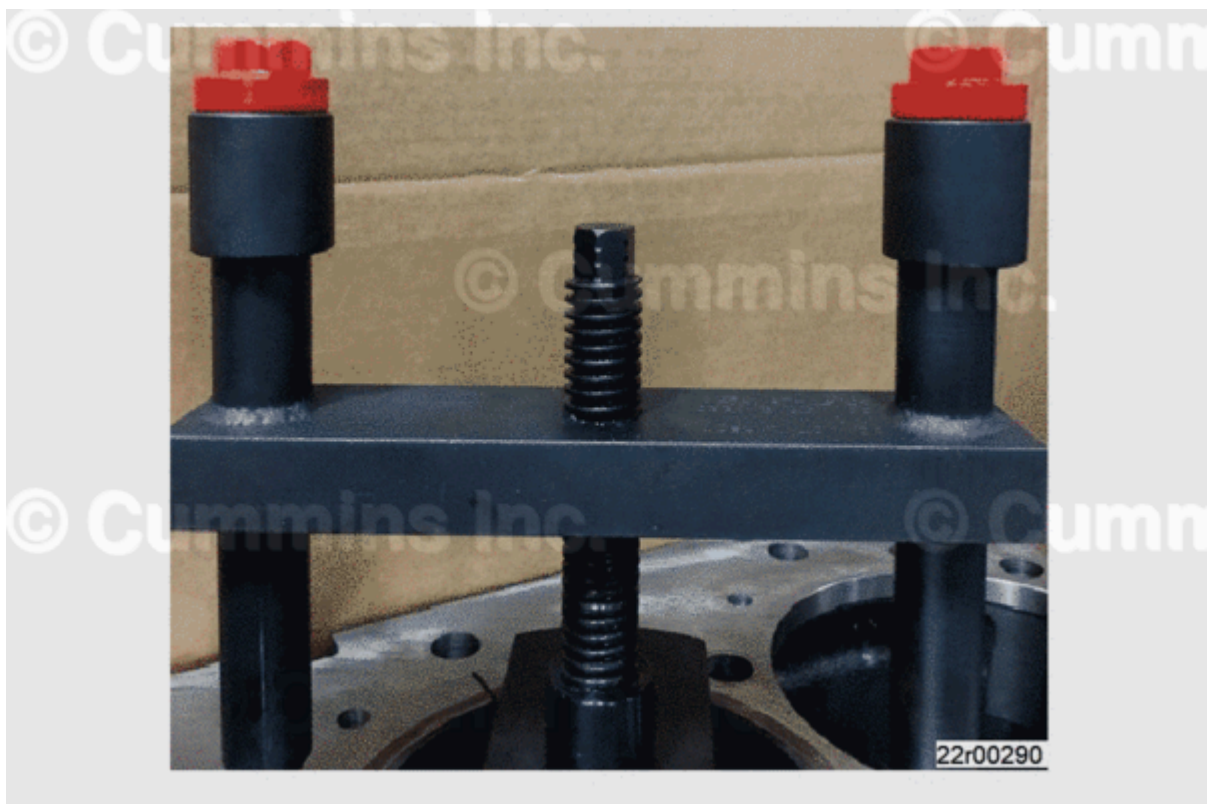


Figure 3, Kit Correctly Assembled on Block

Date	Details
2019-2-26	Module Created

Last Modified: 05-Mar-2019
