


Trainings ▾

Inspect for Reuse


Every 80,000 km [50,000 mi], 1500 hours, or 1 year, whichever comes first, inspect the automatic belt tensioner.

With the engine turned off, verify that neither the top nor bottom tensioner arm stop is touching the cast boss on the tensioner body. If either of the stops is touching a boss, the alternator belt **must** be replaced. Check to make sure the correct belt part number is being used if either condition exists.

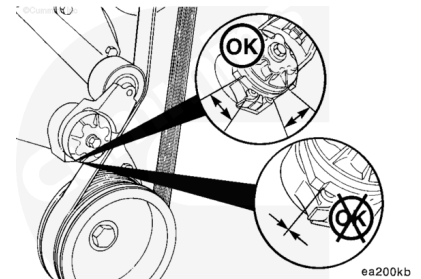


Check the tensioner pulley and body for cracks. If any cracks are noticed, the tensioner **must** be replaced.

Check the tensioner for dirt buildup. If this condition exists, the tensioner **must** be removed and steam-cleaned.

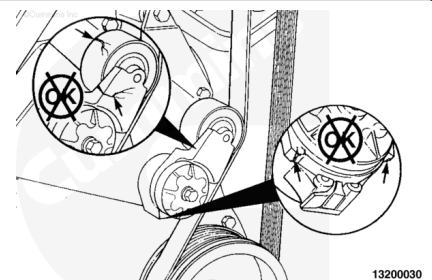


Remove the alternator belt.

If the tensioner pulley touches the accessory drive pulley after the tensioner has been fully relaxed, the bottom tensioner arm stop boss has broken and the tensioner **must** be replaced.

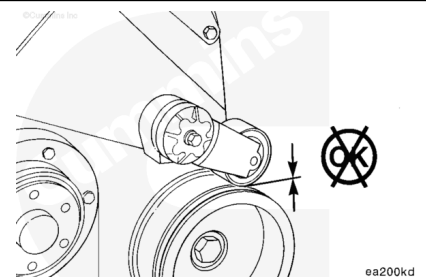

Check that the bottom tensioner arm stop is in contact with the bottom tensioner arm stop boss on the tensioner body. If these two are **not** contacting, the tensioner **must** be replaced.

Install the alternator belt.

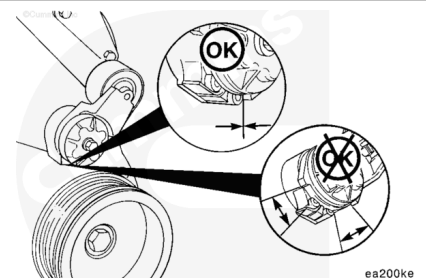

Inspect the tensioner for evidence of the pivoting tensioner arm contacting the stationary circular base. If there is evidence of these two areas contacting, the pivot tube bushing has failed and the tensioner **must** be replaced.

