


Fault Code: 115

Engine Speed Sensor Circuit

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 115 PID(P): P190 SPN: 190 FMI: 2 Lamp: Red SRT: 00-345	No engine speed signal detected at pins 27, 28, 37, and 38 of the engine harness.	Engine is shut down and can not be run.

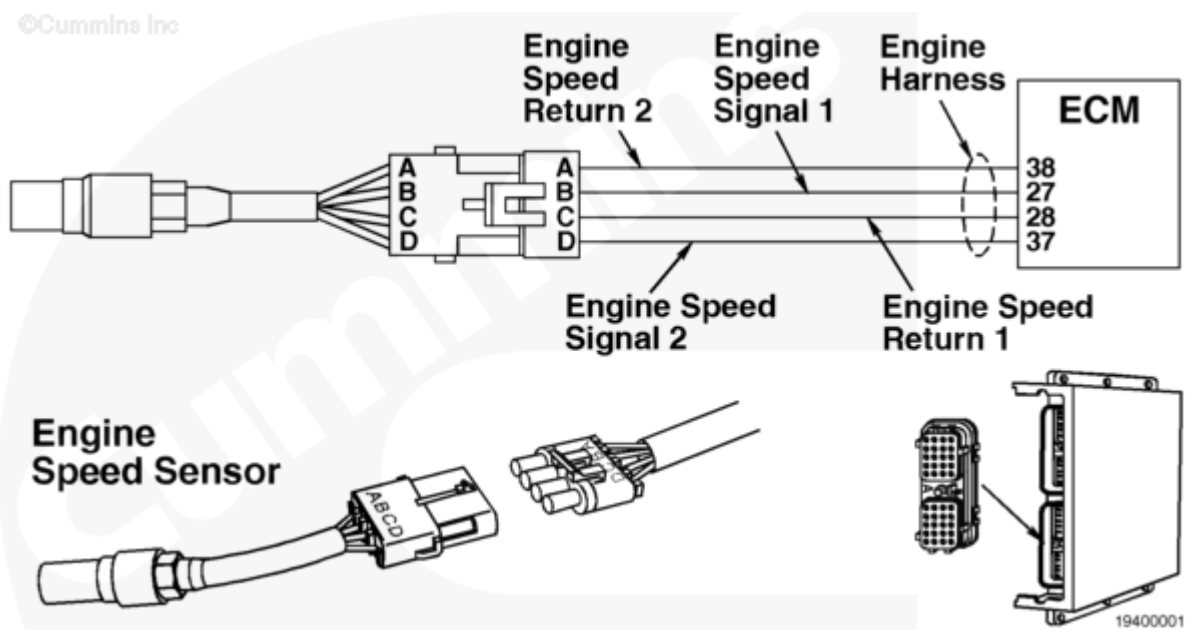

Engine Speed Sensor Circuit

Circuit Description

The engine speed sensor is a dual-coil circuit that provides the engine speed signal to the ECM through the engine harness.

Component Location

The engine speed sensor is located above the accessory drive.

Shoptalk

- If the problem occurs **only** at a certain engine temperature, be sure to check the engine speed sensor (engine speed sensor) circuit while the engine is at that particular temperature.
- Check camshaft end play to make sure that the camshaft gear is **not** moving too far away from the end of the engine speed sensor.

Refer to Troubleshooting Fault Code t05-115 (/qs3/pubsys2/xml/en/procedures/19/19-t05-115.html)

Last Modified: 01-Mar-2011
