


Fault Code: 233

Coolant Pressure - Engine Protection

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 233 PID(P): P109 SPN: 109 FMI: 1 Lamp: Engine Protection SRT: 00-389	Low coolant pressure has been detected. Voltage signal at coolant pressure signal pin 16 of the engine harness indicates coolant pressure lower than 28 kPa [4 psi] at 800 rpm, 41 kPa [6 psi] at 1300 rpm, 76 kPa [11 psi] at 1800 rpm, 96 kPa [14 psi] at 2000 rpm, and 103 kPa [15 psi] above 2100 rpm.	Calibration-dependent progressive power and speed derate and engine shutdown with increasing time after alert.

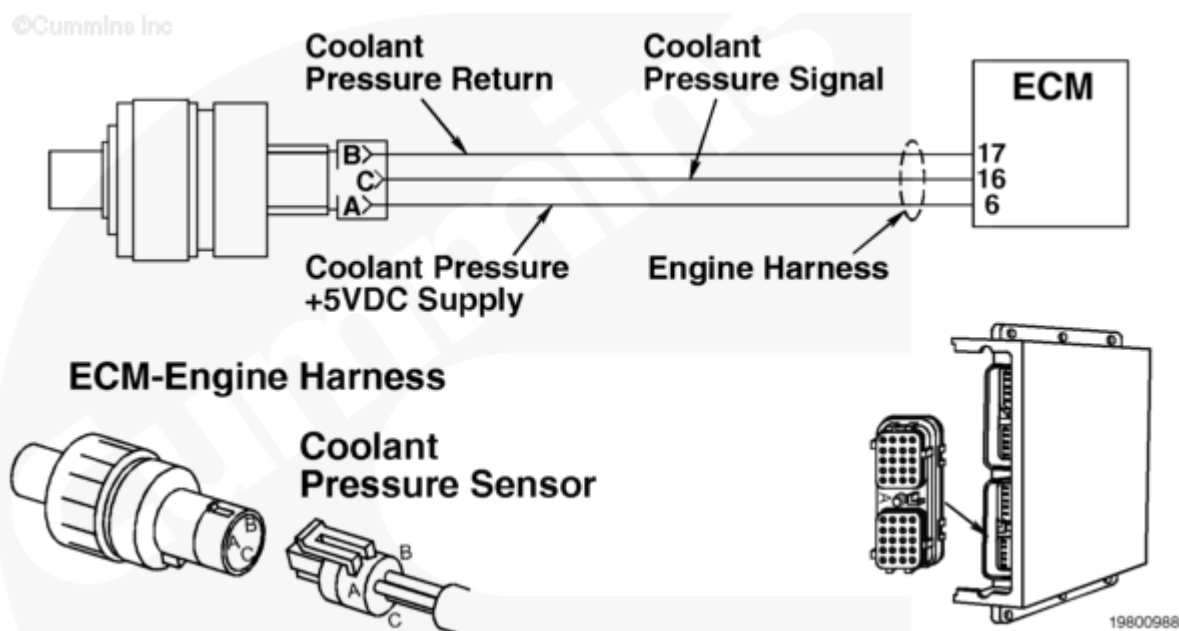

Coolant Pressure Sensor Circuit

Circuit Description

The coolant pressure sensor is used by the ECM to monitor the coolant pressure. The ECM monitors the voltage on the signal pin and converts this to a pressure value. The coolant pressure value is used by the ECM for the engine protection system.

Component Location

The coolant pressure sensor is located on the exhaust side of the engine, below the oil cooler.

Shoptalk

Possible causes of this fault code include:

- Malfunctioning or damaged coolant pressure sensor

Refer to Troubleshooting Fault Code t05-233 (</qs3/pubsys2/xml/en/procedures/19/19-t05-233.html>)

Last Modified: 28-May-2026
