


# Fault Code: 455

## Rail Actuator Circuit

 Printable Version

### Overview

| Codes                                                                                | Reason                                                                                                                                                                  | Effect                                                                                                                                                  |
|--------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------|
| Fault Code: 455<br><br>PID(P): S18<br>SPN: 633<br>FMI: 3<br>Lamp: Red<br>SRT: 00-376 | Rail actuator circuit is open, or supply pin 3 is shorted to battery voltage or ground, or return pin 10 is shorted to battery voltage or ground in the engine harness. | No action by the ECM is taken. Actuator is closed, or partially closed. Engine will <b>not</b> run, or runs at one speed. Fault Code 514 can be logged. |

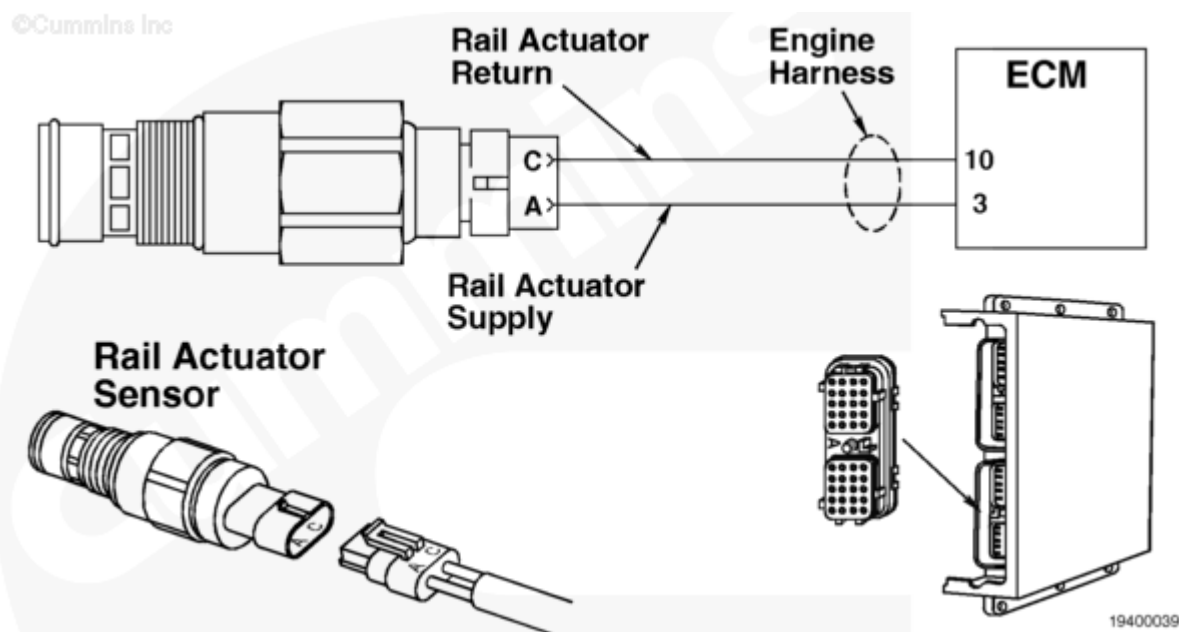

Rail Actuator Circuit

### Circuit Description

The rail actuator circuit supplies current to the rail actuator. The ECM commands a varying amount of current to the rail actuator to control the amount of rail pressure to the injectors.

### Component Location

The rail actuator is located on the bottom of the control valve body, toward the front of the engine, behind the ECM.

## Shoptalk

- Confirm that the actuator connector is firmly in place.
- When there is no power to the actuator, the actuator closes and fuel flow stops. This will cause Fault Code 514, fueling flow mismatch.
- When there is shorted power to the actuator, the actuator opens and fuel flow is uncontrolled. This will cause Fault Code 234, engine overspeed, or Fault Code 514, fueling flow mismatch.

Refer to Troubleshooting Fault Code t05-455 (</qs3/pubsys2/xml/en/procedures/19/19-t05-455.html>)

---

**Last Modified: 01-Mar-2011**

---