


Fault Code: 467

Timing Current Offset Error

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 467 PID(P): S20 SPN: 635 FMI: 2 Lamp: Yellow SRT: 00-672	The timing current offset, used to adjust timing flow, has reached the maximum or minimum threshold.	No action taken by the ECM.

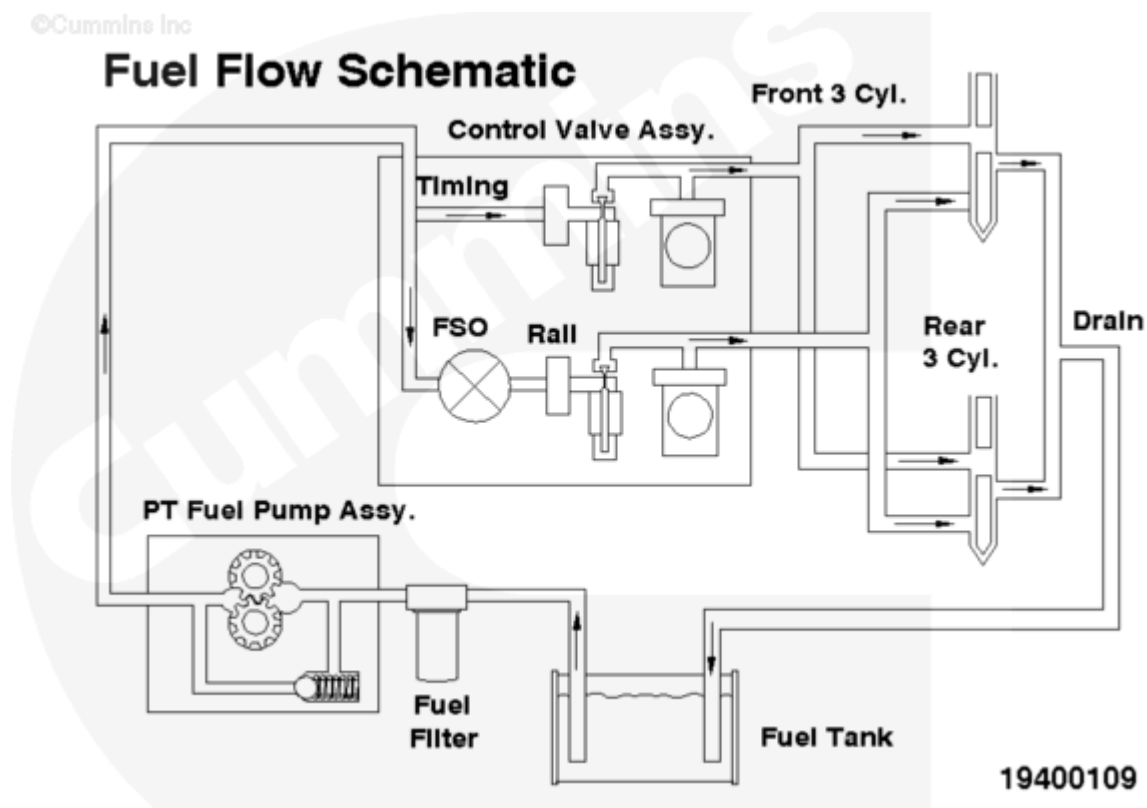

Fuel System Flow Schematic

Circuit Description

The ECM uses the timing pressure signal and engine speed to estimate the actual timing the engine is receiving and then constantly compares this value to the desired timing for the given speed and load. When there is an error in these values, the current offset is adjusted to minimize the error. If the offset can **not** compensate to eliminate the error, it will reach its maximum/minimum threshold and Fault Code 467 is logged.

Component Location

The timing actuator is located on the top of the control valve body, toward the front of the engine, behind the ECM.

Shoptalk

The estimated timing and the desired timing parameters can be monitored on INSITE™. This fault is a check on the ECM's control of the timing actuator and timing current offset. If the desired timing can **not** be met by commanding more current to the actuator or if the desired timing is being exceeded and can **not** be reduced by reducing the current to the actuator, then Fault Code 467 is logged.

Refer to Troubleshooting Fault Code t05-467 (</qs3/pubsys2/xml/en/procedures/19/19-t05-467.html>)