



Technical Service Bulletin

Technical Service Bulletin: TSB150113

Released Date: 22-Jul-2015

New Fuel Pump with Diamond-Like Coated Tappet Roller Pin

New Fuel Pump with Diamond-Like Coated Tappet Roller Pin

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

Table 1, Product Affected

Engine Model Name	Engine Control System	Identifier
ISX12/ISX11.9	CM2250	Not Applicable
	CM2350	X102
ISX15	CM2250	Not Applicable
	CM2250	SN
	CM2350	X101
PowerGen QSX15	CM2250	Not Applicable
	CM2250	ECF
QSX11.9	CM2250	ECF
QSX15	CM2350	X105, X106
	CM2250	ECF

Description of Change

Fuel pump assembly part numbers with brass tappet roller pins are being obsoleted and superseded by fuel pump assemblies with diamond-like coated tappet roller pins, see Figure 1 below.

Reason for Change

The diamond-like coated tappet roller pins are less susceptible to debris or corrosion damage, which can lead to a fuel pump failure.

Service Instructions

⚠ CAUTION ⚠

Use care when handling the roller tappet as the diamond-like coated tappet roller pin can fall out, resulting in damage to either the tappet roller or the pin.

Unlike tappet rollers with brass roller pins, the diamond-like coated roller pins are free floating and can be removed as shown in Figure 2 below.

If the tappet roller pin does fall out during inspection, but the tappet roller and roller pin are **not** damaged, the roller pin can be reinserted.

The tappet roller pin and the tappet roller can be installed in any tappet body and from both the left and right side of the tappet body.

Part Identification

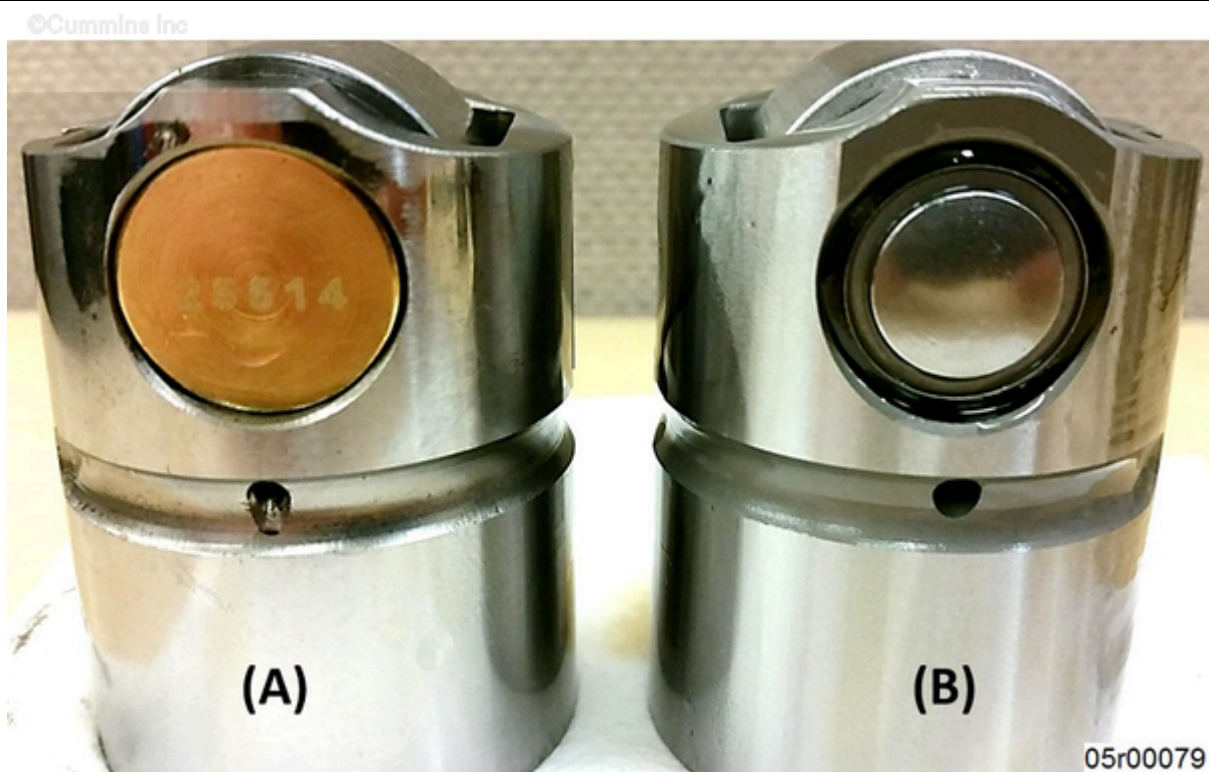


Figure 1, (A) Obsolete Brass Tappet Roller Pin (B) New Diamond-Like Coated Tappet Roller Pin



Figure 2, Diamond-Like Coated Tappet Roller Pin and Tappet Roller Removed From Fuel Pump Roller Tappet Body.

Service Parts Availability

Table 2, Service Parts

Product	Part Description	Obsolete Part Number	New Part Number
ISX15 CM2250 and QSX15 CM2250*	Fuel Pump Assembly	4307527	4359487
ISX15 CM2350 and QSX15 CM2350*		4307700	4359489
ISX12/ISX11.9 CM2250 and QSX11.9 CM2250*		2872929	4359548
ISX12 CM2350 and QSX11.9 CM2350*		4307511	4359490

*Includes all products of this type as listed in Table 1.

Fuel pump roller tappets with diamond-like coated tappet roller pins are available individually, see Table 3, and are also included in the fuel pump part numbers shown in Table 2.

Table 3, Service Parts			
Product	Part Description	Obsolete Part Number	New Part Number
All Products in Table 1	Roller Tappet, Fuel Pump	4307152	4359134
Part Inventory Action Use up parts inventory before using new parts. Production Status			
Table 4, Production Information			
Product	Engine Serial Number (ESN) First	Build Date **	Engine Plant
ISX12 CM2350*	75037969	13 January 2015	Jamestown
ISX15 CM2350*	79804664	13 January 2015	Jamestown
*Includes all products of this type as listed in Table 1. **Engine build date can be found on the engine dataplate.			
Service part availability start date for diamond-like coated tappet roller pin is 02 June 2015.			

Document History

Date	Details
2015-7-15	Module Created