



Technical Service Bulletin

Technical Service Bulletin: TSB180051

Released Date: 12-Jun-2024

New Gear Housing and Fuel Pump Idler Shaft

New Gear Housing and Fuel Pump Idler Shaft

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- ISX15 CM2250 SN
- ISX15 CM2350 X101
- QSX15 CM2250
- QSX15 CM2250 ECF
- QXS15 CM2250 X115
- QXS15 CM2350 X105
- QSX15 CM2350 X106
- X15 CM2350 X114B
- X15 CM2350 X116B
- X15 CM2450 X124B

Description of Change

This document announces the release of a new gear housing and fuel pump idler shaft.

Reason for Change

A new solid lower idler gear and adjustable fuel pump idler were introduced which led to creation of a new gear housing part numbers. To consolidate to one common part numbers of gear housing, a new gear housing, Part Number 5468170, was released to replace the existing part numbers. A new fuel pump idler shaft, Part Number 5484100, (with shallow dowel height) was released and **must** be used to replace the non-adjustable fuel pump idler shaft used with scissor gear arrangements when new housing, Part Number 5468170, is used.

Service Instructions

If replacing gear housing, Part Number 2893208, for use with scissor style lower idler gear and non-adjustable fuel pump idler shaft:

- New gear housing, Part Number 5468170, and new fuel pump idler shaft, Part Number 5484100 **must** be used.

If replacing gear housing, Part Number 3689586, for use with solid lower idler gear and adjustable fuel pump idler shaft:

- New gear housing, Part Number 5468170, **must** be used (reuse adjustable fuel pump idler shaft).

Service Parts Availability

Service parts are available. See Table 1 for part numbers.

Table 1, Service Parts				
Part Description	Existing Part Number	Obsolete	Superseded	New Part Number
Twelve Point Capscrew	3882922	Yes	Yes	4374074
Gear Housing	2893208	Yes	Yes	5468170
Gear Housing	3689586	Yes	Yes	5468170
Fuel Pump Idler Shaft	3686952	Yes	Yes	5484100

Part Compatibility

- The new gear housing, Part Number 5468170, is completely interchangeable and backwards compatible with engines (and associated hardware) built with gear housing, Part Number 3689586.
- If replacing gear housing, Part Number 2893208, new gear housing, Part Number 5468170, and new fuel pump idler shaft, Part Number 5484100, are required.

Part Identification

New gear housing, Part Number 5468170, can be distinguished by the 4mm [5/32 in] deep blind hole where the fuel pump idler shaft dowel fits. See Figure 1.

New fuel pump idler shaft, Part Number 5484100, can be distinguished by dowel protrusion decreased from 6mm [15/64 in] to 3mm [1/8 in]. See Figure 2.

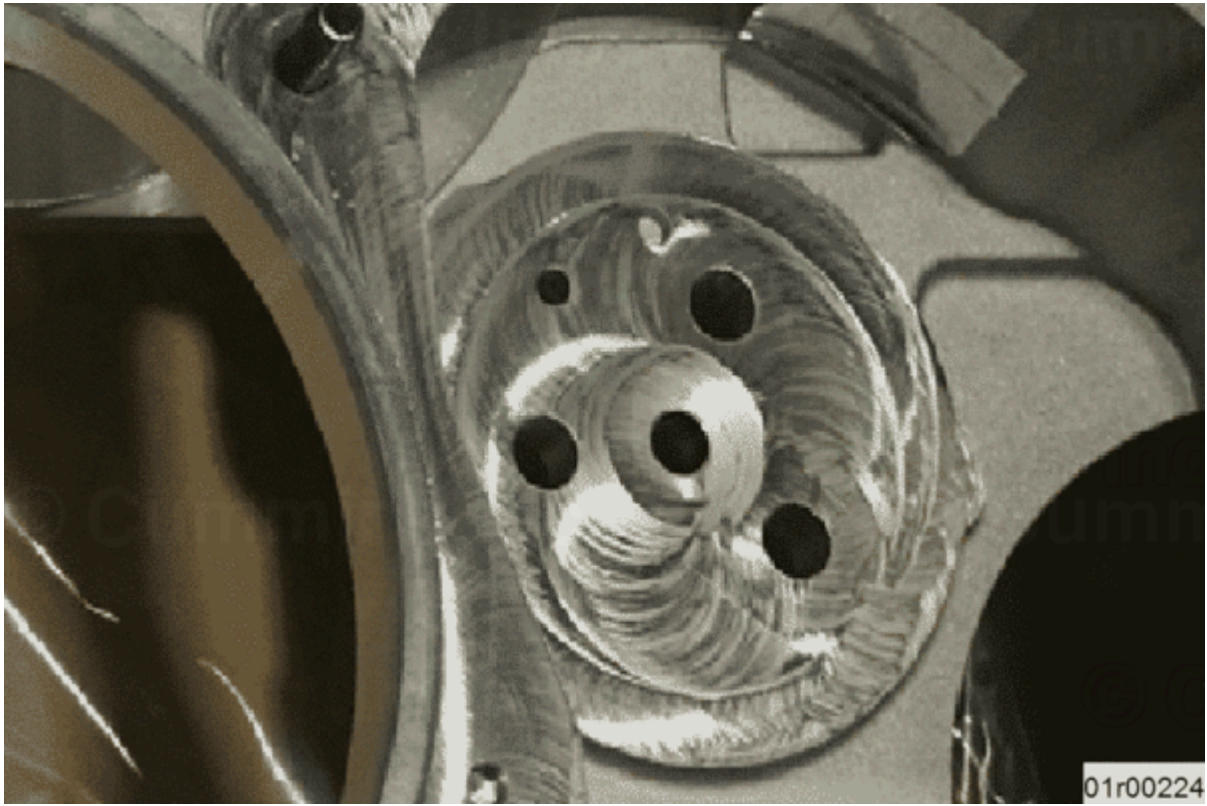


Figure 1, New Gear Housing, Part Number 5468170.

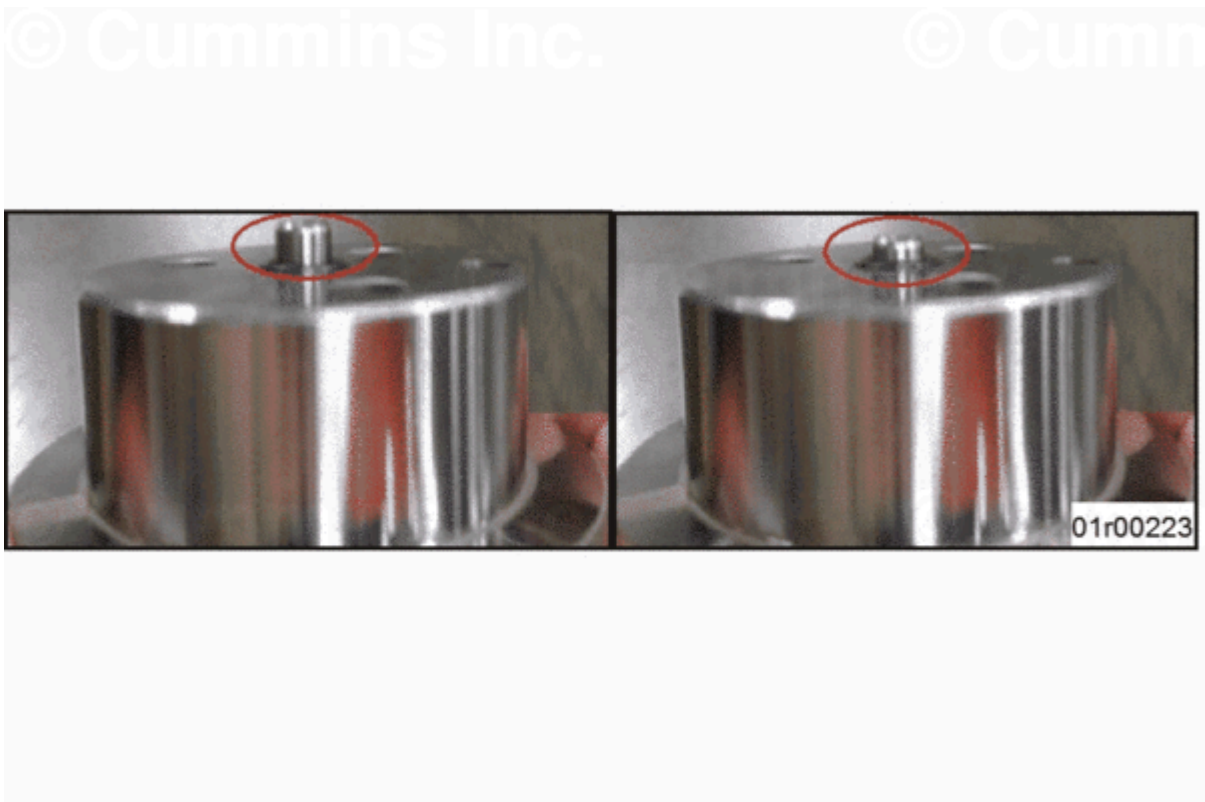


Figure 2, Left: Existing Fuel Pump Idler Shaft, Part Number 3686952. Right: New Fuel Pump Idler Shaft, Part Number 5484100.

Production Status

Implemented for production. See Table 2

Table 2, Production Information		
ESN First	Build Date ¹	Plant
80004985	31 August, 2017	Jamestown Engine Plant
¹ Engine build date can be found on the engine dataplate.		
.		

Document History

Date	Details
2018-4-24	Module Created
2020-1-22	Update to Product Affected List
2024-5-23	Added reference to part number 4374074 in Table 1.
2024-6-12	Minor wording correction table 1.