


Fault Code: 113

Timing Rail Actuator Circuit - Shorted High

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 113 PID(P): SPN: FMI: Lamp: Warning SRT:	Engine timing actuator circuit - shorted high. Timing actuator circuit is open, or the timing rail actuator signal pin is shorted to ground, or the timing rail actuator return pin is shorted to battery.	No action by the ECM is taken. Actuator is open, closed, or partially closed. Engine power output will vary and white smoke can occur. Fault Code 112 can also be logged.

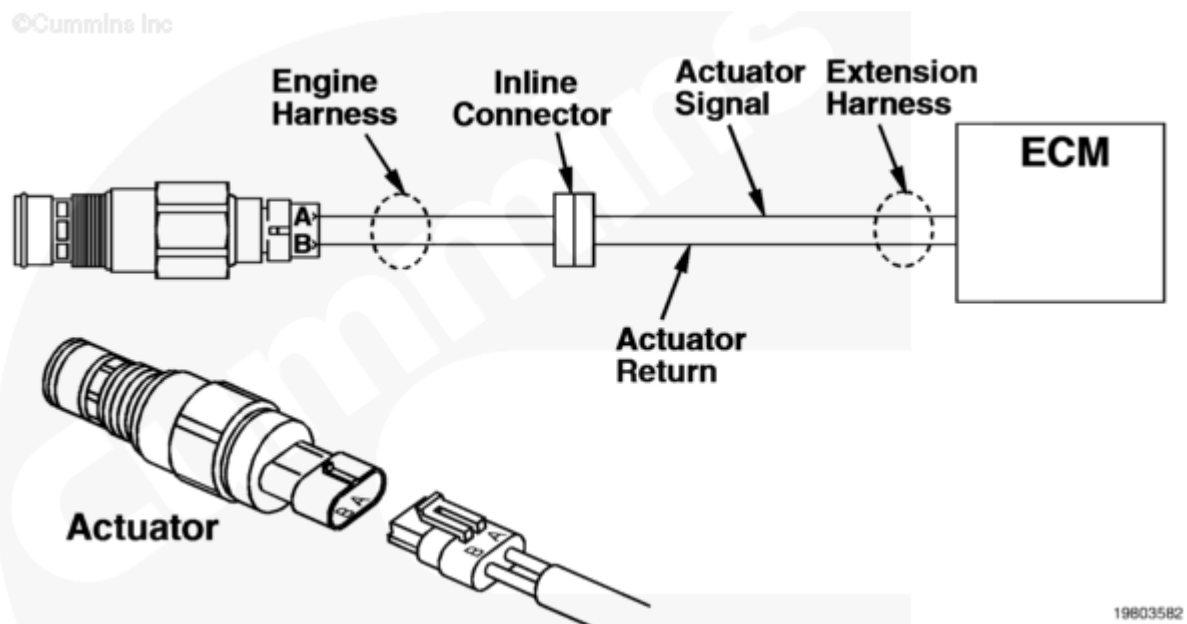

Timing Rail Actuator Circuit

Circuit Description

The timing rail actuator circuit supplies current to the timing rail actuator(s). The engine control module (ECM) commands a varying amount of current to the timing rail actuator to control the amount of timing pressure to the injectors.

Component Location

The timing rail actuators are located at the left side, toward top, of the ECVA.

Shoptalk

Confirm that the actuator connector is firmly in place. When there is power to the actuator(s), the actuator opens. This can cause Fault Code 112, timing flow mismatch.

Refer to Troubleshooting Fault Code t05-113 (</qs3/pubsys2/xml/en/procedures/01/01-t05-113.html>)

Last Modified: 29-Jul-2010
