


Fault Code: 115

Engine Speed/Position Sensor Circuit - Lost Both of Two Signals From the Magnetic Pickup Sensor

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 115 PID(P): SPN: FMI: Lamp: Shutdown SRT:	No engine speed signal detected from the main and backup speed sensors.	Engine is shut down and can not be run.

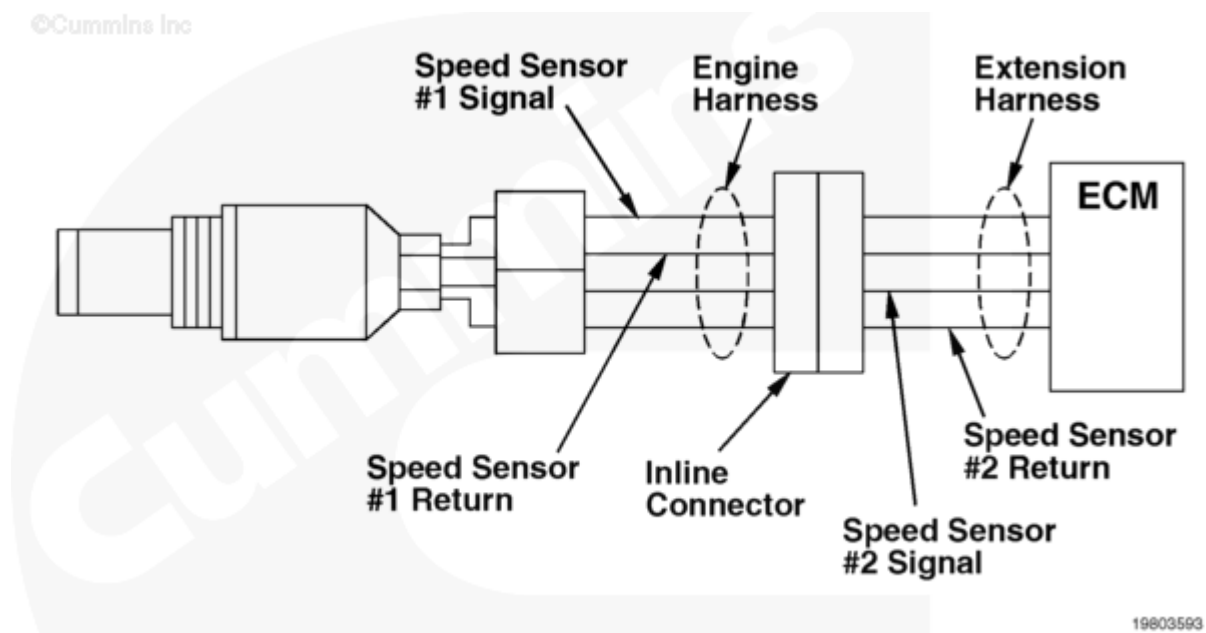

Engine Speed Sensor Circuit

Circuit Description

The engine speed sensor is a dual-coil circuit that provides the engine speed signal to the engine control module (ECM) through the engine harness.

Component Location

Use the following procedure for component location. Refer to Procedure 100-002 in Section E (</qs3/pubsys2/xml/en/procedures/01/01-100-002.html>).

Shoptalk

If the problem occurs **only** at a certain engine temperature, be sure to check the engine speed sensor circuit while the engine is at that particular temperature. Check for correct air gap of engine speed sensor to flywheel tooth. Refer to Procedure 019-042 in Section 19 (</qs3/pubsys2/xml/en/procedures/01/01-019-042.html>). Some speed sensors can use a single Deutsch™ harness connector instead of the two Weather-Pack™ connectors.

Refer to Troubleshooting Fault Code t05-115. (</qs3/pubsys2/xml/en/procedures/01/01-t05-115.html>)

Last Modified: 08-May-2012
