


Fault Code: 116

Fuel Timing Rail Pressure Sensor Circuit - Shorted High

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 116 PID(P): SPN: FMI: Lamp: Shutdown SRT:	Fuel timing pressure sensor circuit - shorted high.	Calibration-dependent engine shutdown occurs, or no action is taken by ECM.

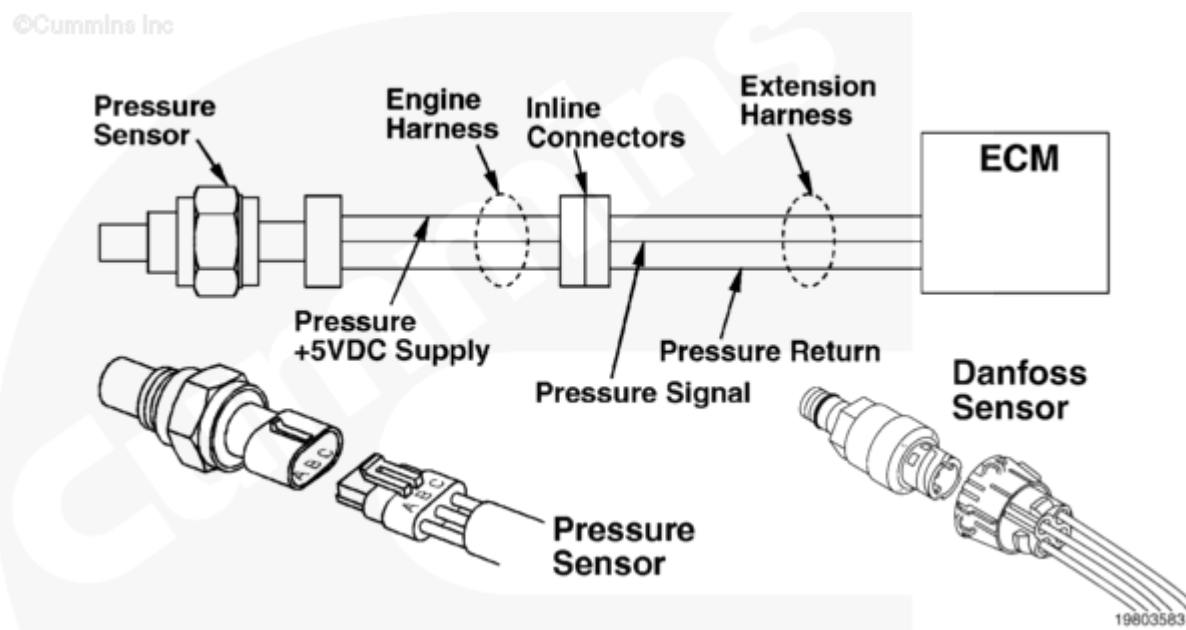

Fuel Timing Rail Pressure Sensor Circuit

Circuit Description

The timing rail pressure sensor provides the timing rail pressure signal to the electronic control module (ECM), through the engine harness. The ECM uses the timing rail pressure signal to monitor the timing rail pressure going to the injector's timing chamber from the control valve body.

Component Location

The timing rail pressure sensor is located on the right-side, toward the top, of the ECVA, across from the timing rail actuators.

Shoptalk

Refer to specific engine wiring diagram for the output voltage of the pressure sensor.

Note: Some engine models will use the Metri-Pack type connector on this pressure sensor, and some will use the Danfoss™ type connector. The Metri-Pack connector pin designators are alpha and the Danfoss™ connector pin designators are numeric. The steps depicted in this fault code show the Metri-Pack type connector with alpha pin call outs. Refer to specific engine wiring diagrams to determine the correct pin designators for the type of connector.

Refer to Troubleshooting Fault Code t05-116 (</qs3/pubsys2/xml/en/procedures/01/01-t05-116.html>)