


## Fault Code: 118

### Fuel Pump Delivery Pressure Sensor Circuit - Shorted High

 Printable Version

#### Overview

| Codes                                                                   | Reason                                                     | Effect                                                       |
|-------------------------------------------------------------------------|------------------------------------------------------------|--------------------------------------------------------------|
| Fault Code: 118<br><br>PID(P):<br>SPN:<br>FMI:<br>Lamp: Warning<br>SRT: | Fuel pump delivery pressure sensor circuit - shorted high. | No action is taken by the ECM. Possible loss of performance. |

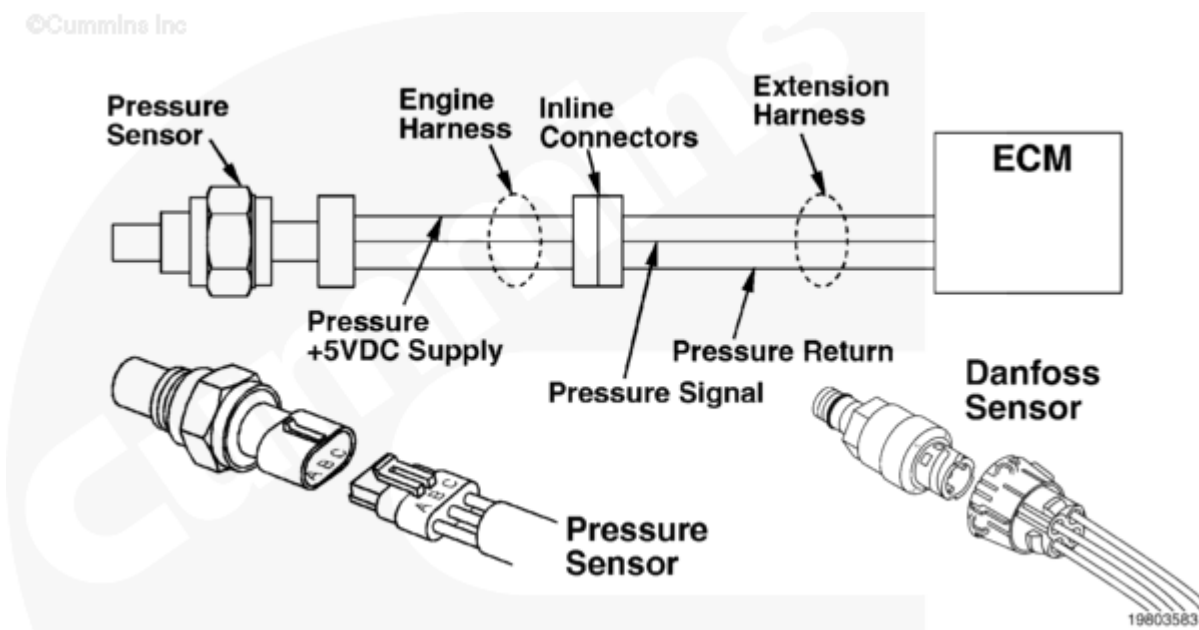

Fuel Pump Pressure Sensor Circuit

#### Circuit Description

The fuel pump pressure sensor provides the fuel pump pressure signal to the ECM, through the engine harness. The ECM uses the fuel pump pressure signal to monitor the fuel pump pressure going to the control valve body.

#### Component Location

The fuel pump pressure sensor is located on the fuel pumps just above the fuel pump actuator.

## Shoptalk

Refer to specific engine wiring diagram for the output voltage of the pressure sensor.

Note: Some engine models will use the Metri-Pack type connector on this pressure sensor, and some will use the Danfoss™ type connector. The Metri-Pack connector pin designators are alpha and the Danfoss™ connector pin designators are numeric. The steps depicted in this fault code show the Metri-Pack type connector with alpha pin callouts. Refer to specific engine wiring diagrams to determine the correct pin designators for the type of connector.

Refer to Troubleshooting Fault Code t05-118 (/qs3/pubsys2/xml/en/procedures/01/01-t05-118.html)

---

**Last Modified: 29-Jul-2010**

---