


Fault Code: 121

Engine Speed/Position Sensor Circuit - Lost One of Two Signals From the Magnetic Pickup Sensor

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 121 PID(P): SPN: FMI: Lamp: Warning SRT:	No engine speed signal detected from either the main or backup speed sensors.	No action by the ECM is taken. No effect on performance.

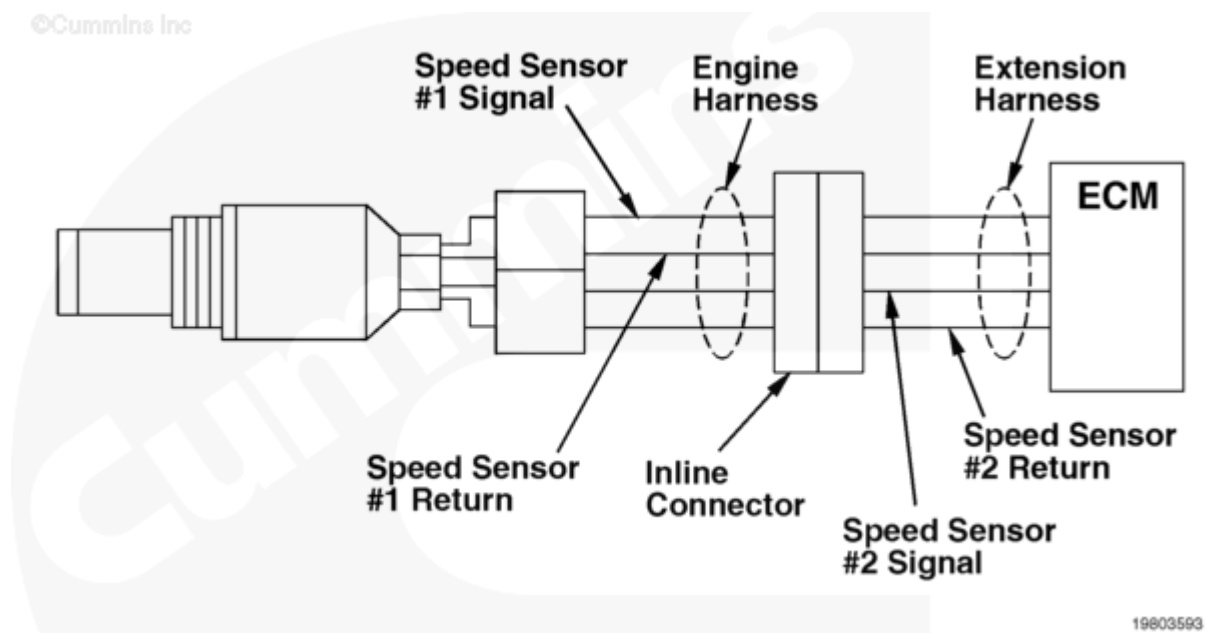

Engine Speed Sensor Circuit

Circuit Description

The engine speed sensor is a dual coil circuit that provides the engine speed signal to the engine control module (ECM) through the engine harness.

Component Location

Refer to Procedure 100-002 in Section E (/qs3/pubsys2/xml/en/procedures/01/01-100-002.html) for the component location.

Shoptalk

If the problem occurs **only** at a certain engine temperature, be sure to check the engine speed sensor circuit while the engine is at that particular temperature. Check for a correct air gap of engine speed sensor to flywheel tooth. Some speed sensors can use a single Deutsch™ harness connector instead of two Weather-Pack™ connectors.

Refer to Troubleshooting Fault Code t05-121. (/qs3/pubsys2/xml/en/procedures/01/01-t05-121.html)

Last Modified: 08-May-2012
