


Fault Code: 129

Intake Manifold Pressure Sensor 2 Circuit - Shorted Low

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 129 PID(P): SPN: FMI: Lamp: Warning SRT:	Intake manifold pressure sensor 2 circuit - shorted low.	No action is taken by the ECM. Possible loss of performance.

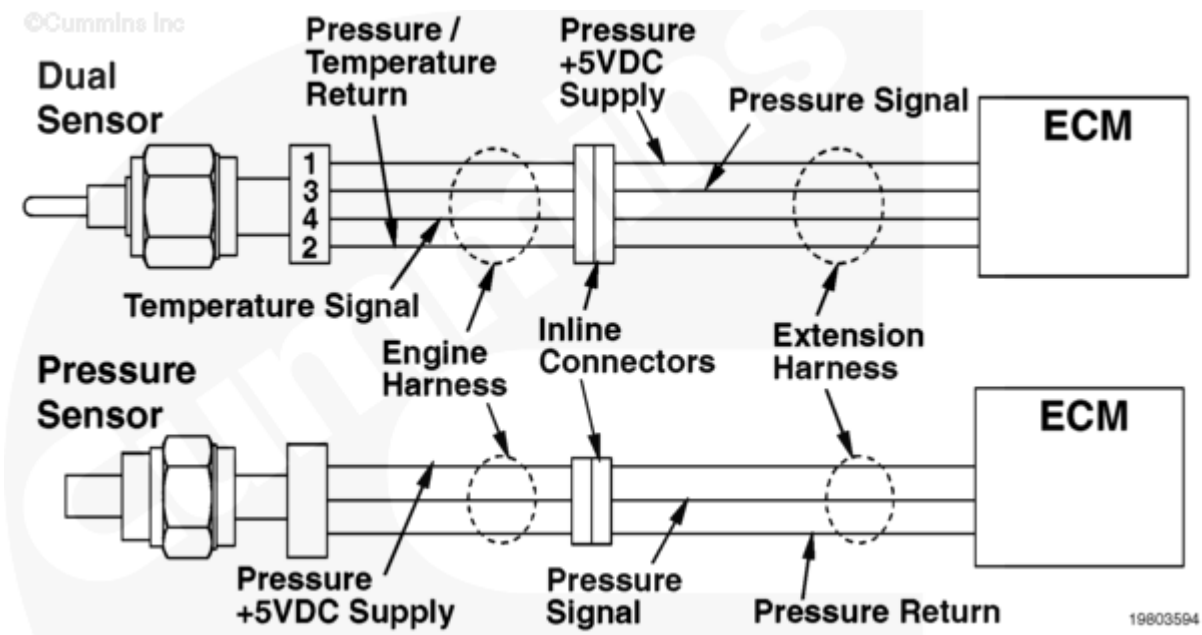

Intake Manifold Pressure Sensor 2 Circuit

Circuit Description

The intake manifold pressure sensor monitors boost pressure and passes information to the electronic control module (ECM). Low voltage will trip Fault Code 129 and can be caused by shorts in the supply, signal, or return wires, an open in the supply or signal wires, low supply voltage from the ECM, or a failed sensor.

Component Location

Refer to the Engine Diagrams. 100-002 (</qs3/pubsys2/xml/en/procedures/01/01-100-002.html>) for the component location.

Shoptalk

Check for high restriction in the intake air manifold due to clogged air filters or a shutdown device in the manifold.

Do **not** remove this device. If the engine is operated in a flammable atmosphere, the device is an essential safety feature.

Make sure the turbocharger is working correctly. Check for a positive intake manifold pressure.

Refer to specific engine wiring diagram for the output voltage of the pressure sensor.

Note: Some engine models will use the Metri-Pack type connector on this pressure sensor, and some will use the Danfoss™ type connector. The Metri-Pack connector pin designators are alpha and the Danfoss™ connector pin designators are numeric. The steps depicted in this fault code show the Metri-Pack type connector with alpha pin callouts. Refer to specific engine wiring diagrams to determine the correct pin designators for the type of connector.

Refer to Troubleshooting Fault Code t05-129 (</qs3/pubsys2/xml/en/procedures/01/01-t05-129.html>)