


Fault Code: 135

Engine Oil Pressure Sensor Circuit - Shorted High

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 135 PID(P): SPN: FMI: Lamp: Warning SRT:	Engine oil pressure sensor is shorted high - shorted high.	No engine protection for oil pressure.

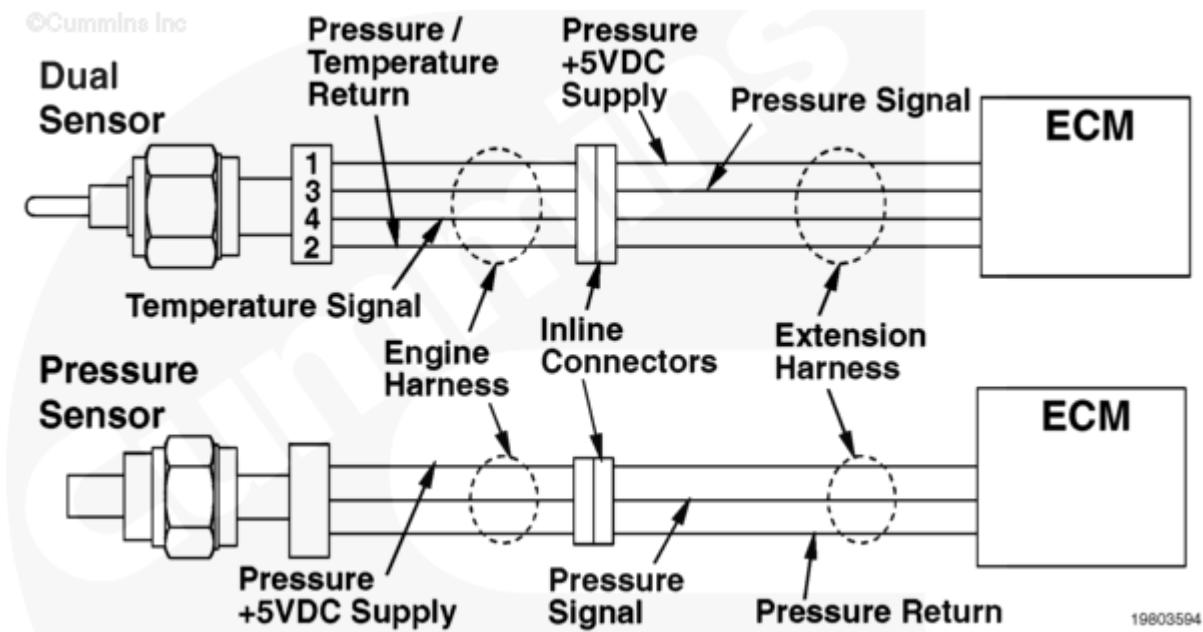

Oil Pressure Sensor Circuit

Circuit Description

The oil pressure sensor monitors oil pressure and passes information to the electronic control module (ECM). The ECM monitors the voltage on the oil pressure signal pin and expects to see the voltage vary between 0.46 and 4.56 VDC during normal engine operation. High voltage will trip Fault Code 135 and can be caused by shorts in the supply, signal, or return wires, an open in the return wire, or a failed sensor.

Component Location

Refer to the Engine Diagrams. 100-002 (</qs3/pubsys2/xml/en/procedures/01/01-100-002.html>) for the component location.

Shoptalk

Does the fault code occur **only** in cold weather? If so, allow the oil to warm up and see if the fault code goes inactive.

Refer to specific engine wiring diagram for the output voltage of the pressure sensor.

Note: Some engine models will use the Metri-Pack type connector on this pressure sensor, and some will use the Danfoss™ type connector. The Metri-Pack connector pin designators are alpha and the Danfoss™ connector pin designators are numeric. The steps depicted in this fault code show the Metri-Pack type connector with alpha pin callouts. Refer to specific engine wiring diagrams to determine the correct pin designators for the type of connector.

Refer to Troubleshooting Fault Code t05-135 (</qs3/pubsys2/xml/en/procedures/01/01-t05-135.html>)