


Fault Code: 154

Intake Manifold Temperature Sensor Number 1 Circuit - Shorted Low

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 154 PID(P): SPN: FMI: Lamp: Warning SRT:	Engine intake manifold temperature sensor signal is shorted low.	No engine protection for the intake manifold temperature. Possible white smoke.

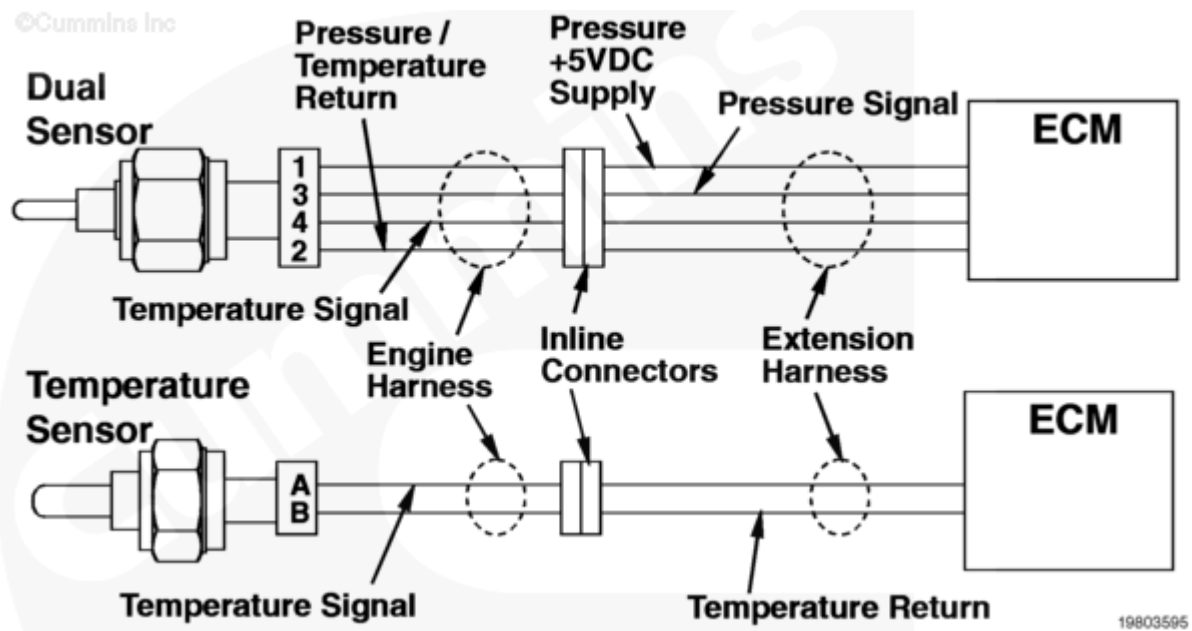

Intake Manifold Temperature Sensor Circuit

Circuit Description

The intake manifold temperature sensor is used by the ECM to monitor the temperature of the air in the intake manifold downstream of the aftercooler element. The intake manifold temperature is used by the ECM for the engine protection system, timing, and fueling control. If the voltage is low, the ECM will log Fault Code 154. Low voltage can be caused by shorts to engine block ground on the supply or return wires or an internally grounded failed sensor.

Component Location

Refer to the Engine Diagrams in Section E of this manual for the component location.

Shoptalk

The resistance of the sensor varies with the temperature.

Refer to Troubleshooting Fault Code t05-154 (</qs3/pubsys2/xml/en/procedures/01/01-t05-154.html>)

Last Modified: 29-Jul-2010
