


Fault Code: 159

Intake Manifold Temperature Sensor Number 2 Circuit - Shorted High

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 159 PID(P): SPN: FMI: Lamp: Warning SRT:	Engine intake manifold temperature sensor signal is shorted high.	No engine protection for the intake manifold air temperature. Possible white smoke.

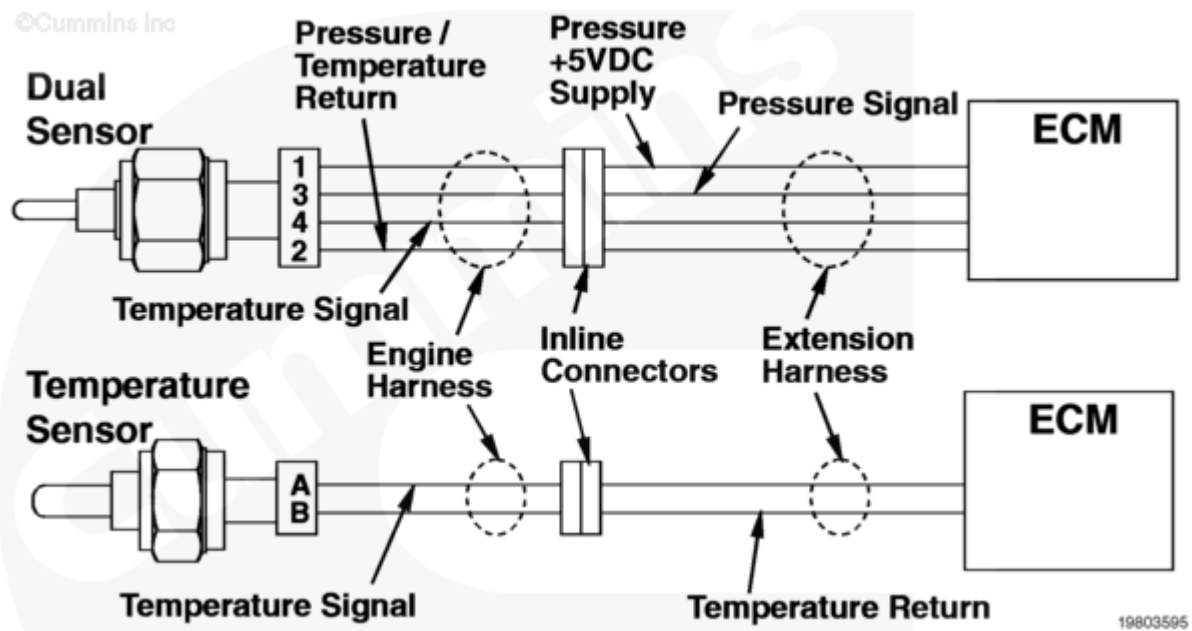

Intake Manifold Temperature Sensor Circuit

Circuit Description

The intake manifold temperature sensor Number 2 is used by the ECM to monitor the temperature of the air in the intake manifold after the aftercooler. The intake manifold temperature sensor Number 2 is used by the ECM for the timing and fueling control. If the voltage is high, the ECM will log Fault Code 159. Voltage high can be caused by opens in the signal or return wires, voltage shorts to the signal or return wires, or a failed open sensor.

Component Location

Refer to the Engine Diagrams in Section E of this manual for the component location.

Shoptalk

The resistance of the sensor varies with the temperature.

Refer to Troubleshooting Fault Code t05-159 (</qs3/pubsys2/xml/en/procedures/01/01-t05-159.html>)

Last Modified: 29-Jul-2010
