


Fault Code: 2111

Aftercooler Water Inlet Temperature Sensor - Shorted High

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 2111 PID(P): SPN: FMI: Lamp: Warning SRT:	Engine coolant temperature 2 sensor circuit - shorted high. This was formerly called the aftercooler water inlet temperature sensor.	No engine protection for aftercooler water inlet temperature.

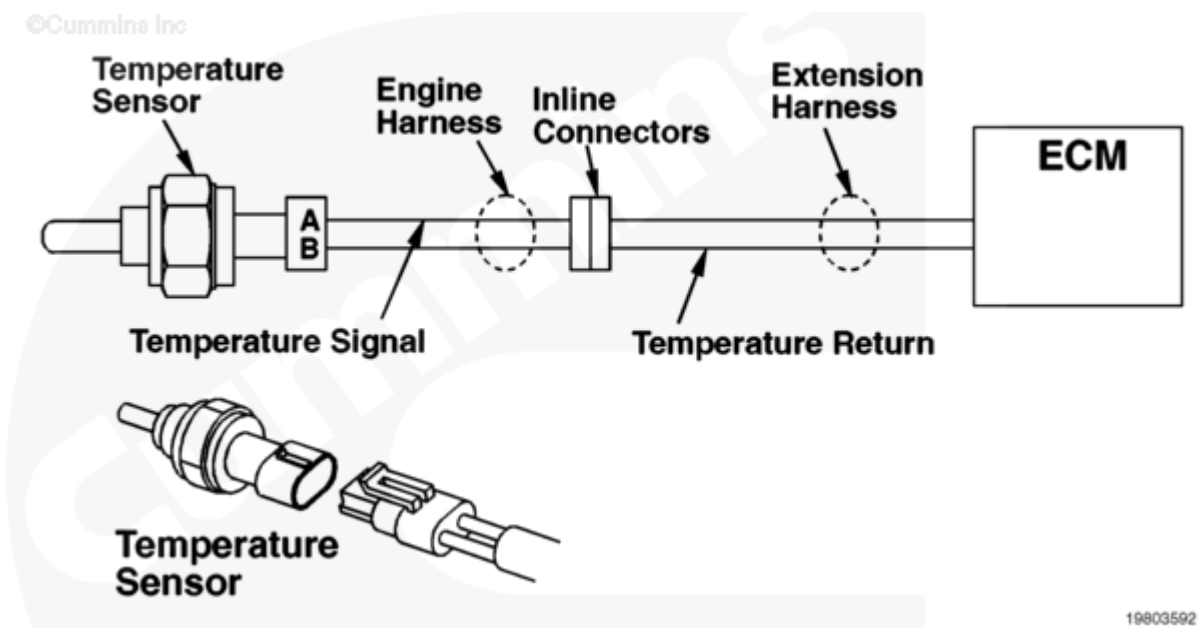

Aftercooler Water Inlet Temperature Sensor Circuit

Circuit Description

The aftercooler water inlet temperature sensor is used by the electronic control module (ECM) to monitor the ability of the engine cooling system to cool down the engine coolant. The aftercooler water inlet temperature is used by the ECM for the engine protection system. The ECM monitors the voltage on the aftercooler water inlet temperature signal pin and expects to see a voltage

vary between 0.5 to 4.5 VDC during normal engine operation. High voltage will trip Fault Code 2111 and can be caused by shorts in the signal, or return wires, an open in the return wire, or a failed sensor.

Component Location

Refer to Procedure 100-002 (</qs3/pubsys2/xml/en/procedures/01/01-100-002.html>) for the component location.

Shoptalk

The possible failure modes are open circuit, short to battery positive (+), failed sensor, and loss of supply voltage inside the ECM. The resistance of the sensor varies with the temperature.

Refer to Troubleshooting Fault Code t05-2111 (</qs3/pubsys2/xml/en/procedures/01/01-t05-2111.html>)