


Fault Code: 221

Barometric Pressure Sensor Circuit - Shorted High

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 221 PID(P): SPN: FMI: Lamp: Warning SRT:	Barometric pressure sensor circuit - shorted high.	No action is taken by the ECM. Possible loss of performance.

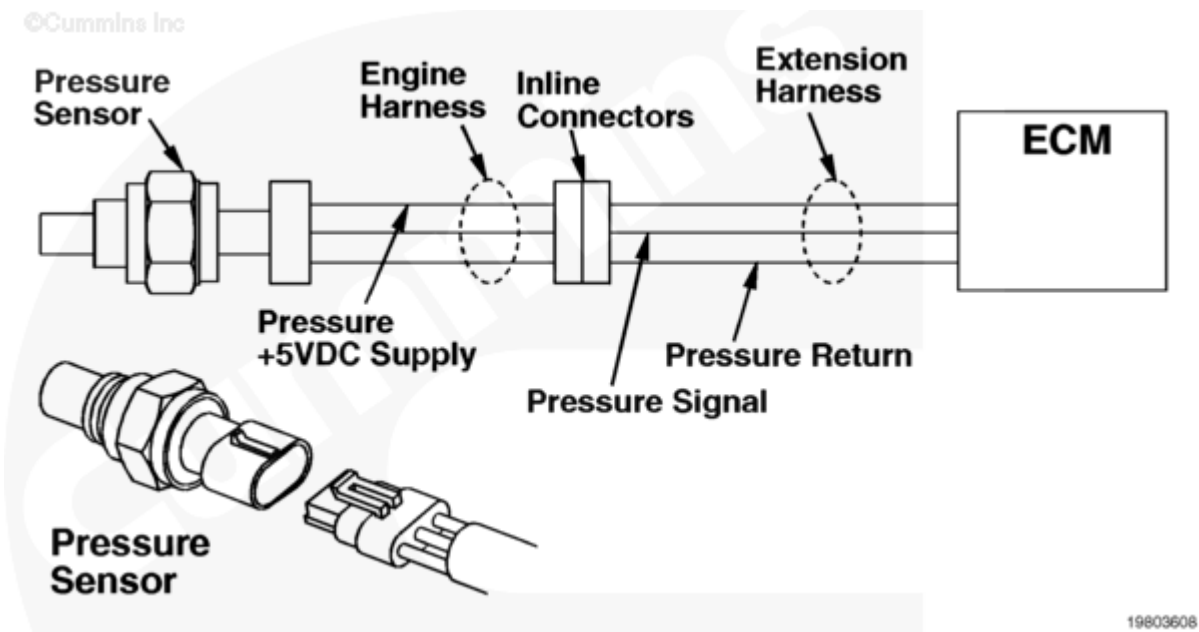

Barometric Pressure Sensor Circuit

Circuit Description

This troubleshooting tree is intended for troubleshooting absolute pressure sensors **only**. The barometric pressure sensor monitors barometric pressure and passes information to the electronic control module (ECM). The ECM uses the barometric pressure sensor to adjust fueling based on the altitude.

Component Location

Refer to the Engine Diagrams. 100-002 (</qs3/pubsys2/xml/en/procedures/01/01-100-002.html>) for the component location.

Shoptalk

Monitor the barometric pressure reading with an electronic service tool to confirm that the pressure reading matches the actual air pressure.

Refer to specific engine wiring diagram for the output voltage of the pressure sensor.

Note: Some engine models will use the Metri-Pack type connector on this pressure sensor, and some will use the Danfoss™ type connector. The Metri-Pack connector pin designators are alpha and the Danfoss™ connector pin designators are numeric. The steps depicted in this fault code show the Metri-Pack type connector with alpha pin callouts. Refer to specific engine wiring diagrams to determine the correct pin designators for the type of connector.

The following shows the typical PSIA pressure values for the corresponding altitude values:

Altitude (ft)	PSIA
0	14.45
3000	13.17
6000	11.78
9000	10.50
12000	9.35

Refer to Troubleshooting Fault Code t05-221 (</qs3/pubsys2/xml/en/procedures/01/01-t05-221.html>)